

Part 573 Safety Recall Report

24V-364

Manufacturer Name : Jaguar Land Rover North America, LLC**Submission Date :** MAY 24, 2024**NHTSA Recall No. :** 24V-364**Manufacturer Recall No. :** N901**Manufacturer Information :****Population :**

Manufacturer Name : Jaguar Land Rover North America, LLC

Number of potentially involved : 22,268

Address : 100 Jaguar Land Rover Way

Estimated percentage with defect : 100 %

Mahwah NJ 07495

Company phone : 8188500

Vehicle Information :

Vehicle 1 : 2018-2022 LAND ROVER RANGE ROVER SPORT

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : NR

Descriptive Information : Jaguar Land Rover is conducting a non-compliance recall campaign involving certain 2018-2022MY Land Rover Range Rover Sport vehicles built at the Solihull Vehicle Assembly Plant from May 25, 2017 - April 28, 2022. 22,268 Land Rover Range Rover Sport vehicles in the United States and Federalized Territories. The basis for the recall population has been determined as all the Range Rover Sport vehicles eligible for the previous N778 safety recall that recalled the Land Rover Range Rover Sport vehicles fitted with the "Surround Camera System", specifically the Gen 3 Continental reversing camera.

Production Dates : MAY 25, 2017 - APR 28, 2022

VIN Range 1 : Begin : SALWR4RY1JA155922 End : SALWZ2RE8NA799997 Not sequential**Description of Noncompliance :**

Description of the Noncompliance : A concern has been identified on certain Range Rover Sport vehicles equipped with the "Surround Camera System" where the reversing camera will display a poor image or no image at all as a result of water ingress into the camera housing/bezel. Certain Range Range Rover Sport vehicles were incorrectly repaired where repair instructions for Range Rover were followed. These instructions did not provide a permanent remedy for Range Rover Sport vehicles.

To ensure correct remedy actions are completed for the entire affected Range Rover Sport population, N901 safety recall is being launched.

FMVSS 1 : 111 - Rear visibility

FMVSS 2 : NR

Description of the Safety Risk : In an intermittent or failed state the rear camera image display does not meet the requirements of Motor Vehicle Safety Standard No. 111, Rear Visibility. Lack of display of the rear camera image may result in the driver being unaware of objects or pedestrians behind the vehicle increasing the risk of a crash.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

Involved Components :

Component Name 1 : Camera - Rear Facing Lower Continental Hi-Line Cam

Component Description : Camera - Rear Facing

Component Part Number : JPLA-19H422-AB

Supplier Identification :

Component Manufacturer

Name : Continental Teves AG& Co. oHG

Address : Wilhelm-Fay Straße 30
Frankfurt/Main Foreign States 65936

Country : Germany

Chronology :

Provide the chronology of events leading up to the defect decision or test data for the noncompliance decision.:
See File "Recall N901 Chronology".

Description of Remedy :

Description of Remedy Program : Vehicles will have the rear camera will be removed and inspected. If the camera is found to be OK, it will be refitted with a new seal. If the camera is found to not be OK, a new camera will be fitted along with the new seal and a 10-minute calibration drive cycle will be carried out.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Notifications to dealers will occur on June 6, 2024. Distribution of owner notification letters will occur on or before July 19, 2024.

Planned Dealer Notification Date : JUN 06, 2024 - JUN 06, 2024

Planned Owner Notification Date : JUL 19, 2024 - JUL 19, 2024

* NR - Not Reported