Part 573 Safety Recall Report

Manufacturer Name :Rivian Automotive, LLCSubmission Date :JUN 05, 2024NHTSA Recall No. :24V-408Manufacturer Recall No. :FSAM-1464

Manufacturer Information :

Manufacturer Name : Rivian Automotive, LLC Address : 13250 North Haggerty Road PLYMOUTH MI 48170 Company phone : 999

Vehicle Information :

Vehicle 1: 2022-2024 Rivian R1T Vehicle Type: LIGHT VEHICLES Body Style: PICKUP TRUCK Power Train: NR Descriptive Information: The recall population includes certain Model Year 2022, 2023, and 2024 R1T and R1S vehicles that may have been serviced in such a way that the upper B pillar trim panel on R1Ts, and upper B and/or C pillar trim panel on R1Ss does not meet current production specifications. The suspect period began on October 20, 2021, when Rivian started to service vehicles incorrectly and ended on May 31, 2024, when Rivian stopped servicing vehicles incorrectly. That population was determined using manufacturing records. Similar R1T vehicles not included in this recall have never had upper B pillar trim service conducted; similar R1S vehicles not included in this recall have never had upper B and/or C pillar trim panel service, were confirmed to have had the part(s) correctly replaced during that service. Production Dates : AUG 13, 2021 - APR 02, 2024 VIN Range 1 : Begin : NR End : NR Int sequential						
Body Style :PICKUP TRUCKPower Train :NRDescriptive Information :The recall population includes certain Model Year 2022, 2023, and 2024 R1T and R1S vehicles that may have been serviced in such a way that the upper B pillar trim panel on R1Ts, and upper B and/or C pillar trim panel on R1Ss does not meet current production specifications. The suspect period began on October 20, 2021, when Rivian started to service vehicles incorrectly and ended on May 31, 2024, when Rivian stopped servicing vehicles incorrectly. That population was determined using manufacturing records.Production Dates :Similar R1T vehicles not included in this recall have never had upper B and/or C pillar trim service conducted; or the R1T and R1S vehicles that had upper B and/or C pillar trim panel service, were confirmed to have had the part(s) correctly replaced during that service.Production Dates :AUG 13, 2021 - APR 02, 2024	Vehicle 1:	2022-2024 Rivian R	21T			
Power Train :NRDescriptive Information :The recall population includes certain Model Year 2022, 2023, and 2024 R1T and R1S vehicles that may have been serviced in such a way that the upper B pillar trim panel on R1Ts, and upper B and/or C pillar trim panel on R1Ss does not meet current production specifications. The suspect period began on October 20, 2021, when Rivian started to service vehicles incorrectly and ended on May 31, 2024, when Rivian stopped servicing vehicles incorrectly. That population was determined using manufacturing records.Similar R1T vehicles not included in this recall have never had upper B pillar trim service conducted; similar R1S vehicles not included in this recall have never had upper B and/or C pillar trim service conducted; or the R1T and R1S vehicles that had upper B and/or C pillar trim panel service, were confirmed to have had the part(s) correctly replaced during that service.Production Dates :AUG 13, 2021 - APR 02, 2024	Vehicle Type :	LIGHT VEHICLES				
Descriptive Information :The recall population includes certain Model Year 2022, 2023, and 2024 R1T and R1S vehicles that may have been serviced in such a way that the upper B pillar trim panel on R1Ts, and upper B and/or C pillar trim panel on R1Ss does not meet current production specifications. The suspect period began on October 20, 2021, when Rivian started to service vehicles incorrectly and ended on May 31, 2024, when Rivian stopped servicing vehicles incorrectly. That population was determined using manufacturing records.Binlar R1T vehicles not included in this recall have never had upper B pillar trim service conducted; similar R1S vehicles not included in this recall have never had upper B and/or C pillar trim panel service, were confirmed to have had the part(s) correctly replaced during that service.Production Dates :AUG 13, 2021 - APR 02, 2024	Body Style :					
 vehicles that may have been serviced in such a way that the upper B pillar trim panel on R1Ts, and upper B and/or C pillar trim panel on R1Ss does not meet current production specifications. The suspect period began on October 20, 2021, when Rivian started to service vehicles incorrectly and ended on May 31, 2024, when Rivian stopped servicing vehicles incorrectly. That population was determined using manufacturing records. Similar R1T vehicles not included in this recall have never had upper B pillar trim service conducted; similar R1S vehicles not included in this recall have never had upper B and/or C pillar trim service conducted; or the R1T and R1S vehicles that had upper B and/or C pillar trim panel service, were confirmed to have had the part(s) correctly replaced during that service. Production Dates : AUG 13, 2021 - APR 02, 2024 	Power Train :	NR				
	Descriptive Information :	vehicles that may ha on R1Ts, and upper production specifica Rivian started to sen stopped servicing ve manufacturing reco Similar R1T vehicles service conducted; s upper B and/or C pi upper B and/or C pi	ave been serviced B and/or C pillar ations. The suspect rvice vehicles incorrectly rds. s not included in t similar R1S vehicl illar trim service c illar trim panel service	in such a way that the trim panel on R1Ss doo t period began on Octo prrectly and ended on N 7. That population was his recall have never h es not included in this onducted; or the R1T a cvice, were confirmed t	upper B pillar trim panel es not meet current ober 20, 2021, when May 31, 2024, when Rivian determined using ad upper B pillar trim recall have never had and R1S vehicles that had	
VIN Range 1 : Begin : NR End : NR 🗌 Not sequential	Production Dates :	AUG 13, 2021 - APR	02, 2024			
	VIN Range 1:	Begin : NI	R End	: NR	□ Not sequential	

The information contained in this report was submitted pursuant to 49 CFR §573



Number of potentially involved : 1,723

Estimated percentage with defect : 100 %

Population :

24V-408

Part 573 Safety Recall Report

Vehicle 2:	2022-2024 Rivian R1S				
Vehicle Type :					
Body Style :	JV				
Power Train :					
	he recall population includes certain Model Year 2022, 2023, and 2024 R1T and R1S chicles that may have been serviced in such a way that the upper B pillar trim panel in R1Ts, and upper B and/or C pillar trim panel on R1Ss does not meet current roduction specifications. The suspect period began on October 20, 2021, when twian started to service vehicles incorrectly and ended on May 31, 2024, when Rivian opped servicing vehicles incorrectly. That population was determined using anufacturing records.				
	never had upper B pillar trim in this recall have never had e R1T and R1S vehicles that had irmed to have had the part(s)				
Production Dates :	AUG 13, 2021 - APR 02, 202	24			
Production Dates : VIN Range 1 : F		End: NR	☐ Not sequential		
VIN Range 1 : F	egin : NR : Rivian has determined to and 2024 R1T and R1S removed and then reuse new component. Remove clip(s) that secure the to are potentially impacted	End : NR that during service of certa vehicles the upper pillar the ed instead of being remov- val and reuse may result in rim panel to the pillar. For	☐ Not sequential ain model year 2022, 2023, rim panel(s) may have been ed and replaced with a brand- n damage to the attachment R1T only the upper B-pillars d/or C-pillars are potentially		
VIN Range 1 : F	egin : NR Rivian has determined to and 2024 R1T and R1S removed and then reuse new component. Removed clip(s) that secure the to are potentially impacted impacted.	End : NR that during service of certa vehicles the upper pillar the ed instead of being remov- val and reuse may result in rim panel to the pillar. For	ain model year 2022, 2023, rim panel(s) may have been ed and replaced with a brand- n damage to the attachment FR1T only the upper B-pillars		
VIN Range 1 : F Description of Defect : Description of the Defect FMVSS	egin : NR : Rivian has determined to and 2024 R1T and R1S removed and then reuse new component. Removed clip(s) that secure the to are potentially impacted impacted. : NR	End : NR that during service of certa vehicles the upper pillar the ed instead of being remov- val and reuse may result in rim panel to the pillar. For	ain model year 2022, 2023, rim panel(s) may have been ed and replaced with a brand- n damage to the attachment FR1T only the upper B-pillars		
VIN Range 1 : F Description of Defect : Description of the Defect FMVSS FMVSS	egin : NR Rivian has determined to and 2024 R1T and R1S removed and then reuse new component. Removed clip(s) that secure the tr are potentially impacted impacted. NR NR	End : NR that during service of certa vehicles the upper pillar to ed instead of being remove val and reuse may result in rim panel to the pillar. For d. For R1S the upper B and	ain model year 2022, 2023, rim panel(s) may have been ed and replaced with a brand- n damage to the attachment R1T only the upper B-pillars d/or C-pillars are potentially		
VIN Range 1 : F Description of Defect : Description of the Defect FMVSS FMVSS Description of the Safety Ris	egin : NR Rivian has determined to and 2024 R1T and R1S removed and then reuse new component. Removed clip(s) that secure the tr are potentially impacted impacted. NR NR Damaged upper B and/ an improper side air bat the risk of occupant inju	End : NR that during service of certa vehicles the upper pillar to ed instead of being remove val and reuse may result in rim panel to the pillar. For d. For R1S the upper B and or C pillar trim panel attac	ain model year 2022, 2023, rim panel(s) may have been ed and replaced with a brand- n damage to the attachment R1T only the upper B-pillars d/or C-pillars are potentially		
VIN Range 1 : F Description of Defect : Description of the Defect FMVSS FMVSS	egin : NR Rivian has determined to and 2024 R1T and R1S removed and then reuse new component. Removed clip(s) that secure the tr are potentially impacted impacted. NR NR Damaged upper B and/ an improper side air bat the risk of occupant inju	End : NR that during service of certa vehicles the upper pillar to ed instead of being remov- val and reuse may result in rim panel to the pillar. For d. For R1S the upper B and or C pillar trim panel attac g inflatable curtain deploy	ain model year 2022, 2023, rim panel(s) may have been ed and replaced with a brand- n damage to the attachment R1T only the upper B-pillars d/or C-pillars are potentially		

Involved Components :

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

24V-408

Component Name 1 : PANEL - B-PILLAR, PANEL - C-PILLAR; Component Description : UPR LH, UPR RH

Component Part Number : PT00427868, PT00427866, PT00003438, PT00003439

Supplier Identification :

Component Manufacturer

Name : NR Address : NR NR Country : NR

Chronology :

On April 18, 2024, the Rivian Field Performance Engineering team was made aware that upper B and/or C trim pillar panels were potentially being reused, instead of replaced, during service and an investigation began.

From April 18, 2024, to May 30, 2024, Rivian conducted the investigation and identified the potentially affected vehicles.

On May 30, 2024, Rivian, out of an abundance of caution, determined that a safety-related defect may exist related to this matter.

As of the date of this filing, Rivian is not aware of any accidents, injuries, warranty claims, or field reports related to this issue in any market.

The information contained in this report was submitted pursuant to 49 CFR \$573

Description of Remedy :

Description of Remedy Program :	Rivian will remove the potentially affected pillar trim panel(s) and replace them with new parts.		
	Rivian is committed to reimbursing owners for previous out-of-pocket repairs according to the plan submitted to the agency on May 10, 2022; however, systems affected by this recall are covered under Rivian's new vehicle limited warranties. Rivian only began releasing vehicles to customers at the end of 2021. As no owners of these vehicles would have reached the end of the warranty period and therefore not incurred expenses for the warranted repair as a result of this condition, no notification regarding reimbursement under section 577.11 is necessary.		
	Rivian has a policy and practice of reimbursing owners who have paid for a repair that subsequently becomes the subject of a field action. To ensure consistency, Rivian, as part of the owner letter, will request that customers send the original receipt and/or other adequate proof of payment to the company for confirmation of the expense.		
	The remedy component will be a brand-new pillar trim panel that has not potentially been damaged by reuse.		
Identify How/When Recall Condition was Corrected in Production :	NR		
Recall Schedule :			
Description of Recall Schedule :	We will mail notifications on or before July 26, 2024. As a direct-to consumer manufacturer, Rivian owns and operates all of the Company's sales and service operations. As all "dealers" are Rivian owned entities, notification will be through internal means to our licensed store and service operations addressing this recall on or before		

Planned Dealer Notification Date :JUL 26, 2024 - JUL 26, 2024Planned Owner Notification Date :JUL 26, 2024 - JUL 26, 2024

* NR - Not Reported