

# Part 573 Safety Recall Report

# 24V-450

**Manufacturer Name :** Jaguar Land Rover North America, LLC**Submission Date :** NOV 07, 2024**NHTSA Recall No. :** 24V-450**Manufacturer Recall No. :** N908**Manufacturer Information :****Population :**

Manufacturer Name : Jaguar Land Rover North America, LLC

Number of potentially involved : 2,013

Address : 100 Jaguar Land Rover Way

Estimated percentage with defect : 100 %

Mahwah NJ 07495

Company phone : 8188500

**Vehicle Information :**

Vehicle 1 : 2023-2024 LAND ROVER DEFENDER

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

**Descriptive Information :** Jaguar Land Rover is conducting a voluntary safety recall campaign involving certain 2023MY - 2024MY Land Rover Defender vehicles built at the Nitra Vehicle Assembly Plant from March 31, 2022, - February 27, 2024. 911 Land Rover Defender vehicles in the United States and Federalized Territories. The basis for the recall population was Land Rover Defender vehicles determined to be fitted with any engines which passed through the oil filter housing installation station during the at-risk period. In addition, a number of engines have been identified to have been supplied to the aftermarket parts organization as replacement parts. A small number of these engines have been identified as having been fitted into vehicles and the replacement engine serial number recorded as part of a warranty claim. These vehicles are being added into this recall.

Production Dates : MAR 31, 2022 - FEB 27, 2024

VIN Range 1 : Begin : SALEX7EU9P2120697 End : SALE27EUXR2316469  Not sequential

Vehicle 2 : 2024-2024 LAND ROVER DISCOVERY

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

**Descriptive Information :** Jaguar Land Rover is conducting a voluntary safety recall campaign involving certain 2024MY Land Rover Discovery vehicles built at the Nitra Vehicle Assembly Plant from November 30, 2023, - January 10, 2024. 235 Land Rover Discovery vehicles in the United States and Federalized Territories. The basis for the recall population was Land Rover Discovery vehicles determined to be fitted with any engines which passed through the oil filter housing installation station during the at-risk period.

Production Dates : NOV 30, 2023 - JAN 10, 2024

VIN Range 1 : Begin : SALRW4EUXR2494046 End : SALRL4EU1R2496020  Not sequential

Vehicle 3 : 2024-2024 LAND ROVER RANGE ROVER

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

**Descriptive Information :** Jaguar Land Rover is conducting a voluntary safety recall campaign involving certain 2024MY Land Rover Discovery vehicles built at the Solihull Vehicle Assembly Plant from November 6, 2023, - December 21, 2023. 304 Land Rover Range Rover vehicles in the United States and Federalized Territories. The basis for the recall population was Land Rover Range Rover vehicles determined to be fitted with any engines which passed through the oil filter housing installation station during the at-risk period. In addition, a number of engines have been identified to have been supplied to the aftermarket parts organization as replacement parts. A small number of these engines have been identified as having been fitted into vehicles and the replacement engine serial number recorded as part of a warranty claim. These vehicles are being added into this recall.

**Production Dates :** NOV 06, 2023 - DEC 22, 2023

**VIN Range 1 :** Begin : SALK19F43RA202268 End : SALK19F42RA212631  Not sequential

Vehicle 4 : 2024-2024 LAND ROVER RANGE ROVER SPORT

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

**Descriptive Information :** Jaguar Land Rover is conducting a voluntary safety recall campaign involving certain 2024MY Land Rover Range Rover Sport vehicles built at the Solihull Vehicle Assembly Plant from November 29, 2023, - December 21, 2023. 500 Land Rover Range Rover Sport vehicles in the United States and Federalized Territories. The basis for the recall population was Land Rover Range Rover Sport vehicles determined to be fitted with any engines which passed through the oil filter housing installation station during the at-risk period.

**Production Dates :** NOV 28, 2023 - JAN 09, 2024

**VIN Range 1 :** Begin : SAL1L9FU7RA174786 End : SAL1L9FU6RA181809  Not sequential

Vehicle 5 : 2024-2024 LAND ROVER RANGE ROVER VELAR

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

**Descriptive Information :** Jaguar Land Rover is conducting a voluntary safety recall campaign involving certain 2024MY Land Rover Range Rover Velar vehicles built at the Solihull Vehicle Assembly Plant from December 4, 2023 - December 18, 2023. 47 Land Rover Range Rover Velar vehicles in the United States and Federalized Territories. The basis for the recall population was Land Rover Range Rover Velar vehicles determined to be fitted with any engines which passed through the oil filter housing installation station during the at-risk period.

Production Dates : DEC 04, 2023 - DEC 19, 2023

VIN Range 1 : Begin : SALYM2FU7RA387546 End : SALYL2FUXRA389052  Not sequential

## Description of Defect :

**Description of the Defect :** A concern has been identified where the incorrect specification of plastic was used to manufacture the oil filter housing. The incorrect specification plastic housing will, over time and with vehicle use, crack allowing oil to leak out onto the engine and into the engine bay.

FMVSS 1 : NR

FMVSS 2 : NR

**Description of the Safety Risk :** An oil leak under pressure in this area could result in oil coming into contact with hot components on the engine which may result in a fire. Additionally, oil may leak onto the road surface posing a skid hazard to other road users especially two-wheeled vehicles.

**Description of the Cause :** NR

**Identification of Any Warning that can Occur :** NR

## Involved Components :

Component Name 1 : Oil filter housing

Component Description : Oil filter housing

Component Part Number : Oil filter housing – J6P3-6714-AB

**Supplier Identification :****Component Manufacturer**

Name : PurFlux Filtration Ltd (previously Sogef)  
Address : Crown Business Park  
Tredegar- Blaenau Gwent Foreign States NP22 4EF  
Country : United Kingdom

**Chronology :**

See File "Recall N908 Chronology 10OCT24".

**Description of Remedy :**

Description of Remedy Program : Vehicles will have the oil filter housing, complete with filter and associated o-rings, replaced. There will be no charge to the owners for this repair. The affected vehicles will be covered under Jaguar Land Rover's new vehicle warranty program. Therefore, reimbursement for pre-notice remedies is not necessary because the affected vehicles are still under warranty.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

**Recall Schedule :**

Description of Recall Schedule : Notifications to dealers actually occurred on June 14, 2024. Distribution of owner notification letters will occur on or before August 9, 2024. For vehicles added to recall, owner notification letters were sent to owners on October 31, 2024.

Planned Dealer Notification Date : JUN 17, 2024 - JUN 17, 2024

Planned Owner Notification Date : AUG 09, 2024 - OCT 31, 2024

\* NR - Not Reported