

Part 573 Safety Recall Report

24V-562

Manufacturer Name : Hyundai Motor America**Submission Date :** JUL 25, 2024**NHTSA Recall No. :** 24V-562**Manufacturer Recall No. :** 266**Manufacturer Information :**

Manufacturer Name : Hyundai Motor America

Address : 10550 Talbert Avenue

Fountain Valley CA 92708

Company phone : 800-633-5151

Population :

Number of potentially involved : 12,612

Estimated percentage with defect : 1 %

Vehicle Information :

Vehicle 1 : 2010-2013 Hyundai Genesis Coupe

Vehicle Type : LIGHT VEHICLES

Body Style : 2-DOOR

Power Train : GAS

Descriptive Information : Based on manufacturing and sales records, the subject vehicles include certain model year 2010-2013 Hyundai Genesis Coupe vehicles produced on the specified dates by Hyundai Motor Company ("HMC") for sale in the U.S. market. Other than those listed in this report, no other Hyundai/Genesis vehicles use the same structure being recalled.

Production Dates : DEC 19, 2008 - APR 09, 2012

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : The ignition lock switch used in conjunction with the clutch pedal of the subject vehicles contains a return spring that could fracture due to stress from the switch interaction with the clutch pedal bracket. A fractured return spring could force the ignition lock switch to remain continually "ON," allowing for vehicle startup when the clutch pedal is not depressed. If an operator starts the vehicle in gear without the parking brake set, brake pedal depressed or the clutch depressed, the vehicle could inadvertently move.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Inadvertent vehicle movement increases the risk of a crash and injury to occupants or bystanders.

Description of the Cause : Return spring fracture due to deformation of the clutch pedal bracket.

Identification of Any Warning that can Occur : There are no warnings prior to onset of the defect condition.

Involved Components :

Component Name 1 : SWITCH ASSY - IGNITION LOCK

Component Description : Ignition lock switch for Genesis Coupe (BK)

Component Part Number : 93840-2E000

Supplier Identification :**Component Manufacturer**

Name : INFAC

Address : 450, Baekjegobun-ro
Songpa-gu Seoul Foreign States 05641

Country : Korea, Republic of

Chronology :

Please see the attached chronology.

Description of Remedy :

Description of Remedy Program : All owners of the subject vehicles will be notified by first class mail with instructions to bring their vehicles to a dealer for replacement of the ignition lock switch. This remedy will be offered at no cost to owners for all affected vehicles, regardless of whether the affected vehicles are still covered under Hyundai's New Vehicle Limited Warranty. Additionally, Hyundai will provide owners of affected vehicles reimbursement for out-of-pocket expenses incurred to obtain a remedy for the recall condition in accordance with the reimbursement plan submitted to NHTSA on February 22, 2024. As a precautionary measure, owners are advised to follow the owner's manual starting procedure by engaging the parking brake and depressing the clutch, while placing the transmission in the neutral position, prior to starting their vehicle.

How Remedy Component Differs from Recalled Component : The remedy switch is produced with a more robust spring.

Identify How/When Recall Condition was Corrected in Production : According to supplier manufacturing records, the spring improvement of the ignition lock switch was implemented by the supplier on March 25, 2012.

Recall Schedule :

Description of Recall Schedule : Dealers will be notified electronically on the specified dates.
Owners will be notified by certified mail on the specified dates.

Planned Dealer Notification Date : SEP 23, 2024 - SEP 23, 2024

Planned Owner Notification Date : SEP 23, 2024 - SEP 23, 2024

* NR - Not Reported