

Part 573 Safety Recall Report

24V-613

Manufacturer Name : Winnebago Industries, Inc.

Submission Date : SEP 05, 2024

NHTSA Recall No. : 24V-613

Manufacturer Recall No. : 187



Manufacturer Information :

Manufacturer Name : Winnebago Industries, Inc.

Address : PO BOX 152
605 W. Crystal Lake Rd. Forest City IA
50436

Company phone : 1-641-585-3535

Population :

Number of potentially involved : 443

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2023-2025 Winnebago Vista

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : The recall population was determined by identifying the models with the affected F53 Chassis.

Production Dates : APR 19, 2023 - AUG 06, 2024

VIN Range 1 : Begin : NR **End :** NR Not sequential

Vehicle 2 : 2023-2025 Winnebago Sunstar

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : The recall population was determined by identifying the models with the affected F53 Chassis.

Production Dates : APR 19, 2023 - AUG 06, 2024

VIN Range 1 : Begin : NR **End :** NR Not sequential

Vehicle 3 : 2023-2025 Winnebago Adventurer

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : The recall population was determined by identifying the models with the affected F53 Chassis.

Production Dates : APR 19, 2023 - AUG 06, 2024

VIN Range 1 : Begin : NR **End :** NR Not sequential

Description of Defect :

Description of the Defect : Incorrect wire routing may cause potential damage to the forward-facing camera wiring.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : If the camera becomes inoperable, features such as active brake assist, lane keep assist, and auto high beams may become disabled, increasing the risk of a crash.

Description of the Cause : Driver assist technology features were added in MY2023, however the design did not allow for adequate clearance through the firewall, which resulted in incorrect harness routing.

Identification of Any Warning that can Occur : A dash warning will indicate to the operator that the camera is inoperable, and some safety features are disabled.

Involved Components :

Component Name 1 : Front Panel

Component Description : Panel - Front, W/Draft 23 E/F

Component Part Number : 000273850/354659-01-CHT

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

On or about June 18, 2024, quality was notified by warranty that there were several instances that dash cameras were malfunctioning due to wires being damaged by dash components. Winnebago opened an investigation into the concern. After investigating it was discovered the damage was caused by a deviation in the intended routing, which pinched the wires causing damage.

Additional units were inspected, and Winnebago identified 5 units within company control that exhibited this issue. The Product Safety committee met on August 8, 2024, and decided to recall the impacted products.

Winnebago is not aware of any complaints, warranty claims, accidents, injuries, or property damage because of this condition.

Description of Remedy :

Description of Remedy Program : Reimbursement requests will follow the general reimbursement plan on file with NHTSA.

How Remedy Component Differs from Recalled Component : An intended route will be provided for additional wiring.

Identify How/When Recall Condition was Corrected in Production : Production placed a hold on current units and rerouted the wiring.

Recall Schedule :

Description of Recall Schedule : Recall schedule for notifications will be within the 60 day requirement

Planned Dealer Notification Date : AUG 29, 2024 - AUG 29, 2024

Planned Owner Notification Date : OCT 11, 2024 - OCT 11, 2024

* NR - Not Reported