

Part 573 Safety Recall Report

24V-691

Manufacturer Name : Hyundai Motor America**Submission Date :** SEP 13, 2024**NHTSA Recall No. :** 24V-691**Manufacturer Recall No. :** 268**Manufacturer Information :**

Manufacturer Name : Hyundai Motor America

Address : 10550 Talbert Avenue

Fountain Valley CA 92708

Company phone : 800-633-5151

Population :

Number of potentially involved : 65

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2025-2025 Hyundai Tucson

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

Descriptive Information : The subject population includes certain model year 2025 Hyundai Tucson vehicles produced on the specified dates by Kia Motors Mexico ("KMX") for sale in the U.S. market.

Production Dates : JUN 07, 2024 - JUL 30, 2024

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Noncompliance :**

Description of the Noncompliance : The passenger-side Supplemental Restraint System ("SRS") label might not have been affixed to the glove compartment box in the subject vehicles at the vehicle processing center. As such, the affected vehicles fail to comply with the label requirements set forth in Federal Motor Vehicle Safety Standard No. 208, "Occupant Crash Protection."

FMVSS 1 : 208 - Occupant crash protection

FMVSS 2 : NR

Description of the Safety Risk : Without the SRS label, operators may be unaware of the increased risks that an air bag poses to an infant or child in the front seat, increasing the risk of injury to occupants.

Description of the Cause : Installation of the required label was not included in manufacturing standardized work.

Identification of Any Warning that can Occur : N/A

Involved Components :

Component Name 1 : LABEL-C/PAD (A/BAG WARN'G)

Component Description : Air bag label attached to C/PAD (glove box)

Component Part Number : 85261-2D700

Supplier Identification :**Component Manufacturer**

Name : Hyundai Mobis Mexico

Address : Carretera Pesqueria-Los Ramones

Km 13-15, La Arena Pesqueria Foreign States 66679

Country : Mexico

Chronology :

Please see attached for the requested information.

Description of Remedy :

Description of Remedy Program : All owners of the subject vehicles will be sent a recall notification letter and a new SRS label by first class mail. Additionally, affected owners will have the option to bring their vehicles to a Hyundai dealer to have the SRS label affixed by a technician. This remedy will be offered at no cost to owners for all affected vehicles, regardless of whether the affected vehicles are still covered under Hyundai's New Vehicle Limited Warranty. Additionally, Hyundai will provide owners of affected vehicles reimbursement for out-of-pocket expenses incurred to obtain a remedy for the recall condition in accordance with the reimbursement plan submitted to NHTSA on February 22, 2024.

How Remedy Component Differs from Recalled Component : N/A

Identify How/When Recall Condition was Corrected in Production : SRS label application instructions were added to production standardized work on August 12, 2024.

Recall Schedule :

Description of Recall Schedule : Dealers will be notified electronically on the specified dates.
Owners will be notified by certified mail on the specified dates.

Planned Dealer Notification Date : SEP 13, 2024 - SEP 13, 2024

Planned Owner Notification Date : NOV 12, 2024 - NOV 12, 2024

* NR - Not Reported