

# Part 573 Safety Recall Report

# 24V-701

**Manufacturer Name :** Lamborghini (Automobili Lamborghini)

**Submission Date :** OCT 11, 2024

**NHTSA Recall No. :** 24V-701

**Manufacturer Recall No. :** L62X-R.03.24



## Manufacturer Information :

**Manufacturer Name :** Lamborghini (Automobili Lamborghini)  
**Address :** Via Modena 12  
Sant'Agata Bolognese (BO) 40019 -  
Italy 00 99999  
**Company phone :** 999

## Population :

**Number of potentially involved :** 39  
**Estimated percentage with defect :** 100 %

## Vehicle Information :

**Vehicle 1 :** 2024-2024 Automobili Lamborghini Huracan EVO Spyder  
**Vehicle Type :** LIGHT VEHICLES  
**Body Style :** 2-DOOR  
**Power Train :** GAS

**Descriptive Information :** The recall population was determined based on manufacturing records.

**Production Dates :** NOV 20, 2023 - JUL 26, 2024

**VIN Range 1 :** Begin : ZHWUT4ZF3RLA26136 End : ZHWUT4ZF6RLA28947  Not sequential

## Description of Noncompliance :

**Description of the Noncompliance :** On the front structural member assembly, a bracket which is relevant for crash protection according to FMVSS208, may have been mounted on the wrong side of the vehicle. As such, these vehicles fail to meet the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection".

**FMVSS 1 :** 208 - Occupant crash protection

**FMVSS 2 :** NR

**Description of the Safety Risk :** In the event of a crash, an incorrectly installed frame bracket may not provide adequate protection to an unbelted passenger, increasing the risk of injury.

**Description of the Cause :** Error during the manual assembly step of the component.

**Identification of Any Warning that can Occur :** NA

## Involved Components :

Component Name 1 : Front frame bracket

Component Description : Front frame bracket

Component Part Number : 4T0803662

## Supplier Identification :

### Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

## Chronology :

On August 28th during production assembly phase, one working shift reported the bracket 4T0803662 assembled in the wrong vehicle side (left side instead of right side).

Lamborghini immediately launched an internal investigation to determine the root cause. Results from the investigation revealed a risk that additional number of vehicles may have been produced not according to product specification.

A compliance assessment was requested and following the results, on September 12th, Lamborghini Product Safety Committee determined that a non-compliance related to motor vehicle safety exists and decided to conduct a voluntary non-compliance recall. Lamborghini is not aware of crashes, deaths or injuries related to this issue.

## Description of Remedy :

Description of Remedy Program : Automobili Lamborghini S.p.A. will notify all owners of affected vehicles and will instruct them to arrange for an appointment with an authorized Lamborghini dealer. Dealers will inspect the parts and if necessary remove the wrongly installed bracket and reassemble it on the correct side, free of charge.

How Remedy Component Differs from Recalled Component : Remedied vehicles will have the front frame brackets mounted according to product specification.

Identify How/When Recall Condition was Corrected in Production : Since the issue was identified, on August 28th, the factory stock and production line were blocked and all vehicles inspected. A training refresh for operators was conducted and a specific production line check was added.

**Recall Schedule :**

Description of Recall Schedule : Customer will be notified by registered mail and customer app while dealers through Lamborghini dealer portal.

Planned Dealer Notification Date : NOV 08, 2024 - NOV 11, 2024

Planned Owner Notification Date : NOV 15, 2024 - NOV 15, 2024

\* NR - Not Reported