OMB Control No.: 2127-0004

Part 573 Safety Recall Report

24V-713

Manufacturer Name: Royal Enfield North America Limited

Submission Date: SEP 25, 2024 NHTSA Recall No.: 24V-713 Manufacturer Recall No.: NR



Manufacturer Information:

Manufacturer Name: Royal Enfield North America Limited

Address: 226 North Water Street

Milwaukee WI 53202

Company phone: 866-600-1122

Population:

Number of potentially involved: 4,017 Estimated percentage with defect: 100 %

Vehicle Information:

Vehicle 1: 2023-2023 Royal Enfield Himalayan, Classic 350, Meteor 350, Hunter 350, Int 650,

Super Meteor 650, Continental GT 650,

Vehicle Type: MOTORCYCLES Body Style: UNKNOWN

Power Train: GAS

Descriptive Information: Supplier reflective part when tested did not meet reflective requirement. Working

with supplier identified when tool for molding was not adequately cleaned. The updated reflector carries the letter 'N' molded into reflector surround and '25' in the

side molding for the red reflector.

Production Dates: NOV 01, 2022 - MAR 31, 2023

VIN Range 1: Begin: ME3FCP205PK300017 End: ME3HJN473RK700464 ✓ Not sequential

Description of Defect:

Description of the Defect: Side and rear reflector does not reflect at the required reflective performance.

FMVSS 1: 108 - Lamps, reflective devices, and assoc. Equipment

FMVSS 2: NR

Description of the Safety Risk: It may make it difficult for other road users to see the motorcycle from the

rear or side.

Description of the Cause: Molding tool cleanliness which reduced reflective operation.

Identification of Any Warning N/A

that can Occur:

Involved Components:

Component Name 1: Reflector

Component Description: Side Reflector.

Component Part Number: Side Reflector RAH00259.

Component Name 2: Reflector

Component Description: Rear reflector

Component Part Number: Rear Reflector 143275

Supplier Identification:

Component Manufacturer

Name: Uno Minda Limited

Address: 34-35 Km, Mile Stone, GT Road, Village R

Sonipat, Haryana Foreign States 131029

Country: India

Chronology:

The defect was Identified while under performance testing by KATRI (Korean Transportation Safety Authority).

Description of Remedy:

Description of Remedy Program: Replace the side and/or rear reflectors at no cost to the customer.

How Remedy Component Differs

The updated side reflector part carries the letter 'N' molded into the side

from Recalled Component: body of the part. The rear reflector part carries the number 25' into the

side body of the reflector.

Identify How/When Recall Condition The new parts were carrying the new identification were integrated into

was Corrected in Production: the production process. April 1st 2023.

Recall Schedule:

Description of Recall Schedule: Dealer letter and replacement process together with full VIN list to be

sent to all dealers. Customer letters to follow 14 days later.

Planned Dealer Notification Date: OCT 16, 2024 - OCT 16, 2024

Part	573	Safety	Recal	l Report
-------------	------------	---------------	-------	----------

24V-713

Page 3

Planned Owner Notification Date: OCT 30, 2024 - OCT 31, 2024

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR \$573