

Part 573 Safety Recall Report

24V-735

Manufacturer Name : International Motors, LLC**Submission Date :** NOV 01, 2024**NHTSA Recall No. :** 24V-735**Manufacturer Recall No. :** 24512**Manufacturer Information :**

Manufacturer Name : International Motors, LLC

Address : 2701 Navistar Drive

Lisle IL 60532

Company phone : 331-332-1590

Population :

Number of potentially involved : 6

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2025-2025 International CV

Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER

Power Train : DIESEL

Descriptive Information : • The suspect population was identified by reviewing airbag module configuration files and validating air bag activation status.

• The vehicles in the suspect population did not have their airbag modules activated and all other similar vehicles not subject to this recall had their airbag modules activated.

Production Dates : MAY 23, 2024 - AUG 23, 2024

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : • Airbag control modules were not activated during the manufacturing process and will not deploy the airbag in the event of a crash.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : In the event of a crash, an air bag that does not properly deploy can increase the risk of injury.

Description of the Cause : Software in certain module programming tools used for end-of-line operations at the assembly plant were not properly configured.

Identification of Any Warning that can Occur : The continuous flashing of the Airbag Readiness Light suggests that the airbag system may not be functioning correctly.

Involved Components :

Component Name 1 : Module, Airbag Sen & Diag

Component Description : Airbag Sensing & Diagnostic Module (SDM)

Component Part Number : 7504121C1

Supplier Identification :

Component Manufacturer

Name : Navistar, Inc.

Address : 2701 Navistar DR
Lisle Illinois 60532

Country : United States

Chronology :

9/5/2024: During a pre-delivery inspection, Navistar Manufacturing notices that a vehicle had a flashing airbag readiness light after end-of-line final programming.

9/6/2024: A review of manufacturing records determined certain vehicles airbag modules were potentially not activated.

9/6/2024 thru 9/23/2024: Navistar initiates a delivery stop for units at the assembly plant finding 22 suspect units that did not have activated airbags establishing a clean point at Springfield Assembly Plant.

9/23/2024: Navistar finalizes the suspect population.

9/25/2024: Navistar declares a Safety Recall.

10/31/2024 All suspect vehicles have been repaired.

Description of Remedy :

Description of Remedy Program : Since all suspect vehicles are remedied, no dealer or owner notification will occur. Future quarterly completion reports will indicate 100%.

How Remedy Component Differs from Recalled Component : NA

Identify How/When Recall Condition was Corrected in Production : NA

Recall Schedule :

Description of Recall Schedule : • When tools are available, remedy instructions and owner notifications will be distributed. Tentative schedule as indicated.

Planned Dealer Notification Date : NOV 15, 2024 - NOV 15, 2024

Planned Owner Notification Date : NOV 22, 2024 - NOV 22, 2024

* NR - Not Reported