

Part 573 Safety Recall Report

24V-792

Manufacturer Name : Mack Trucks, Inc.

Submission Date : DEC 05, 2024

NHTSA Recall No. : 24V-792

Manufacturer Recall No. : SC0472



Manufacturer Information :

Manufacturer Name : Mack Trucks, Inc.

Address : 2100 Mack Boulevard
PO Box M Allentown PA 18105-5000

Company phone : 610-709-2131

Population :

Number of potentially involved : 51,000

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2020-2025 Mack ANTHEM(AN)/GRANITE(GR)/TERRAPRO(TE)PINNACLE (PI/PN)

Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER

Power Train : DIESEL

Descriptive Information : The recall population is defined by specific vehicles equipped with Bendix EC80 electronic control units (ECU's) and equipped to tow a trailer. Vehicles without towing capability and Bendix EC80 and Power Line Carrier (PLC) communication are excluded from the population. 51000 units, MACK/ANTHEM(AN)/GRANITE(GR)/TERRAPRO(TE)PINNACLE (PI/PN)/MY 2020-2025.

Production Dates : MAY 01, 2019 -OCT 28, 2024

VIN Range 1 :Begin : 1M2GR2ACXLM001268 **End :** 1M1PN4GYXSM017645 ☒ Not sequential

Description of Defect :

Description of the Defect : As described in 24E-086, EC80 is an electronic control unit mounted on a towing vehicle. It is a component of an antilock braking system (ABS). Power Line Carrier (PLC) is a trailer to tractor communication system that sends a signal on the electrical connection between the tractor and trailer. PLC purpose is to control the cab mounted trailer-ABS indicator lamp in the towing vehicle. In the presence of high electrical interference (i.e. noise) on the vehicle power line and low PLC signal strength, the EC80 PLC functionality may incorrectly process certain signals. The EC80 may set a fault or stop operating or malfunction. The combination of high electrical interference and low PLC signal strength is more likely on vehicles that tow more than one trailer than vehicles that tow only one trailer. The PLC signal strength may be substantially reduced when other optional devices are connected to the power line. These optional devices include trailer based tracking systems. Vehicles with low noise levels and high signal strength may never exhibit the vehicle effects.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : As described in 24E-086, The ABS, Automatic Traction Control (ATC), or Electronic Stability Control(ESC) may set an ABS fault or may stop operating. Other functions which strongly interact with ABS such as Active Cruise Control (ACC) and Collison Mitigation System (CMS) may also fault. In extremely rare situations before the system faults or stops operating, if there is a stability event or an automated braking request, the system may respond incorrectly to the event. This can increase the likelihood of a crash.

Description of the Cause : Inadequate systems validation in an operational environment.

Identification of Any Warning that can Occur : The ABS warning lamp will be illuminated when an ABS fault is detected or when the ABS stops operating.

Involved Components :

Component Name 1 : Control Unit

Component Description : ABS-Advanced (ESP+)

Component Part Number : 22865025

Supplier Identification :

Component Manufacturer

Name : Bendix Commercial Vehicle Systems, LLC.

Address : 35500 Chester Road
Avon Ohio 44011

Country : United States

Chronology :

October 11 2024: Bendix management contacts our purchasing organization concerning their upcoming filing of a equipment DIR relative to their EC80 Advanced Electronic Control Units.

October 11, 2024: Product Safety is notified of the potential issue and opens investigation.

October 14, 2024: Product Safety Evaluation Committee meets and reviews communications from Bendix and our internal investigation and recommends that this be escalated to the Product Safety Committee as a potential safety defect.

October 17 , 2024: Product Safety Committee meets and determines that a product safety defect exists and vehicles will be recalled.

October 23, 2024: DIR report filed with NHTSA.

There have been 55 warranty claims where an ABS light became illuminated, ABS off line, without additional ABS/ATC/ESC/ACC or CMS systems in use failures.

There have been no field reports, no accidents or no injuries reported with this issue.

Description of Remedy :

Description of Remedy Program :	Vehicle will be recalled and the Bendix EC80 electronic control unit software will be updated.
	Reimbursement for the recall will be covered by Manufacturer's Reimbursement Plan on file with NHTSA.
How Remedy Component Differs from Recalled Component :	The remedy software does not contain the defective PLC functionality. Control Unit, ABS-Advanced (ESP+), 22865025
Identify How/When Recall Condition was Corrected in Production :	Vehicles have been identified on October 18, 2024 and placed on hold and will not be released until the EC 80 electronic control unit software is updated.

Recall Schedule :

Description of Recall Schedule :	Dealer Notifications will be on or before October 29, 2024 Owners Notifications will be on or before December 13, 2024
Planned Dealer Notification Date :	OCT 29, 2024 - OCT 29, 2024
Planned Owner Notification Date :	DEC 13, 2024 - DEC 13, 2024

* NR - Not Reported