



U.S. Department  
of Transportation

National Highway  
Traffic Safety  
Administration

## Part 573 Safety Recall Report

# 24V824

**Manufacturer Name:** Winnebago Industries, Inc.

**Submission Date:** Jun 02, 2025

**NHTSA Recall No.:** 24V824

**Manufacturer Recall No.:** 191

### Manufacturer Information

### Population

**Manufacturer Name:** Winnebago Industries, Inc.

**Address:** PO BOX 152  
605 W. Crystal Lake Rd.  
Forest City IA, 50436

**Total number of potentially involved:** 5,313

**Estimated percentage with defect:** 100%

### Vehicle Information

**Vehicle 1:** 2020-2024 Winnebago View / Navion

**Product Category:**

**Product Type:**

**Fuel / Propulsion:**

**Production Dates:** Mar 02, 2019 - Aug 22, 2023

**Number of potentially involved:**

**Descriptive Information:**

The recall population was determined by identifying the production dates.

### Defect / Noncompliance Description

**Description of the defect or noncompliance:**

Certain Lippert (Metallarte) door assemblies were manufactured with inadequate adhesion of the window to the door assembly.

**FMVSS1:**

**FMVSS2:**

**Description of the safety risk, including crash, fire, death, injury:**

There is potential for the adhesive used to mount the window in the entrance door to fail over time, which can result in the window becoming loose and/or detaching completely from the door. A window that becomes loose or detached while the vehicle is in transit could become a road hazard to other motorists and increase the risk of a crash.

# Part 573 Safety Recall Report

**24V824****Description of the cause:**

Unknown

**Identification of any warning that can occur:**

A window that becomes loose in transit will produce a noticeable change in noise level within the vehicle.

## Component Manufacturer

**Tier of Supplier:****Supplier Type:****Name:** Lippert Components (Metallarte)**Address:** 2020 Blakesley Pkwy  
Bristol IN, 46507**Country:** United States

## Involved Components

**Component Name 1:** Door Complete - Entrance**Component Description:** Entrance Door Assembly**Component Part Number:** 329933-01-06A

## Chronology

In late September, Winnebago Product Safety became aware of a concern with the Lippert (Metallarte) door assembly windows with allegations of partial and/or full detachment of the window in transit. An investigation was subsequently opened. During the investigation, Winnebago identified 121 total claims from 2019 to mid-2023. It was also found that Lippert provided repair instructions regarding the process of re-adhering the window to the door assembly. On October 25, 2024, the Product Safety Committee met and determined that a defect related to motor vehicle safety was present. Winnebago is aware of 2 unconfirmed detachments in the field and 121 total claims of loose windows. Winnebago is not aware of any injuries or property damage associated with this issue. Final remedy is pending parts availability from our supplier.

**Related NHTSA Recall Number:**

## Description of Remedy

# Part 573 Safety Recall Report

# 24V824

**Remedy Type:** Repair

**Consumer Advisories:**  Do Not Drive  Park Outside

**Description of remedy program:**

Reimbursement requests will follow the general reimbursement plan on file with NHTSA.

**How remedy component differs from recalled component:**

Remedy is to install clips to secure the window to the door and, if necessary, apply additional adhesive.

**Identify how/when recall condition was corrected in production:**

Winnebago Motorhomes switched to a new door supplier.

## Reimbursement Plan

**Description of reimbursement program:**

**Period of reimbursement:**

**Costs to be reimbursed:**

**Address for reimbursement claims:**

## Recall Schedule

**Description of recall schedule:**

Recall schedule for notifications will be within the 60 day requirement.

**Planned Dealer Notification Date:**  No Dealers

**Planned Interim Owner Notification Date:**  No Owners

**Planned Remedy Owner Notification Date:**  Phased Recall

**Date when VIN will be searchable:**