

Part 573 Safety Recall Report

24V-843

Manufacturer Name : Hyundai Motor America**Submission Date :** NOV 07, 2024**NHTSA Recall No. :** 24V-843**Manufacturer Recall No. :** 270**Manufacturer Information :**

Manufacturer Name : Hyundai Motor America

Address : 10550 Talbert Avenue

Fountain Valley CA 92708

Company phone : 800-633-5151

Population :

Number of potentially involved : 34,964

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2024-2024 Hyundai Santa Fe

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

Descriptive Information : Based on manufacturing records, the subject population includes 26,273 model year 2024 Hyundai Santa Fe vehicles produced on the specified dates by Hyundai Motor Manufacturing Alabama ("HMMA") for sale in the U.S. market.

Production Dates : DEC 28, 2023 - OCT 09, 2024

VIN Range 1 : Begin :

NR

End : NR

 Not sequential

Vehicle 2 : 2024-2024 Hyundai Santa Fe Hybrid

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : HYBRID ELECTRIC

Descriptive Information : Based on manufacturing records, the subject population includes 8,691 model year 2024 Hyundai Santa Fe Hybrid vehicles produced on the specified dates by Hyundai Motor Manufacturing Alabama ("HMMA") for sale in the U.S. market.

Production Dates : MAR 06, 2024 - OCT 08, 2024

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Noncompliance :**

Description of the Noncompliance : The subject vehicles are equipped with an Overhead Console Sunshade Switch that may not be fully recessed, increasing the risk of inadvertent sunshade activation. As such, the subject vehicles do not meet the test requirements of Federal Motor Vehicle Safety Standard No. 118 "Power-Operated Window, Partition and Roof Panel Systems."

FMVSS 1 : 118 - Power-operated window systems

FMVSS 2 : NR

Description of the Safety Risk : Inadvertent sunshade activation could increase the risk of minor pinch point injury occurring from unexpected closure of the fabric sunshade with an extremity in the enclosed fixed sunroof space.

Description of the Cause : The Overhead Console Sunshade Switch is not fully recessed.

Identification of Any Warning that can Occur : N/A

Involved Components :

Component Name 1 : Overhead Console Lamp

Component Description : Overhead console assembly on the roof

Component Part Number : 92810-R6110

Supplier Identification :

Component Manufacturer

Name : IL HEUNG

Address : 242, Hwahap-ro, Pocheon-si
Gyeonggi-do Foreign States

Country : Korea, Republic of

Chronology :

Please see attached information regarding technical analysis leading up to the noncompliance decision.

Description of Remedy :

Description of Remedy Program : All owners of the subject vehicles will be notified by first class mail with instructions to bring their vehicles to a Hyundai dealer to replace the Overhead Console Sunshade Switch Knobs. This remedy will be offered at no cost to owners for all affected vehicles, regardless of whether the affected vehicles are still covered under Hyundai's New Vehicle Limited Warranty. Additionally, Hyundai will provide owners of affected vehicles reimbursement for out-of-pocket expenses incurred to obtain a remedy for the recall condition in accordance with the reimbursement plan submitted to NHTSA on February 22, 2024.

How Remedy Component Differs from Recalled Component : The remedy component will be approximately 2.3mm more recessed than the recalled component.

Identify How/When Recall Condition was Corrected in Production : The revised component was implemented as a running production change on July 29, 2024.

Recall Schedule :

Description of Recall Schedule : Dealers will be notified electronically on the specified dates. Owners will be notified via certified mail on the specified dates.

Planned Dealer Notification Date : JAN 06, 2025 - JAN 06, 2025

Planned Owner Notification Date : JAN 06, 2025 - JAN 06, 2025

* NR - Not Reported