

# Part 573 Safety Recall Report

# 24V-927

**Manufacturer Name :** Jaguar Land Rover North America, LLC**Submission Date :** DEC 12, 2024**NHTSA Recall No. :** 24V-927**Manufacturer Recall No. :** H529**Manufacturer Information :****Population :**

Manufacturer Name : Jaguar Land Rover North America, LLC

Number of potentially involved : 34

Address : 100 Jaguar Land Rover Way

Estimated percentage with defect : 100 %

Mahwah NJ 07495

Company phone : 8188500

**Vehicle Information :**

Vehicle 1 : 2019-2019 JAGUAR I-PACE

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : HYBRID ELECTRIC

**Descriptive Information :** Jaguar Land Rover is conducting a voluntary safety recall campaign involving certain 2019MY Jaguar I-PACE vehicles built at the Graz Vehicle Assembly Plant from February 21, 2018 - March 11, 2019. 34 vehicles in the United States and Federalized Territories. The basis for the recall population is data from the JLR Service diagnostic system to identify vehicles where there is no record of the correct software installed or there is erroneous software installed by assessing software State of Charge (SoC) limit stored for safety recall H514 interim repair.

Production Dates : FEB 21, 2018 - MAR 11, 2019

VIN Range 1 : Begin : SADHD2S16K1F60313 End : SADHD2S14K1F76302  Not sequential**Description of Defect :**

**Description of the Defect :** Following an internal review of warranty claims for interim recall remedy H514, it was revealed that the interim recall action had been incorrectly completed by a number of retailers. Investigations revealed the retailers had either not started, or not correctly completed, the H514 safety recall software updates per the published repair procedure. As a result, affected vehicles remain with the safety defect.

FMVSS 1 : NR

FMVSS 2 : NR

**Description of the Safety Risk :** An incorrectly repaired vehicle will continue to have a risk of vehicle thermal overload condition such as fire or smoke which can result in increased risk of occupant injury and/or injury to persons outside the vehicle, as well as property damage. The owner will not be aware that the prior interim repair

was not completed correctly.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

## Involved Components :

Component Name 1 : High Voltage Battery Pack Assembly

Component Description : High Voltage Battery Pack Assembly

Component Part Number : T4K4282

Component Name 2 : High Voltage Battery Pack Assembly

Component Description : High Voltage Battery Pack Assembly

Component Part Number : T4K9818

Component Name 3 : High Voltage Battery Pack Assembly

Component Description : High Voltage Battery Pack Assembly

Component Part Number : T4K11674

Component Name 4 : High Voltage Battery Pack Assembly

Component Description : High Voltage Battery Pack Assembly

Component Part Number : T4K13288

Component Name 5 : High Voltage Battery Pack Assembly

Component Description : High Voltage Battery Pack Assembly

Component Part Number : T4K14489

Component Name 6 : High Voltage Battery Pack Assembly

Component Description : High Voltage Battery Pack Assembly

Component Part Number : T4K14609

Component Name 7 : High Voltage Battery Pack Assembly

Component Description : High Voltage Battery Pack Assembly

Component Part Number : T4K16281

Component Name 8 : High Voltage Battery Pack Assembly

Component Description : High Voltage Battery Pack Assembly

Component Part Number : T4K16370

Component Name 9 : High Voltage Battery Pack Assembly

Component Description : High Voltage Battery Pack Assembly

Component Part Number : T4K17606

Component Name 10 : High Voltage Battery Pack Assembly

Component Description : High Voltage Battery Pack Assembly

Component Part Number : T4K19934

## Supplier Identification :

### Component Manufacturer

Name : LG Energy SolutionCo., Ltd.

Address : LG Energy Solution Wrocław Sp. z o.o

ul. LG 1A, Biskupice Podgórne Kobierzyce Foreign States 55-040

Country : Poland

## Chronology :

On 12 November 2024, following an audit of the first 20 H514 remedy records, an internal report was received that there may have been 3 vehicles where the interim remedy had not been successfully applied to the vehicles, but yet a claim for the repair had been made by the repairing retailer.

Throughout November 2024, and into early December 2024, the logs of the retailer activity for the remainder of the H514 recall population were manually reviewed with the intention of verifying the accuracy of the original report and ascertaining whether there were any other vehicles where repair records show the same situation.

On 03 December 2024, the findings of the investigation were presented to JLR's Product Safety and Compliance Committee (PSCC) where it was decided to progress this matter to the Recall Determination Committee (RDC) for review.

On 05 December 2024, the RDC reviewed the matter and determined that, as these vehicles had not had the interim remedy applied, there was a continued safety risk and therefore they should be subject to further recall.

There have no accidents, injuries or fires reported attributed to this issue.

JLR has not received any claims or field reports in the USA related to this issue.

## Description of Remedy :

Description of Remedy Program : Vehicles will have the interim repair update software installed. Vehicles where the H514 final remedy (vehicle reacquisition) is completed do not need this recall to be carried out. There will be no charge to the owners for this repair. Customers who have paid for a repair of this defect out of warranty will be reimbursed by the Jaguar Land Rover reimbursement plan, subject to the usual terms and conditions.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

## Recall Schedule :

Description of Recall Schedule : Notifications to dealers will occur on January 2, 2025. Distribution of owner notification letters will occur on or before February 7, 2025.

Planned Dealer Notification Date : JAN 02, 2025 - JAN 02, 2025

Planned Owner Notification Date : FEB 07, 2025 - FEB 07, 2025

\* NR - Not Reported