

Part 573 Safety Recall Report

24V-931

Manufacturer Name : Featherlite Trailer Manufacturing, LLC

Submission Date : MAR 28, 2025

NHTSA Recall No. : 24V-931

Manufacturer Recall No. : NR



Manufacturer Information :

Population :

Manufacturer Name : Featherlite Trailer Manufacturing, LLC

Number of potentially involved : 30

Address : Highway 9 & 63

Estimated percentage with defect : 100 %

P O Box 320 Cresco IA 52136

Company phone : 800-800-1230

Vehicle Information :

Vehicle 1 : 2023-2024 Featherlite Trailers 7821,7841,9807,9808

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : It was determined on a production change. The difference is that the LP hose in the cooktop is rubber on the recalled units compared to a copper line

Production Dates : SEP 29, 2022 - AUG 12, 2024

VIN Range 1 : Begin : 4fgb12523pc159125 **End :** 4fgb13320rc163760

Not sequential

Description of Defect :

Description of the Defect : Incorrect LP line was installed in the cooktop. A rubber line was used instead of a copper line in that area where it can get hot and compromise the line and start a fire.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Rubber line could fail because of the heat in the cooktop and cause a fire

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

Involved Components :

Component Name 1 : LP HOSE

Component Description : HOSE LP 3/8 FEMALE FLARE X 3/8 FEMALE FLARE 30" LONG

Component Part Number : 03181039

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

On August 12th 2024, i was notified by our production team that they felt the rubber LP line inside the cooktop was not adequate for the application we were using on the cooktop which could cause a failure in the hose and cause a fire. We found that other RV manufacturers were using a rubber hose in that area also but after investigating with the manufacturer of the hose that the hose was not rated for the heat in the cooktop

Description of Remedy :

Description of Remedy Program : We will send them a kit along with instructions that has parts needed to add a copper extension to the rubber LP line in the cooktop area. We will have them take the trailer back to their dealer or a local RV center to have the copper line added to the rubber LP line in the cooktop. We will cover the labor to add the copper extension line that is provided in the kit.

How Remedy Component Differs from Recalled Component : Inside the cooktop, the recalled units will have a rubber line and the repaired units will have a copper LP extension line in the cooktop.

Identify How/When Recall Condition was Corrected in Production : On August 12th, 2024 after production felt that we were using an inadequate rubber LP line in the cooktop, they added a copper extension line in the cooktop.

Recall Schedule :

Description of Recall Schedule : As soon as we are approved to do the recall, we will send letters out as soon as possible,

Planned Dealer Notification Date : APR 04, 2025 - APR 04, 2025

Planned Owner Notification Date : APR 04, 2025 - APR 04, 2025

* NR - Not Reported