53

Part 573 Safety Recall Report

Manufacturer Name :Chrysler (FCA US, LLC)Submission Date :DEC 19, 2024NHTSA Recall No. :24V-942Manufacturer Recall No. :D4B

Manufacturer Information :

Manufacturer Name : Chrysler (FCA US, LLC) Address : 800 Chrysler Drive CIMS 482-00-91 Auburn Hills MI 48326-2757

Company phone : 1-800-853-1403

Vehicle Information :

	25-2025 Ram 1500 Picku	р		
Vehicle Type : Body Style - DI	CVIDTDUCV			
Body Style: PI Power Train: NI				
	Some 2025 MY Ram 1500 vehicles may have been built with incorrect headlamp module software that may allow the headlamps to become inoperative.			
in 20 wa	The suspect period began on September 20, 2024, when the first vehicle containing incorrect software in the headlamp module was produced, and ended on October 4, 2024, when the last vehicle containing incorrect software in the headlamp module was produced. Engineering release, supplier, and vehicle manufacturing records were used to determine the suspect population.			
	Similar vehicles not included in this recall contain the correct software in the headlamp module.			
Production Dates : SE	P 20, 2024 - OCT 04, 2024			
VIN Range 1: Beg	gin: NR	End: NR	□ Not sequential	
Description of Noncompliance :				
	of the Federal Motor Vehicle Safety Standard ("FMVSS") 571.108 S6.1.1 specifies the number of lamps and/or reflective devices for these suspect vehicles and their conformance to the performance requirements of this standard. The incorrect software may cause the headlamps not to function.			
FMVSS 1 :	108 - Lamps, reflective devices, and assoc. Equipment			
FMVSS 2 :				
Description of the Safety Risk :	: A nonfunctional headlamp can reduce forward visibility which can cause a vehicle crash without prior warning.			
The infor				



Number of potentially involved :

Estimated percentage with defect : 100 %

Population :

24V-942

Part 573 Safety Recall Report

Identification of Any Warning None that can Occur: None that can Occur: None that can Occur: None Suppler Identification : None Suppler Identification : None that can Occur : None	Descri	ption of the Cause : NR	
Component Name 1 : Headlamp RH Component Description : Headlamp RH Component Part Number : 68530384AC Component Name 2 : Headlamp LH Component Description : Headlamp LH Component Part Number : 68530385AC Supplier Identification : Component Manufacturer Name : Marelli North America Inc. Address : 26555 Northwestern Highway		ion of Any Warning None	
Component Description : Headlamp RH Component Part Number : 68530384AC Component Name 2 : Headlamp LH Component Description : Headlamp LH Component Part Number : 68530385AC Supplier Identification : 68530385AC Supplier Identification : Komponent Manufacturer Name : Marelli North America Inc. Address : 26555 Northwestern Highway	nvolved Co	omponents :	
Component Part Number : 68530384AC Component Name 2 : Headlamp LH Component Description : Headlamp LH Component Part Number : 68530385AC Supplier Identification : Component Manufacturer Name : Marelli North America Inc. Address : 26555 Northwestern Highway	Com	ponent Name 1: Headlamp RH	
Component Name 2 : Headlamp LH Component Description : Headlamp LH Component Part Number : 68530385AC Supplier Identification : Component Manufacturer Name : Marelli North America Inc. Address : 26555 Northwestern Highway	Compor	ent Description : Headlamp RH	
Component Description : Headlamp LH Component Part Number : 68530385AC Supplier Identification : Component Manufacturer Name : Marelli North America Inc. Address : 26555 Northwestern Highway	Compone	ent Part Number : 68530384AC	
Component Part Number : 68530385AC Supplier Identification : Component Manufacturer Name : Marelli North America Inc. Address : 26555 Northwestern Highway	Com	ponent Name 2 : Headlamp LH	
Supplier Identification : Component Manufacturer Name : Marelli North America Inc. Address : 26555 Northwestern Highway	Compor	ent Description : Headlamp LH	
Component Manufacturer Name : Marelli North America Inc. Address : 26555 Northwestern Highway	Compone	ent Part Number : 68530385AC	
Component Manufacturer Name : Marelli North America Inc. Address : 26555 Northwestern Highway			
Name :Marelli North America Inc.Address :26555 Northwestern Highway	Supplier Id	entification :	
Address : 26555 Northwestern Highway	Compone	nt Manufacturer	
	Name : Marelli North America Inc.		
Southfield Michigan 19022			
Country : United States	0	Southfield Michigan 48033	

Chronology :

On October 02, 2024, the FCA US LLC ("FCA US") Technical Safety and Regulatory Compliance ("TSRC") organization was notified of a potential build issue resulting in a loss of headlamp functionality related to the headlamp module software in some 2025 MY Ram 1500 vehicles.

From October 2024 through November 2024, FCA US TSRC met with FCA US Engineering and Manufacturing to review the issue, understand all potential failure modes, and to determine the suspect population.

On November 27, 2024, FCA US TSRC organization recognized that a vehicle build issue existed on certain vehicles related to headlamp module software potentially resulting in a noncompliance with FMVSS No. 108.

On December 13, 2024, FCA US determined, through the Vehicle Regulations Committee, to conduct a

The information contained in this report was submitted pursuant to 49 CFR §573

voluntary safety recall of the affected vehicles.			
Description of Remedy :			
Description of Remedy Program :	FCA US will conduct a voluntary safety recall to reprogram the headlamp module with corrected software. FCA US submitted its General Reimbursement Plan relating to		
	reimbursement to owners and purchasers for costs incurred for remedies in advance of the manufacturer's notification of safety-related defects and noncompliance with Federal motor vehicle safety standards in October 2024. Owners and purchasers may be eligible for reimbursement in accordance with that plan.		
How Remedy Component Differs from Recalled Component :	The remedy is a headlamp module software update.		
Identify How/When Recall Condition was Corrected in Production :	NR		
Recall Schedule :			
Description of Recall Schedule :	**12/19/2024: FCA US will notify dealers on or about 01/03/2025 and		

-	begin notifying owners on or about $01/21/2025$.
Planned Dealer Notification Date :	DEC 20, 2024 - DEC 20, 2024
Planned Owner Notification Date :	JAN 21, 2025 ⁻ JAN 28, 2025

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR \$573