

VOLUNTARY RECALL CAMPAIGN

 Classification:
 Reference:
 Date:

 RS24-003
 NTB24-021
 March 5, 2024

VOLUNTARY SAFETY RECALL CAMPAIGN 2024 PATHFINDER; DRIVER SEATBELT PRE-TENSIONER

CAMPAIGN ID #: PD106

APPLIED VEHICLES: 2024 Pathfinder (R53)

Check Service COMM or Dealer Business Systems (DBS) National Service History to confirm campaign eligibility.

INTRODUCTION

Nissan is conducting this voluntary safety recall campaign on certain specific model year 2024 Pathfinder vehicles to inspect and, if necessary, replace the driver seatbelt pretensioner. This service will be performed at no charge to the customer for parts or labor.

IDENTIFICATION NUMBER

Nissan has assigned identification number PD106 to this campaign. This number must appear on all communication and documentation of any nature dealing with this campaign.

DEALER RESPONSIBILITY

It is the dealer's responsibility to check Service COMM or Dealer Business Systems (DBS) National Service History for the campaign status on each vehicle falling within the range of this voluntary safety recall which for any reason enters the service department. This includes vehicles purchased from private parties or presented by transient (tourist) owners and vehicles in a dealer's inventory. Federal law requires that new vehicles in dealer inventory which are the subject of a safety recall must be corrected prior to sale. Failure to do so can result in civil penalties by the National Highway Traffic Safety Administration. While federal law applies only to new vehicles, Nissan strongly encourages dealers to correct any used vehicles in their inventory before they are retailed.

Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. **NOTE:** If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

SERVICE PROCEDURE

IMPORTANT: Follow all cautions, warnings, and notes in the Electronic Service Manual (ESM) when working on or near a Supplemental Restraint System (SRS), such as an air bag.

AWARNING

To avoid the risk of death or severe personal injury, always observe the following items for preventing accidental activation:

- Before servicing, place the ignition switch in the OFF position, disconnect 12V battery negative terminal and wait for 3 minutes or more (discharges electricity held in the additional power supply circuit of the air bag diagnosis sensor unit).
 Refer to Precautions for Removing Battery Terminal in the ESM.
- Never use air tools or electric tools for servicing.

ACAUTION

To avoid the risk of minor personal injury, property damage, and damage to the vehicle, always observe the following:

2/7

- Never place the seat belt pre-tensioner retractor and lap pre-tensioner in an area where the temperature reaches 80°C (176°F) or more.
- Always use a remover tool that is made of plastic to prevent damage to the parts.
- 1. Remove the driver (LH) side Rear Kicking Plate Inner.
 - Refer to the ESM: BODY
 INTERIOR > INTERIOR >
 REMOVAL AND INSTALLATION > BODY SIDE TRIM > KICKING PLATE > Removal and Installation > Rear Kicking Plate



Figure 1

NTB24-021

- 2. Remove the driver Front Kicking Plate Inner.
 - Refer to the ESM: BODY
 INTERIOR > INTERIOR >
 REMOVAL AND INSTALLATION
 > BODY SIDE TRIM > KICKING
 PLATE > Removal and
 Installation > Front Kicking Plate

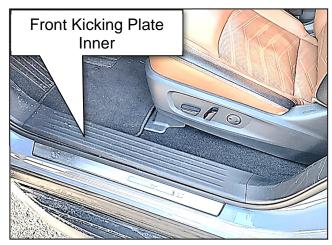


Figure 2

3. Move the driver seat all the way forward.



Figure 3

- 4. Remove the Center Pillar Lower Finisher.
 - Refer to the ESM: BODY
 INTERIOR > INTERIOR >
 REMOVAL AND INSTALLATION
 > BODY SIDE TRIM > CENTER
 PILLAR LOWER FINISHER >
 Removal and Installation

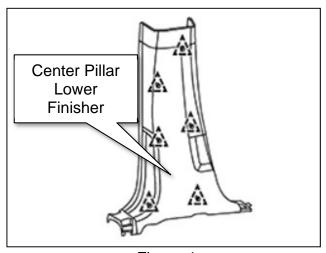


Figure 4

NTB24-021

3/7

5. Position the carpet away from the Driver Seatbelt Pre-tensioner.

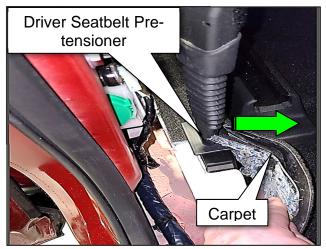


Figure 5

6. Carefully move the foam away from the Driver Seatbelt Pre-tensioner lower anchor.


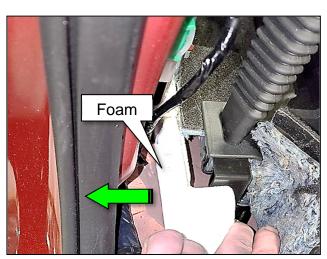


Figure 6

4/7 NTB24-021

- 7. Inspect the Driver Seatbelt Pre-tensioner for the presence of a rivet, as shown in Figure 7.
 - If the rivet is present on the Driver Seatbelt Pre-tensioner, no further action is needed. Continue to step 8 to reassemble the vehicle.
 - If the rivet is missing from the Driver Seatbelt Pre-tensioner, replace the Driver Seatbelt Pre-tensioner, and then continue to step 8 to reassemble the vehicle.
 - Refer to the ESM: RESTRAINTS > SEAT BELT > REMOVAL AND INSTALLATION > FRONT SEAT BELT > SEAT BELT RETRACTOR > FOR USA AND CANADA > Removal and Installation

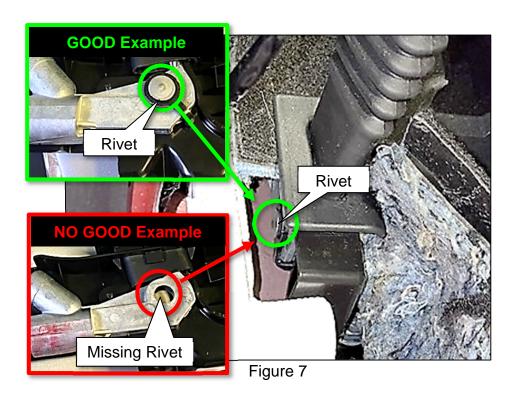

8. Reposition the foam against the Driver Seatbelt Pre-tensioner lower anchor.

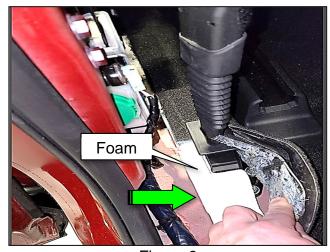


Figure 8

5/7 NTB24-021

9. Reposition the carpet back to its original location.

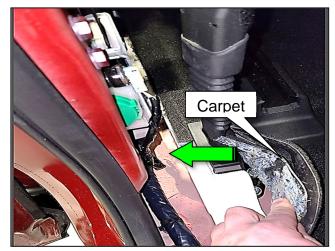


Figure 9

IMPORTANT: Verify all panel clips are present and attached to each individual finisher and kicking plate before reinstallation.

- 10. Reinstall the Center Pillar Lower Finisher.
 - Refer to the ESM: BODY INTERIOR > INTERIOR > REMOVAL AND INSTALLATION > BODY SIDE TRIM > CENTER PILLAR LOWER FINISHER > Removal and Installation
- 11. Reinstall the Front Kicking Plate Inner.
 - Refer to the ESM: BODY INTERIOR > INTERIOR > REMOVAL AND INSTALLATION > BODY SIDE TRIM > KICKING PLATE > Removal and Installation > Front Kicking Plate
- 12. Reinstall the Rear Kicking Plate Inner.
 - Refer to the ESM: BODY INTERIOR > INTERIOR > REMOVAL AND INSTALLATION > BODY SIDE TRIM > KICKING PLATE > Removal and Installation > Rear Kicking Plate

6/7 NTB24-021

PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
BELT ASSY – OUTER, PRE-TENSIONER FRONT	86889-6TA8A	1
LH	00009-01A0A	(If Needed)

CLAIMS INFORMATION

Submit a "CM" line claim using the following claims coding:

CAMPAIGN ("CM") ID	DESCRIPTION	OP CODE	FRT
PD106	Inspect Driver Seatbelt Pre-tensioner (OK Condition)	PD1060	0.2
	Inspect and Replace Driver Seatbelt Pre- tensioner	PD1061	0.7

AMENDMENT HISTORY

PUBLISHED DATE	REFERENCE	DESCRIPTION
March 5, 2024	NTB24-021	Original bulletin published

7/7

NTB24-021