


# RECALL 24V272 / 2024-227 REMEDY INSTRUCTIONS

	Make(s): MANY, SEE BELOW Model(s): MANY Model Year(s): MANY, SEE BELOW	Repair Code: RC-029-09-00-004531 Allotted Time: .30 HRS. Inspection Code: RC-029-05-00-004530 Allotted Time: .10 HRS.
	Concern: SEE BELOW	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: N/A Part(s) Return: N/A

Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

PLEASE REFERENCE THE INCLUDED REMEDY INSTRUCTIONS PROVIDED BY SUBURBAN.

**RANGE/COOKTOPS WITH RED BACKLIT LEDS – REMEDY IS REQUIRED**

**RANGE/COOKTOPS WITH BLUE OR WHITE BACKLIT LEDS ARE NOT AFFECTED – CLAIM INSPECTION CODE ONLY**

**CONCERN:**

ACCORDING TO SUBURBAN RECALL 24E028: "THE LED BACKLIGHT PRINTED CIRCUIT BOARDS (PCB) ARE NOT FULLY COATED. THE LACK OF CONFORMAL COATING IN THE CONNECTION PASSAGES BETWEEN THE LAYERS OF THE PCB CAN ALLOW LIQUID FROM THE COOKTOP SURFACE TO ACCUMULATE WHICH COULD RESULT IN A SHORT CIRCUIT RESULTING IN THE FAILURE OF THE PCB."

**CERTAIN CARDINAL: 2021 – 2022:** CAF320RLX, CAF335RLX, CAF345RLX, CAF352BHLE, CAF366DVLE, CAF370FLX, CAF377MBLE, CAF380RLX, CAF383BHLE, CAF390FBX & CAF403FKLE

**CERTAIN CEDAR CREEK: 2015 - CRT40CCK, 2016 - CRF36CKTS, 2018 - CRF37MBH & 2019 - CRF36CK2, CRF37MBH & CRF38FLX**

**CERTAIN COLUMBUS: 2021 - CMF297RKC**

**CERTAIN CONTINENTAL CARGO: 2023 - TXAMG8.532TA5 & TXAMG8.552TTA5**

**CERTAIN DYNAMAX DX3: 2021 – 2024 - DXC32KD, DXC34KD, DXC37BD, DXC37RB & DXC37TS**

**CERTAIN DYNAQUEST XL: 2021 – 2024 - DLC3200KD, DLC3400KD, DLC3700BD, DLC3700RB, DLC37RB & DLC3801TS**

**CERTAIN EUROPA: 2022 – 2024 - EUC31SSFR & EUC32KDFR**

**CERTAIN FORCE: 2021 – 2023 - FRC34KDHD, FRC37BDHD & FRC37TSHD**

**CERTAIN ISATA: 2021 – 2024 - ISC28SSD4X4, ISC28SSD4X4CD, ISC30FWD4X4, ISC30FWD4X4CD & ISC34DSD4X4**

**CERTAIN IBEX: 2021 – 2024 - BXT20BHS, BXT20MDS, BXT23BHEO, BXT23RLDS & BXT24MTH**

**CERTAIN NOBO: 2022 – 2024 - NBT20.3, NBT20.3EO & NBT20.4**

**CERTAIN SANDSTORM: 2022 – 2023 - SCF286GSLR-CA, SCF306GSLR-CA, SCF326GSLR-CA, SCF346GSLR-CA, SCT211SLC-CA, SCT242GSLC-CA-67, SCT242SLC-CA, SCT245GSLC-CA-67, SCT251GSLC-CA-67, SCT251SLC-CA, SCT265GSLR-CA-67, SCT272GSLC-CA-67, SCT272SLC-CA, SCT291SLC-CA, SCT293GSLR-CA-67, SCT302GSLR-CA-67 & SCT304GSLR-CA-67**

**CERTAIN SHOCKWAVE: 2022 – 2023 - SHF28FWGDX-CA, SHF30FWGDX-CA, SHF32FWGDX-CA, SHT21RQMX-CA, SHT24QSGMX-CA-67, SHT24RQGMX-CA-67, SHT24RQMX-CA, SHT25FSGLE-CA-67, SHT25RQGMX-CA-67, SHT25RQMX-CA, SHT26QSGDX-CA-67, SHT27RQGMX-CA-67, SHT27RQMX-CA, SHT29KSGDX-CA-67, SHT29RQMX-CA, SHT30DSGDX-CA-67 & SHT30FKGDX-CA-67**

**CERTAIN STEALTH: 2022 – 2023 - SFFSA2816G-CA, SFFSA3019G-CA, SFFSA3217G-CA, SFFSA3320G-CA, SFFSA3421G-CA, SFTFK3018G-CA-67, SFTFQ2113-CA, SFTFQ2413-CA, SFTFQ2413G-CA-67, SFTFQ2514-CA, SFTFQ2514G-CA-67, SFTFQ2916G-CA-67, SFTKS3016G-CA-67, SFTQS2414G-CA-67, SFTQS2616G-CA-67, SFTRQ2715-CA, SFTRQ2715G-CA-67 & SFTRQ2916-CA**

**CERTAIN WILDCAT: 2021 – 2022 - WCF260RD, WCF263RL, WCF271ML, WCF302BH, WCF311RLWS, WCF333RLBS, WCF336RLS, WCF368MB & WCF369MBL**

## 206346 Range and Slide-in Deactivate Lights Instructions

### WARNING

This appliance is not intended for use by young children or infirm persons unless they have been adequately supervised by a responsible person to ensure they can use the appliance safely.


To prevent electrical shock and/or equipment damage, disconnect electrical power to the system at the main fuse or circuit breaker until installation is complete.

### CAUTION

This electrical work must be performed by trained technicians only. Adhere to all local and national codes and ordinances. Take care when securing and routing wires so they do not short. Personal injury and/or property damage may occur.

This electrical work will disable the function of the red, white and oven lights.


1. Disconnect 12VDC power to the range.
2. Remove the range main top by firmly pulling up at the front. Lift the main top free of the burner box clips and set aside.

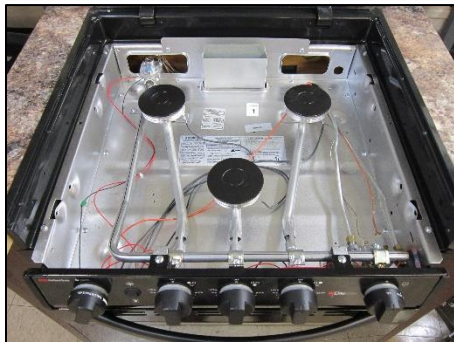

3. Locate the red and black wires that connect to the coach wiring (Coach wiring color may vary). Cut this wire directly behind the connector using a pair of electrical cutters.



4. Crimp the Crimp Caps(233759) to incoming 12V positive and negative to prevent lights from being reattached.

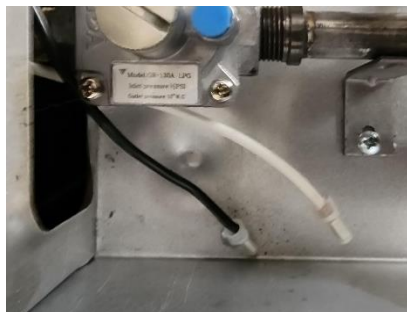

5. Locate and unplug the wires from the light switch on the front of the unit, Then remove the light switch by squeezing the locking tabs and replace with the plug provided in the kit (233754).



6. Replace the main top by engaging rear clips and pressing firmly on the front latch.



7. Close the glass cover (if equipped).
8. Reconnect 12VDC power.

### Service

For any questions, please reach out to the Suburban service department using the contact information below.

Suburban, An Airxcel Brand  
Service Department  
676 Broadway Street  
Dayton, TN 37321  
(574) 247-9235 Option 5