

RECALL 24V280 / 2024-232 REMEDY INSTRUCTIONS



Make(s): AURORA & CATALINA
Model(s): BART15RDX & BCAT154RDX
Model Year(s): 2024

Concern:
The cooktop is not isolated from the furnace return air, which potentially causes an inverted flame on the cooktop. This condition may lead to potentially causing the propane supply line to fail, which may lead to property damage or personal injury.

Repair Code: RC-030-09-00-004529
Allotted Time: .25 HRS.
Inspection Code: N/A
Allotted Time: N/A

Photo(s) Required: YES, POST REMEDY
Prior Authorization Required: YES
Part(s) Kit Number: N/A
Part(s) Return: N/A

Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

STEP 1: REMOVE COOKTOP FROM THE KITCHEN COUNTER;

- KEEP FASTENERS TO USE TO RE-INSTALL THE COOKTOP;
- **DO NOT** DISCONNECT THE LPG LINE FROM THE COOKTOP;

STEP 2: USE SILICONE SEALANT TO SEAL THE PANEL AND THE CLEAT REPRESENTED IN FIGURES 1 & 2;

STEP 3: RE-INSTALL COOPTOP;

STEP 4: TEST;

- TURN ON LPG;
- SET FURNACE TO HIGHEST SETTING;
- IGNITE COOKTOP AND LET BURN;
- THE FLAME SHOULD NOT INVERT WHEN THE FURNACE IS RUNNING.

FIGURE 1



FIGURE 2



APPLY SILICONE SEALANT WHERE THE RED LINE INDICATES.
- THIS IS ON TOP OF THE CLEAT, AGAINST THE PANEL
- THIS ON BOTH RIGHT AND LEFT HAND SIDES