



609 Swan Ave
Hohenwald, TN 38462
Phone (931) 796-6600

RECALL 24V322 / 2024-01 REMEDY INSTRUCTIONS

RECALL 24V322 / 2024-01

Model(s): Legacy Elite II

Model Year(s): 2009-2024

Inspection Time: .10 HRS

Repair Time: .50 HRS

Photo's Required: YES

Prior Authorization Required: NO

Tools Needed:

- (2) ¾" Wrenches
- (1) 80 ft/lbs. Torque Wrench
- (1) Small Flat Head Screwdriver

Remedy:

- Step 1) Ensure camper is in a secure position and unhooked from vehicle.
- Step 2) Using a small flat head screwdriver remove both plastic bolt covers.
- Step 3) Next, remove nylon nut from each bolt. Note: The bolt/nut size is ¾".
- Step 4) Remove and DISCARD old washers, nuts, and bolts from coupler.
- Step 5) Remove coupler from the tongue.
- Step 6) Place the new coupler on the tongue and ensure proper hole alignment.
- Step 7) Put one NEW washer on each NEW bolt and insert back through the aligned holes.
- Step 8) Place two NEW washers on each protruding bolt, followed by a NEW nylon nut.
- Step 9) Tighten to snug.
- Step 10) Using a torque wrench finish tightening each nut to 80 ft/lbs.
- Step 11) Lastly, reinstall both plastic bolt covers over the protruding bolt/nut.

Please submit the *Bulldog Coupler Recall Replacement Form*