


RECALL 24V351/2024-282 REMEDY INSTRUCTIONS

	Make(s): SEE BELOW Model(s): SEE BELOW Model Year(s): 2024 - 2025	Repair Code: RC-026-03-00-004539 Allotted Time: .20 HRS. Inspection Code: RC-026-05-00-004538 Allotted Time: .10 HRS.
	Concern: The LPG line may interfere with the rear tire, causing the LPG line to puncture, which may lead to a leak.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: SOURCE LOCALLY Part(s) Return: N/A

Turn off LP Gas at LPG Tank(s). Place vehicle in (P) Park and engage the Parking Brake. Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

CERTAIN 2024 – 2025 FORESTER: FRC2151SLEC, FRC2151SLEF & FRC2351LEMC
 CERTAIN 2024 FORESTER: FRC2251SLEC, FRC2251SLEF & FRC2351LEC
 CERTAIN 2024 SOLERA: DSC22NC & DSC23SC
 CERTAIN 2024 – 2025 SUNSEEKER: SSC2150SLEC, SSC2250SLEC, SSC2250SLEF, SSC2350LEC, SSC2350LEF & SSC2350LEMC
 CERTAIN 2024 SUNSEEKER: SSC2150SLEF
 CERTAIN 2025 SUNSEEKER: SSC2150SLEFRB, SSC2350LEFCAE & SSC2350LEMCRB

NOTE: SOURCE P-CLAMP AND SELF TAPPING SCREW LOCALLY.


STEP 1: LOCATE THE TRUSS JUST IN FRONT OF THE REAR WHEELS (FIGURE 1);

STEP 2: USE A P-CLAMP AND A SELF-TAPPING SCREW TO SECURE THE P-CLAMP TO THE TRUSS (FIGURE 2);

- THE P-CLAMP SHOULD FACE DOWN WITH THE LP HOSE RUNNING THROUGH IT AND THE SELF-TAPPING SCREW ABOVE IT
- THE P-CLAMP NEEDS TO BE MOUNTED WITHIN 48 INCHES OF IT COMING FROM THE LP TANK;

STEP 3: CLAIM REPAIR CODE.

FIGURE 1

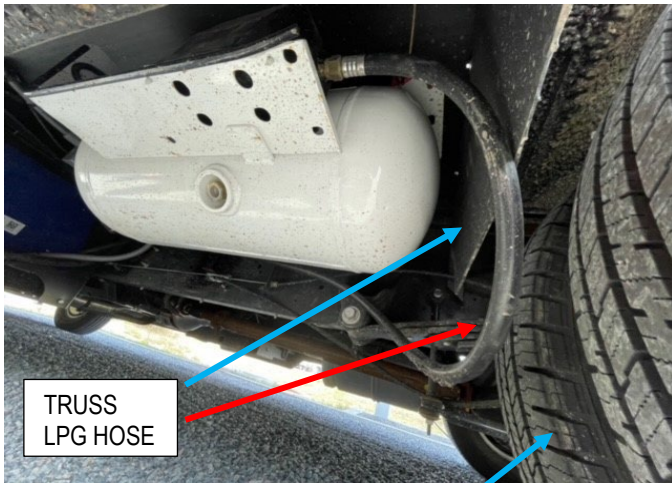

TRUSS
LPG HOSE

REAR TIRES

FIGURE 2



P-CLAMP MOUNTED WITHIN 48" OF LPG TANK WITH LPG HOSE RETAINED