

 Tesla, Inc. Service Bulletin		<h2>Update Vehicle Software To Adjust Seat Belt Reminder Functionality</h2>	
SB-24-00-008 June 17, 2024			
Classification		Section/Group	Mobile Service
Recall Bulletin		00 - Inspection & Service	Can Perform (where permitted)
Model	Model Year	Country/Region	Build Location
Model S	2012 – 2024	North America, EMEA, Asia Pacific	Fremont, Giga Berlin, Giga Shanghai
Model X	2015 – 2024		
Model 3	2017 – 2023		
Model Y	2020 – 2023		
<small>The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.</small>			

Recall Bulletin: Recall Bulletins are mandatory service procedures that, unless they can be completed via a software update that a customer installs through the normal course of ownership, must be carried out by Tesla-certified Service Centers. Recall work performed by uncertified technicians could lead to unsafe conditions or voided warranty provisions.

Condition

On certain affected vehicles, an open trace in the driver seat occupancy switch may result in a loss of the audible and visual seat belt reminder signals when the driver's seat belt is not fastened after the vehicle ignition is moved to the "on" or "start" position.

Correction

Inspect the vehicle software version and if necessary, update the vehicle software to version 2024.20.3 or newer.

Correction Description	Correction	Time
Inspect Vehicle Software Version; No Software Update Needed For Adjusting Seat Belt Reminder Functionality	S012400008	0.06
Inspect And Update Vehicle Software To Adjust Seat Belt Reminder Functionality	S022400008	0.06

Procedure

On the vehicle touchscreen, touch **Controls** (vehicle icon) > **Software**, and then scroll down to display the vehicle software version.

- If the vehicle is operating with software version 2024.20.3 or newer, no further action is necessary. Use correction code S012400008.
- If the vehicle is operating with a software version earlier than 2024.20.3, update the software to version 2024.20.3 or newer (refer to Service Manual procedure 00020003; hyperlinks listed below). Use correction code S022400008.
 - [2012-2020 Model S Service Manual](#)
 - [2021+ Model S Service Manual](#)
 - [2015-2020 Model X Service Manual](#)
 - [2021+ Model X Service Manual](#)
 - [2017-2023 Model 3 Service Manual](#)
 - [Model Y Service Manual](#)