


RECALL 24V490 / 2024-374 REMEDY INSTRUCTIONS

	Make(s): SALEM & WILDWOOD Model(s): SEE BELOW Model Year(s): 2024 - 2025	Repair Code: RC-047-01-00-004582 Allotted Time: 2.50 HRS. Inspection Code: RC-047-05-00-004581 Allotted Time: .10 HRS.
	Concern: Certain vehicles may not have been manufactured with a secondary means of egress.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: F100627546 Part(s) Return: N/A

Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

CERTAIN 2024 – 2025 – SALEM: SMT179DBK & SMT179DBKX
 CERTAIN 2024 – 2025 – WILDWOOD: WDT179DBK & WDT179DBKX

TOOLS REQUIRED:

ROUTER/TINSNIPS SCREW GUN
 STAPLER D-10 CAULK GUN
 STANLEY KNIFE OSCILLAING TOOL
 GREASE PENCIL/PENCIL MASKING TAPE

CONTENTS OF PARTS KIT:

WINDOW, EGRESS 30"X 20" 2 – 3" RADIUS BLOCKS
 EXIT STICKER FOAM SEAL
 LUMBER, 2" X 2"S WINDOW SCREWS
 1" SEAM TAPE 3" WASHER HEAD SCREWS
 CURTAIN & TRACK

STEP 1: LOCATE THE WINDOW **BELOW** THE UPPER BUNK, ON THE REAR WALL;

- IF THE WINDOW CURRENTLY INSTALLED IN THAT LOCATION IS LABELED AS "EGRESS"/"EXIT" – CLAIM INSPECTION CODE;
- IF THE WINDOW CURRENTLY INSTALLED IN THAT LOCATION IS NOT AN EGRESS WINDOW, MOVE TO THE REMEDY;

REMEDY – FOR SMT179DBK, SMT179DBKX, WDT179DBK & WDT179DBKX ONLY:

STEP 1: REMOVE CURTAIN AND TRACK (FIG. 1A);

STEP 2: REMOVE THE WINDOW INTERIOR TRIM RING AND WINDOW, DISCARD BOTH (FIG. 2A);

STEP 3: PLACE THE TEMPLATE AGAINST THE LOWER LEFT SIDE OF THE WINDOW OPENING AND AGAINST THE BOTTOM OF THE WINDOW OPENING (FIG. 3A);

STEP 4: USE OSCILLATING TOOL TO CUT OUT PANELING AFTER TRACING (FIG. 4A);

- CUT AND REMOVE BOTH STUDS;
- USE UTILITY KNIFE TO CUT AWAY BATTEN INSULATION;

STEP 5: BUILD WINDOW FRAME WITH RADIUS BLOCKS TO FIT SIDEWALL OPENING AND INSTALL SCREWS AT TOE IN ANGLE (FIG. 5A);

- EDGE OF NEWLY BUILT WINDOW FRAME SHOULD LINE UP WITH OPENING EDGE;

STEP 6: ONCE RIGHTHAND SIDE FRAMING IS INSTALLED, CUT AND MEASURE TOP REMAINING 2X2 AND SECURE (FIG. 6A);

- ONCE TOP 2X2 IS IN PLACE, ADD 3RD RADIUS BLOCK;
- NEXT TOE IN ANGLE ONE SCREW AT EACH END;
- KEEP STAPLES CLOSE TO OPENING EDGE IN ORDER TO BE COVERED BY WINDOW RING;

STEP 7: AFTER FRAMING, ROUTE OUT 30" X 20" WINDOW OPENING (FIG. 7A);

- TAPE EXTERIOR PARAMETER AROUND NEW WINDOW FRAME TO PREVENT SCRATCHES TO METAL;

STEP 8: PREP AND ADD WINDOW FOAM SEAL (FIG. 8);

- INSTALL WINDOW TRIM RING AND INSTALL WINDOW;
- SECURE WITH PROVIDED WINDOW SCREWS;

STEP 9: INSTALL PROVIDED CURTAIN TRACK AND CURTAIN (FIG. 9);

STEP 10: INSTALL PROVIDED 1" SEAM TAPE TO COVER SCREW HOLE (FIG. 10);

- INSTALL PROVIDED "EXIT" STICKER UNDER WINDOW;

STEP 11: PREP AND SEAL WINDOW (FIG. 11);

STEP 12: HI-POT TEST THE VEHICLE;

STEP 13: CLAIM REPAIR CODE WITH HOURS NEEDED.

RECALL 24V490 / 2024-374 REMEDY INSTRUCTIONS



Make(s): SALEM & WILDWOOD
Model(s): SEE BELOW
Model Year(s): 2024 - 2025

Concern:
Certain vehicles may not have been
manufactured with a secondary means of
egress.

Repair Code: RC-047-01-00-004582
Allotted Time: 2.50 HRS.
Inspection Code: RC-047-05-00-004581
Allotted Time: .10 HRS.

Photo(s) Required: NO
Prior Authorization Required: YES
Part(s) Kit Number: F100627546
Part(s) Return: N/A

FIG. 1A.



FIG. 2A.



FIG. 3A.



RECALL 24V490 / 2024-374 REMEDY INSTRUCTIONS



Make(s): SALEM & WILDWOOD
 Model(s): SEE BELOW
 Model Year(s): 2024 - 2025

Concern:
 Certain vehicles may not have been
 manufactured with a secondary means of
 egress.

Repair Code: RC-047-01-00-004582
 Allotted Time: 2.50 HRS.
 Inspection Code: RC-047-05-00-004581
 Allotted Time: .10 HRS.

Photo(s) Required: NO
 Prior Authorization Required: YES
 Part(s) Kit Number: F100627546
 Part(s) Return: N/A

FIG. 4A.



FIG. 5A.



FIG. 6A.



RECALL 24V490 / 2024-374 REMEDY INSTRUCTIONS



Make(s): SALEM & WILDWOOD
Model(s): SEE BELOW
Model Year(s): 2024 - 2025

Concern:
Certain vehicles may not have been manufactured with a secondary means of egress.

Repair Code: RC-047-01-00-004582
Allotted Time: 2.50 HRS.
Inspection Code: RC-047-05-00-004581
Allotted Time: .10 HRS.

Photo(s) Required: NO
Prior Authorization Required: YES
Part(s) Kit Number: F100627546
Part(s) Return: N/A

FIG. 7A.



FIG. 8A.



END OF REMEDY & PHOTOS FOR SMT179DBK & SMT179DBKX, WDT179DBK & WDT179DBKX ONLY