


RECALL 24V619 / 2024-481 REMEDY INSTRUCTIONS

	Make(s): PUMA Model(s): PUT39DBT Model Year(s): 2024 - 2025	Repair Code: RC-632-01-00-004603 Allotted Time: .50 HRS. Inspection Code: N/A Allotted Time: N/A
	Concern: The lavatory anti-syphon/waterless p-trap may be installed incorrectly.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: F100643980 Part(s) Return: NO, DESTROY

Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

STEP 1: LOOSEN THE FITTING THAT GOES TO THE LAVATORY SINK TAILPIECE;

STEP 2: CUT VENT PIPE JUST ABOVE THE BOTTOM 45 DEGREE FITTING THAT GOES INTO THE WALL AND INSTALL NEW 45 DEGREE FITTING WITHOUT GLUE;

STEP 3: CUT THE DRAIN PIPE JUST BELOW THE CURRENT UNIGUARD AND INSTALL NEW T-FITTING WITHOUT GLUE;

STEP 4: REMOVE UNIGUARD/FITTINGS AND PIPES BETWEEN THE TWO CUTS;

STEP 5: DRILL A 2 1/2" HOLE IN THE SHELF DIRECTLY BENEATH SINK TAILPIECE;

- DRILLING FROM THE BOTTOM UP MAY WORK THE BEST

STEP 6: INSTALL NEW UNIGUARD VERTICALLY/DIRECTLY TO SINK TAILPIECE WITH ADAPTER;

STEP 7: INSTALL NEW ELBOW FITTING TO UNIGUARD WITH ADAPTER;

STEP 8: CUT PIPE TO FILL IN GAPS BETWEEN ELBOW AND T-FITTING;

STEP 9: CUT PIPE TO FILL GAP BETWEEN T-FITTING AND 45 DEGREE FITTING;

STEP 10: ASSEMBLE ALL FITTINGS AND PIPES WITHOUT GLUE TO ASSURE THAT EVERYTHING FITS AND HAS PROPER SLOPE;

STEP 11: REASSEMBLE USING THE PROPER CLEANING AGENT AND GLUE;

STEP 12: CONDUCT A FLOOD TEST TO ENSURE NOTHING LEAKS.