

TECHNICAL SERVICE BULLETIN



TSB #:	TSB-10062408	Release Date:	8/1/2024
Main Group:	00 - General Information (Recalls,Campaigns, Maintenance ..)		
Subject:	ESP BL 5.1 SW improved Drag Torque Control behavior		
Vehicle:	FM29 OCEAN	Production Range:	Up to 03/13/2024 (8,026 total vehicles – 281 Canada and 7,745 USA)
Model Year(s):	2023 and 2024	Region(s):	USA/CANADA
Mobile Service:	NO		

Recall: **SA-200000209 - Install OTA**

Perform the procedure outlined in this Technical Service Bulletin on all affected vehicles before customer delivery.

In the event the customer already has possession of a vehicle affected by this action, please perform the procedure the next time the vehicle is scheduled for a Service.

Affected Vehicles: **All USA and Canada Fisker Ocean models produced in 2023 and 2024 (totaling 8,026) will require this OTA SW update.**

Always confirm the VIN has an open campaign setup in the Work Order system.

- Model: Fisker Ocean
- Trims: All
- Model Year: 2023 and 2024
- Region: (USA, and Canada)
- Total Vehicles Impacted = 8,026 (USA and Canada)

Situation:

When braking over bumps (road disturbance) there is reduction in negative motor torque [Regenerative brake torque]. It requires 740 milliseconds to recover normal operation. The driver still has access to full friction brake deceleration power [Brake power provided by service brake system].

Correction:

With ESP BL3.5 SW in OS 1.10 Over-The-Air [OTA] released, the time to recovery following Drag Torque Control activation is reduced from 740 milliseconds to 320 milliseconds. The current proposed remedy is the release of ESP BL5.1 SW in OS 2.2 Over-The-Air [OTA] update. With ESP BL5.1 SW, the road disturbance will not trigger the Drag Torque Control activation.

Fast Tool / Over-the Air [OTA] OS 2.2 update (08/26/24 – 10/18/24)

Part Identification: N/A (since update to be completed via OTA)

TECHNICAL SERVICE BULLETIN



Parts Info: No HW change, SW update via OTA only		
Part Number	Description	Quantity
Warranty Info:		
The information provided below must be used when completing the Work Order Line item associated with this complaint and repair, covered under the terms of the Fisker New Vehicle Limited Warranty.		
1 FRU = 6 Min		
Campaign /Service Action Number	SA-2000000209	
Job Code:		
Rework#2	OTA	
Service Code:	SA2000000209	
Labor Operation	Labor Time	Description
0002S900	0.1 (1FRU	Software Update - Remote/OTA