

L74X-
R.02.24

To: After Sales Official Network
Subject: Wiper motor connecting rod replacement
Date: 21/10/2024
Pages: 5



Campaign code:

L74X-R.02.24

Campaign name:

Wiper motor connecting rod replacement

Model:

Revuelto

Model Year:

2024

Markets:

Italy, United States, Canada, United Kingdom, Denmark, Belgium, France, Netherlands, Sweden, Luxembourg, Spain, Portugal, Greece, Germany, Monaco, Poland, Azerbaijan, Czech Republic, Austria, Romania, Estonia, Norway, Turkey, India, Singapore, Lebanon, Indonesia, United Arab Emirates, Qatar, Saudi Arabia, New Zealand, Bahrain, Kuwait, Taiwan, Thailand, Mexico, Malaysia, Philippines, Switzerland, Cambodia, Oman, Peru, Latvia, Hungary, South Africa, Macao, Hong Kong, Australia, Brazil.

VIN Involved:


Important information: before proceeding with the repair, connect to the Warranty Portal and, using the “VIN Info” function, check that:

- the vehicle is actually affected by the instructions contained in this bulletin.

NOTE: some vehicles may not be affected, despite the fact that their Vehicle Identification Number (VIN) falls within the range;

- only replacement parts that correspond to the specific operation, identified by a letter (such as A, B, C, etc.), are to be used for the chassis being repaired.

Example

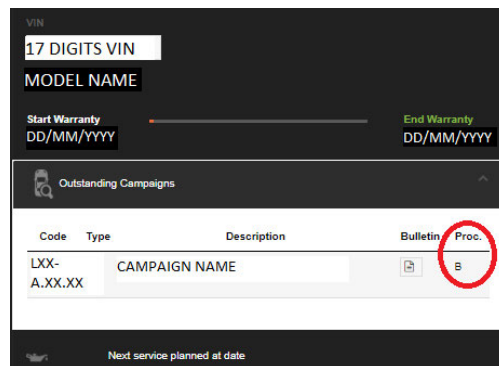

N.B.:

Operation A will be available only when the instructions require a preliminary check to be performed to determine whether or not the vehicle actually needs updating.

Information for the service network:

During ongoing product monitoring, Automobili Lamborghini S.p.A. has released a new required vehicle update for the replacement of wiper motor connecting rod.

Solution for the field:

The following instructions include one operations

Spare Parts:

OPERATION B:

Part number	Description	Q.ty
47B955476	Wiper motor connecting rod	1

The part has already been sent from headquarters to all dealers. It is not necessary to order it. Use part number only for warranty reimbursement.

Management of replaced parts:

Store the components that have been removed from the vehicle in an appropriate manner, marking them with their corresponding bar codes

Rev.02

CONFIDENTIAL

The procedures and information published herein are strictly confidential and are intended exclusively for recognized professionals and persons who are authorized to receive said information. All copyrights are the property of Automobili Lamborghini S.p.A pursuant to copyright law. The company reserves the right to make updates and modifications as needed. The reprinting, reproduction, distribution to unauthorized persons and/or to third parties, and the partial or complete translation of the material contained herein are prohibited without the express written consent of Automobili Lamborghini S.p.A.

Doc. no.: L/V6_M06 Rev.[07]

1/5

L74X-
R.02.24

To: After Sales Official Network
Subject: Wiper motor connecting rod replacement
Date: 21/10/2024
Pages: 5



so that they can be identified during visits by the competent Area Manager.


Labor time:
Operation B: 1,25 h

Previous bulletins superseded.

None.

Warranty claim instructions:

To request reimbursement for the repair performed, access the “LIASS” system on the Lamborghini portal and, following the instructions in the system’s “Manuals” section, generate and fill out a Warranty Request. Select the required campaign and proceed with entry; carefully read the options present in the alert message that displayed by the system (see example) and select the option performed on the vehicle.

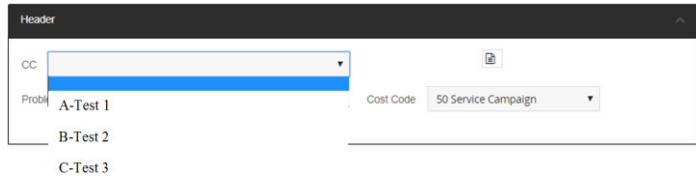

Reimbursement will be structured as follows, on the basis of the operation performed:


- **OPERATION B**
 - o Steps to be executed: 1 to 7
 - o Labour time: 1,25 h

Important information:

attach all documents generated during the work carried out, evidence of the work itself, for instance work orders and diagnostic protocols with BETA-Reports.

If one or more of these is missing, it may lead to a rejected reimbursement request.

Fill out the page in the warranty booklet (identified in the image below) in the section “Service and Recall Campaigns”:

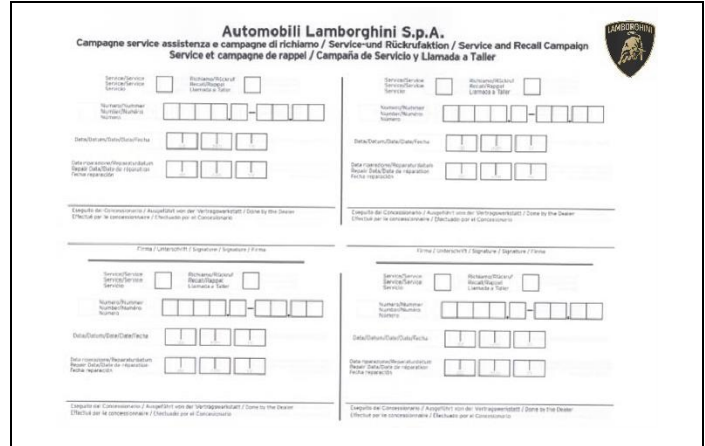

Tools/Materials required

Code	Description.	Q.ty
ASE45147700000	VAS 6275-Flat headed pliers	1
	Crowbar (Ø 10mm; L=600mm),	1
Grease	KLUBER ISOFLEX TOPAS L 32 N Or Berulub FR16	

Automobili Lamborghini does not pay for the tool ASE45147700000 and reserves the right to deny or charge back the amount to those who request it.

Grease specification:

Operating temperatures [°C]	Kinematic viscosity at 40° C [mm²/s]
da -50° a +140°	~ 32



N.B.

All ODIS technical documentation can be viewed on the Lamborghini web portal, in the ODIS section.




OPERATION B Repair method:

Follow the instructions given in the Workshop Manual at the following path:


1. HV system - Deactivating the HV system
High voltage system > High voltage system > HV system - Deactivating the HV system
2. Complete luggage compartment liner-Removal procedure
Body and chassis > Passenger compartment > Luggage compartment liners > Luggage compartment > Complete luggage compartment liner-Removal procedure

After that, please follow the next steps:

3. Lift the cover (1) using a 60mm shim to be placed between the DC/DC converter (2) and the cover (1).

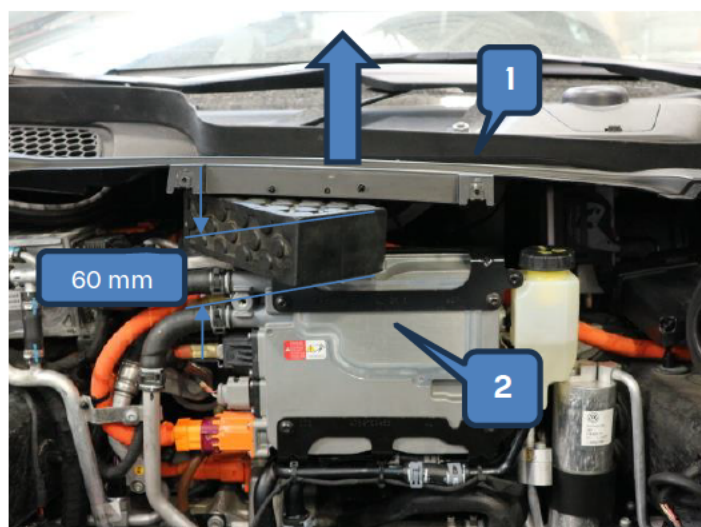

4. Using a crowbar (\varnothing 10mm; L=600mm), pry off the wiper motor arms and release the connecting rod (3) at its ends. Remove the connecting rod (3).

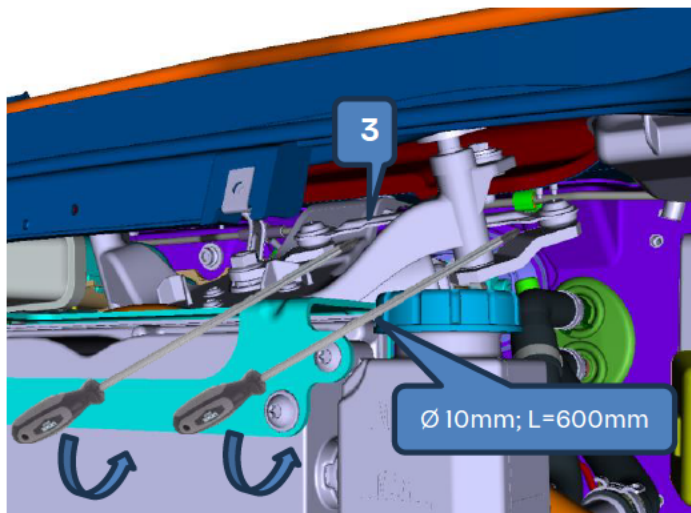

IMPORTANT:

Take care not to damage the seals under the connecting rod connections.






5. Lubricate the joints with grease (KLUBER ISOFLEX TOPAS L 32 N or Berulub FR16), put in a small quantity.
6. Position the new connecting rod (3) on the wiper motor arm, using flat headed pliers (recommended tool VAS 6275), tighten the two ends of the connecting rod (3) until they lock onto the couplings on the wiper motor arms, first the right side and then the left side (driver's side view).

**N.B.^(*)**

The sound identifying the correct fastening must be clearly heard.

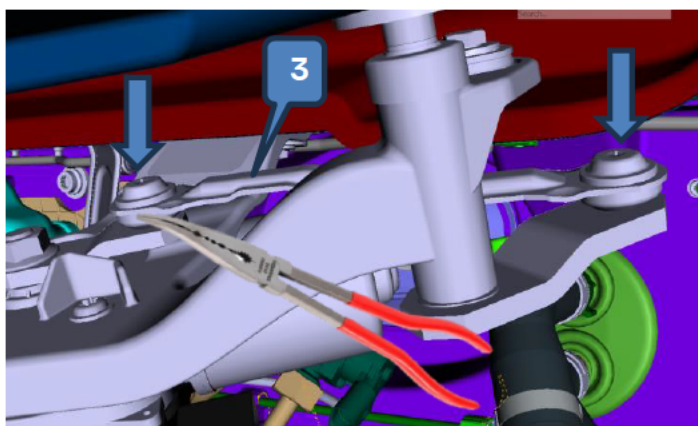

After that, follow the instructions given in the Workshop Manual at the following path:

7. Complete luggage compartment liner- Installatio procedure
 Body and chassis > Passenger compartment > Luggage compartment liners > Luggage compartment > *Complete luggage compartment liner- Installation procedure*
8. HV system - Activation HV system
 High voltage system > High voltage system > *HV system - Activation HV system*
9. With O.D.I.S. Service run the guided function - Erasefault memory - overall system
10. Testing the operation of the wipers.
11. For NAR vehicles only, perform trunk entrapment functionality test.

L74X- R.02.24	To: After Sales Official Network Subject: Wiper motor connecting rod replacement Date: 21/10/2024 Pages: 5	
------------------	---	--



IMPORTANT:

The documents which must be provided together with the operation under warranty request are:

- *Produced Repair Order*
- *Saved Diagnostic Protocol with BETA report*

Failure to follow these procedures could lead to the request being rejected.

For more information, please contact your Area Manager or open a ticket to Technical Support in Lamborghini KEY (Request – General Information – After Sales Services - After Sales Technical Support).

Regards,
Lamborghini Service

Rev.02 CONFIDENTIAL	The procedures and information published herein are strictly confidential and are intended exclusively for recognized professionals and persons who are authorized to receive said information. All copyrights are the property of Automobili Lamborghini S.p.A pursuant to copyright law. The company reserves the right to make updates and modifications as needed. The reprinting, reproduction, distribution to unauthorized persons and/or to third parties, and the partial or complete translation of the material contained herein are prohibited without the express written consent of Automobili Lamborghini S.p.A.	5/5 Doc. no.: L/V6_M06 Rev.[07]
----------------------------	---	--