


RECALL 24V929 / 2024-758 REMEDY INSTRUCTIONS

 FOREST RIVER	Make(s): R. POD Model(s): RPT197 & RPT205 Model Year(s): 2025	Repair Code: RC-706-09-00-004654 Allotted Time: .60 HRS. Inspection Code: RC-706-05-00-004653 Allotted Time: .10 HRS.
	Concern: The LP tray may not have adequate fasteners attaching it to the chassis.	Photo(s) Required: NO Prior Authorization Required: YES Part(s) Kit Number: SOURCE LOCALLY Part(s) Return: N/A

Turn off LP Gas at LPG Tank(s). Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

FASTENER(S) REQUIRED: 3/8" X 1" HEX HEAD, SELF-DRILLING TEK SCREW

- SOURCE LOCALLY/SHOP SUPPLY(S)

INSPECTION:

STEP 1: REMOVE LP BOTTLE(S) FROM THE UNIT;

STEP 2: INSPECT FOR 6 FASTENERS ATTACHING THE LP TRAY TO THE A-FRAME OF THE CHASSIS;

- IF 6 FASTENERS ARE COUNTED PRESENT (AS SHOWN IN FIGURE 1), CLAIM THE INSPECTION CODE ONLY;
- IF THERE ARE **NOT** A TOTAL OF 6 FASTENERS (AS SHOWN IN FIGURE 1), MOVE ON TO THE REMEDY;

REMEDY:

STEP 1: REFERENCE FIGURE 1 FOR PROPER LOCATIONS OF THE FASTENERS;

STEP 2: INSTALL THE FASTENERS, **THE TOTAL COUNT OF FASTENERS NEEDS TO BE 6:**

STEP 3: REINSTALL THE LP TANK(S) AND COVER (IF EQUIPPED) & RECONNECT TO THE LP SYSTEM;

- PERFORM A LP DROP TEST;

STEP 4: CLAIM THE REPAIR CODE.

FIGURE 1

