

 Tesla, Inc. Service Bulletin		<h2>Update Vehicle Software To Correct TPMS Alert Behavior</h2>	
SB-24-00-018 December 23, 2024			
Classification		Section/Group	Mobile Service
Recall Bulletin		00 - Inspection & Service	Can Perform (where permitted)
		Configuration	All
Model	Model Year	Country/Region	Build Location
Model 3	2017–2025	All, except Canada	Fremont, Giga Berlin, Giga Shanghai, Giga Texas
Model Y	2020–2025		
Cybertruck	2024		
<small>The model(s) and model year(s) listed are a general approximation of the affected VIN list. Refer to the VIN/Bulletin Tracker or Customer/Vehicle profile to determine applicability of this bulletin for a particular vehicle.</small>			

Recall Bulletin: Recall Bulletins are mandatory service procedures that, unless they can be completed via a software update that a customer installs through the normal course of ownership, must be carried out by Tesla-certified Service Centers. Recall work performed by uncertified technicians could lead to unsafe conditions or voided warranty provisions.

Condition

On some Model 3, Model Y, and Cybertruck vehicles operating with certain vehicle software versions from 2024.32.100 through 2024.44.1, the Tire Pressure Monitoring System (TPMS) malfunction telltale might not persist between drive cycles, which is noncompliant with FMVSS 138, S4.4(b).

Correction

Inspect the vehicle software version and if necessary, update the vehicle software to a version that has corrected the issue.

Correction Description	Correction	Time
Inspect Vehicle Software Version; No Update Necessary	S012400018	0.06
Inspect And Update Vehicle Software To Correct TPMS Alert Behavior	S022400018	0.06

Procedure

On the vehicle touchscreen, touch **Controls** (vehicle icon) > **Software**, and then scroll down to display the vehicle software version.

- If the vehicle is operating with a vehicle software version listed in Table 1, or a later version, the vehicle already operates software that has corrected the issue; no further action is necessary. Use correction code S012400018.

2024.38.7	2024.38.10	2024.40
-----------	------------	---------

Table 1 – Vehicle software versions with remedy

- If the vehicle is operating with a vehicle software version listed below in Table 2, the vehicle might be affected by the issue; update to a software version listed above in Table 1, or later (refer to Service Manual procedure 00020003; [Model 3](#), [2024+ Model 3](#), [Model Y](#), [Cybertruck](#)). Use correction code S022400018.

2024.32.100	2024.32.100.1	2024.32.25	2024.33.15
2024.33.25	2024.33.30	2024.33.35	2024.34.5
2024.38.100	2024.38.3	2024.38.4	2024.38.6
2024.44	2024.44.1		

Table 2 – Affected vehicle software versions