

Safety Recall Notice

Service Bulletin

601309 REV A.



631 West 11th Street • P.O. Box 310 • Winamac, IN 46996

(574) 946-4139 • 1-800-THE-LIFT • www.braunability.com

November 2024

NHTSA Recall 24V888

Installation Kit 510116BKKS

Applicable for 2024 Chrysler Pacifica & Voyager
I4, E4 & CV


Labor Time: 1 hour, which includes inspection along
with repairs if necessary.

Recall Topics: Recall>24V888>Inspect
Recall>24V888>Repair

Required Tools


- 1/2" Wrench • T20 Torx Socket • 1/2" Socket (1/4" or 3/8" Drive) • 1/4" or 3/8" Ratchet • Regular Screwdriver

1. Adjust the driver front seat to its rear most position. See Photo A.

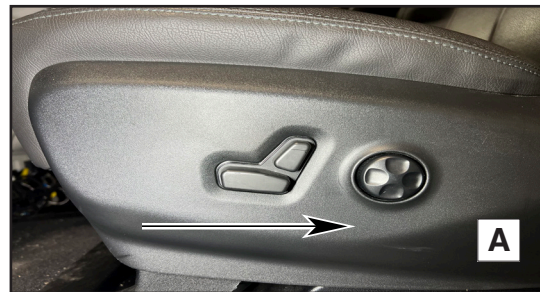

2. Verify if the stop bracket, bolt and nut are installed on both the inboard and outboard seat tracks. See Photo(s) B.

NOTE: If the stop bracket, nut and bolt are installed, no further steps are needed. If they are NOT, proceed to Step 3.

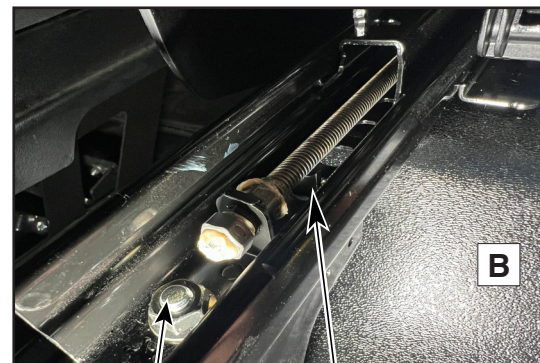


Bolt & Nut

Stop Bracket

3. Remove the torx screw(s) securing the seat track covers followed by the covers. See Photo C.


NOTE: I4 and E4's will have one screw for each panel. CV's will have additional screws securing the rear of the panel.

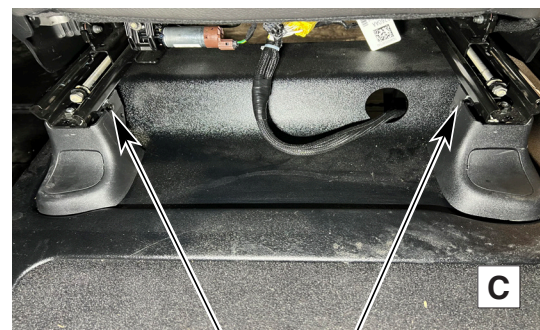

T20 Torx Screws


4. Install the stop bracket, bolt and nut.
See Photo D.

NOTE: Hardware shown below. See
Photo E.

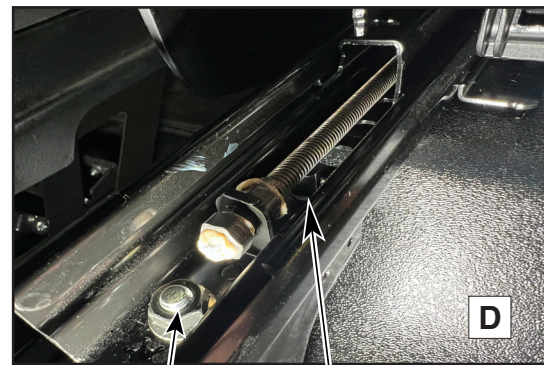

Bolt & Nut Stop Bracket

5. Reinstall both of the seat track covers.
See Photo F.

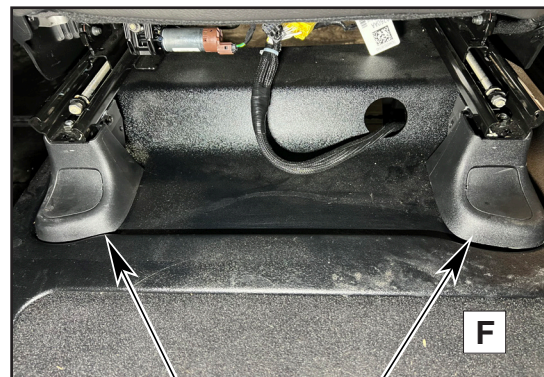

Covers