

July 29, 2026

Version 2

Safety Recall: 2021-23 TLX Fuel Tank Replacement

Supersedes version 1 to revise the information at:

Under PARTS INFORMATION, the information has been updated.

APPLIES TO

Year	Model	Trim Level	VIN Range
2021-23	TLX (incl. Type S)	ALL	Check the iN VIN status for eligibility

BACKGROUND

A very small number of 2021-23 TLX units may have been produced with an improperly welded junction between the fuel filler neck and fuel tank.

Due to the improper weld, fuel may leak while the vehicle is parked or driven. If a fuel leak occurs in the presence of an ignition source, the risk of a fire is increased. The vehicle could display Diagnostic Trouble Code (DTC) P0456.

CLIENT NOTIFICATION

Owners of affected vehicles will be sent a notification of this campaign. Do an iN VIN status inquiry to make sure the vehicle is shown as eligible. Some vehicles affected by this campaign may be in your new or used vehicle inventory.

Failure to repair a vehicle subject to a recall or campaign may subject your dealership to claims or lawsuits from the client or anyone else harmed as a result of such failure. To see if a vehicle in inventory is affected by this safety recall, do a VIN status inquiry before selling it.

CORRECTIVE ACTION

Replace the fuel tank.

PARTS INFORMATION

The fuel tank will be retrieved after the repair is completed. Retain the original fuel tank shipping box for return shipment. Once the repair is complete, contact American Honda at mqe_shipping@na.honda.com for return shipping instructions.

Part Name	Part Number	Quantity
Fuel Tank	17044-TGV-A03	1
Retainer (White)	17711-S84-004	1
Exhaust Gasket	18393-SJA-A01	1
Self-lock nut (10MM)	90212-SA5-003	3
Flange bolt (10X47.5) (AWD only)	90114-TJB-000	6
Flange bolt (8X47) (AWD only)	90113-TJB-000	8
Flange bolt (10X29) (AWD only)	90382-SH9-003	2

CLIENT INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Acura automobile dealer.

REQUIRED MATERIALS

NONE

TOOL INFORMATION

Tool Name	Tool Number	Quantity
Cam lock ring tool	07AAA-TBAA100	1
ORVR service plug	07AAK-TBAA100	1

WARRANTY CLAIM INFORMATION

Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
3101GZ	Replace fuel tank	2.5hr	6FW00	JKX00	B24057A	17044-TGV-A03
A	For AWD - Add	0.6hr	6FW00	JKX00	B24057B	17044-TGV-A03

REPAIR PROCEDURE

⚠ WARNING

Leaking fuel can ignite, causing a fire or explosion. This can cause serious injury or death.
Always work in a well-ventilated area and keep sparks or open flames away.

1. Follow the service manual procedure [Fuel Tank Removal and Installation](#) to replace the fuel tank.

California residents only: Fill out a Vehicle Emissions Recall – Proof of Correction certificate and use **JKX** as the recall number. Have the service advisor give the certificate to your client and advise him or her to keep it as proof that the recall was completed. Your client will need to submit this certificate to the DMV only if the DMV requests it. If you need more certificates, use reorder number **Y0657**

Vehicle Emission Recall - Proof of Correction					
License Number	Make	Year Model	Body Type	Vehicle Identification Number	
Manufacturer			Recall Number JKX		
The above described vehicle has been repaired, modified and/or equipped with emission control devices to meet applicable California Emission Control Laws.					
Dealer's Name			Address, City, State and Zip		
Date	Dealership's Authorized Signature				
	x				
Return this certificate to DMV only when required - otherwise retain for your records.					

Y0657 ACL 24832 (0212)