



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

25V017

Manufacturer Name: Jaguar Land Rover North America, LLC

Submission Date: Feb 11, 2026

NHTSA Recall No.: 25V017

Manufacturer Recall No.: H535

Manufacturer Information

Population

Manufacturer Name: Jaguar Land Rover North
America, LLC

Address: 100 Jaguar Land Rover
Way
Mahwah NJ, 07495

Total number of potentially involved: 5,329

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2019-2020 JAGUAR XE

Product Category: Light Vehicles

Product Type:

Fuel / Propulsion:

Production Dates: Jun 18, 2018 - Sep 10, 2020

Number of potentially involved:

Descriptive Information:

Jaguar Land Rover is conducting a voluntary safety recall campaign involving certain 2019-2020MY Jaguar XE vehicles built at the Castle Bromwich Vehicle Assembly Plant from June 18, 2018 - September 10, 2020. 5,329 Jaguar XE vehicles in the United States and Federalized Territories. The basis for the recall population of Jaguar XE vehicles was determined to be all vehicles in recall population H445, plus 20MY vehicles with a similar harness design.

Defect / Noncompliance Description

Description of the defect or noncompliance:

A concern has been identified on certain 2019MY and 2020MY Jaguar XE vehicles, where the rear camera image display may become intermittent or permanently fail as a result of wiring damage in the trunk.

FMVSS1:

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

Part 573 Safety Recall Report

25V017

Lack of, or intermittent, display of the rear camera image may result in the driver being unaware of objects or pedestrians behind the vehicle increasing the risk of a crash.

Description of the cause:**Identification of any warning that can occur:**

Component Manufacturer

Tier of Supplier:**Supplier Type:****Name:** LEONI WIRING SYSTEMS UK LIMITED (CBMP)**Address:** Lower Milehouse Lane
Newcastle under Lyme
Staffordshire Foreign States, ST5 9BT**Country:** United Kingdom

Involved Components

Component Name 1: Harness**Component Description:** Harness**Component Part Number:** KX73-14A005-Z

Chronology

During Q1 2024, engineering testing was reviewed to confirm the suitability of the remedial action being completed as part of safety, recall H445. The results of this were reviewed at JLR's Product Safety and Compliance Committee (PSCC), where concerns were expressed about the durability of the remedial action. During Q2 and Q3 2024, Engineering undertook a series of further tests, evaluations and assessments of the testing being completed to assure PSCC and themselves that the testing was representative of the H445 remedy installed state. It was also discussed that the design of the 2020 model year harness and installation was similar to those installed as part of the H445 safety recall. In Q4 2024, it was revealed that the testing was representative of the installed state for 2019 model year vehicles and decided that the testing should be run to the conclusion of the test regime (representing full vehicle life) in order to give valid information to allow assessment of further risk to be completed. The outcome of these tests was revealed on 07 January 2025 where the results showed that the 2019 model year remedy and the installed state of the 2020 model year part were not considered to be durable for the life of the vehicle. As a result, the PSCC recommended this matter be progressed to the Recall Determination Committee (RDC) for consideration of a further recall for 2019 model year vehicles as the

Part 573 Safety Recall Report

25V017

defect had not been adequately remedied, and the expansion of the scope to include 2020 module vehicles for the affected markets. On 09 January 2025, the RDC determined that the issue presented an unreasonable risk to safety and requested that a safety recall be launched to remedy the affected vehicles. There have been no reported accidents, injuries or fires as a result of this concern. JLR has received 5 claims and field reports in the USA on 22 April 2022, 08 February 2023, 16 November 2023, 06 February 2024, and 29 July 2024.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type: Inspect, Replace

Consumer Advisories: Do Not Drive Park Outside

Description of remedy program:

The vehicles will have the camera cable inspected and repaired or replaced as necessary.

There will be no charge to the owners for this repair.

Customers who have paid for a repair of this defect out of warranty will be reimbursed by the Jaguar Land Rover reimbursement plan, subject to the usual terms and conditions.

How remedy component differs from recalled component:

Identify how/when recall condition was corrected in production:

Reimbursement Plan

Description of reimbursement program:

Period of reimbursement:

Costs to be reimbursed:

Address for reimbursement claims:

Recall Schedule

Part 573 Safety Recall Report**25V017****Description of recall schedule:**

Notifications to dealers will occur on January 30, 2025.

Distribution of interim owner notification letters occurred on March 3, 2025.

Distribution of final repair owner notification letters occurred on February 2, 2026.

Planned Dealer Notification Date: Jan 30, 2025 - Jan 30, 2025

No Dealers

Planned Interim Owner Notification Date:

No Owners

Planned Remedy Owner Notification Date: Mar 14, 2025 - Mar 14, 2025

Phased Recall

Date when VIN will be searchable: