The information contained in this report was submitted pursuant to 49 CFR §573

Population :

Part 573 Safety Recall Report

Manufacturer Name :KTM North America, Inc.Submission Date :FEB 07, 2025NHTSA Recall No. :25V-074Manufacturer Recall No. :NR

Manufacturer Information :

Manufacturer Name : KTM North America, Inc. Address : 1119 Milan Avenue Amherst OH 44001 Company phone : 440-985-3553

Vehicle Information :

	2022-2024 Husqvarna FE 350s, FE 501s
• •	MOTORCYCLES
Body Style :	
Power Train :	GAS
Descriptive Information :	The brake caliper was only used on affected motorcycles. Affected units were produced between specified dates. The total number of Husqvarna units is 4169, and GASAS units are 947.
	Husqvarna and GASGAS motorcycles included:
	2022 Husqvarna FE 350s
	2023 Husqvarna FE 350s
	2024 Husqvarna FE 350s
	2022 Husqvarna FE 501s
	2023 Husqvarna FE 501s 2024 Husqvarna FE 501s
	2024 Husqvallia FE 3015
	2024 GASGAS ES 350
	2025 GASGAS ES 350
	2024 GASGAS ES 500
	2025 GASGAS ES 500
Production Dates :	JAN 13, 2022 - OCT 11, 2023
VIN Range 1:	Begin : VBKUAG40XNM252726 End : VBKUAJ409RM459739 Not sequential



Number of potentially involved : 5,116 Estimated percentage with defect : 1%

Part 573 Safety Recall Report

	2024-2025 GASGAS ES 350; ES 500
Vehicle Type :	MOTORCYCLES
Body Style :	
Power Train :	GAS
Descriptive Information :	The brake caliper was only used on affected motorcycles. Affected units were produced between specified dates. The total number of Husqvarna units is 4169, and GASAS units are 947.
	Husqvarna and GASGAS motorcycles included:
	2022 Husqvarna FE 350s
	2023 Husqvarna FE 350s
	2024 Husqvarna FE 350s
	2022 Husqvarna FE 501s
	2023 Husqvarna FE 501s
	2024 Husqvarna FE 501s
	2024 GASGAS ES 350
	2025 GASGAS ES 350
	2024 GASGAS ES 500
	2025 GASGAS ES 500

Production Dates : JUN 27, 2023 - MAY 16, 2024 VIN Range 1 : Begin : VBKGCG404RM213160 End : VBKGCJ405SM463249 Vot sequential

Description of Defect :

Description of the Defect :	Casting irregularities are seen in the top portion of the caliper and noted in the manufactures bulletin.
FMVSS 1 :	NR
FMVSS 2 :	NR
Description of the Safety Risk :	On affected models, during use, it is possible the upper guide pin of the brake caliper may crack. If the front brake caliper cracks at the upper guide pin it may reduce the braking system's effectiveness.
Description of the Cause :	Irregularities were found in the casting structure of one of the brake supplier's sub-suppliers. In the worst case, this can lead to the front brake caliper cracking in the area around the upper guide pin.
Identification of Any Warning that can Occur :	None

25V-074

The information contained in this report was submitted pursuant to 49 CFR \$573

Part 573 Safety Recall Report

Involved Components :

Component Name 1:	Front brake caliper
Component Description :	Front brake caliper
Component Part Number :	#A59013015044

Supplier Identification :

Component Manufacturer

Name :	J. JUAN
Address :	Carrer de Miquel Servet, 21-23
	Barcelona Foreign States 08850
Country :	Spain

Chronology:

In the course of ongoing market monitoring, the first case of the mounting point of the brake caliper guide pin breaking was from supplier J. Juan, in April 2024.

KTM Sportmotorcycle GmbH and the supplier began investigating the components and condition in April 2024. KTM Sportmotorcycle GmbH and J. Juan investigated the conditions, and the final technical confirmation was sent on October 21, 2024. No injuries or deaths have been reported.

Description of Remedy :

Description of Remedy Program :	Official KTM/GASGAS and Husqvarna dealers will inspect the front brake mounting caliper and determine which version of the caliper is installed. If the affected version of the caliper is identified, it must be replaced with the corrected version.
	Casting irregularities are seen in the top portion of the caliper and noted in the manufactures bulletin. Vehicles produced later may also have "centering holes" that are not affected by the recall or replacement.
Identify How/When Recall Condition was Corrected in Production :	The part manufacturer changed the sub-suppliers to the sub-supplier which had no casting issue.

Recall Schedule :

Description of Recall Schedule :	KTM North America,dba GASGAS North America and Husqvarna Mobility North America are notifying all registered owners of the above-affected motorcycles by mail and all authorized dealers via GASGAS Dealernet and Husqvarna Dealernet, an internet based communication portal.
Planned Dealer Notification Date : Planned Owner Notification Date :	FEB 10, 2025 - JUL 13, 2026

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573