Part 573 Safety Recall Report

Manufacturer Name :BMW of North America, LLCSubmission Date :FEB 20, 2025NHTSA Recall No. :25V-106Manufacturer Recall No. :NR

Manufacturer Information :

Manufacturer Name : BMW of North America, LLC Address : P.O. Box 1227 Westwood NJ 07675-1227 Company phone : 18005257417

Vehicle Information :

Vehicle 1: 20	2022-2024 BMW X3 sDrive30i, X3 xDrive30i			
Vehicle Type : LI	LIGHT VEHICLES			
Body Style : SU	SUV			
Power Train : GA	GAS			
Descriptive Information : Ap	Approximately 40,736 vehicles may not fully conform to FMVSS 206 Section 4.3.1.			
	Basis for recall population determination: Vehicle assembly information was used to determine the specific dates of potentially affected vehicles.			
wi	Recall component difference to non-recall component: Vehicles have been equipped with second row seat side door locking modules that may not fully conform to FMVSS 206 Section 4.3.1.			
Production Dates : AUG 11, 2021 - AUG 27, 2024				
VIN Range 1 : Begin : NR End : NR				
Description of Noncompliance :				
	This issue involves second row seat side door locking modul affected vehicles were equipped with modules that may not FMVSS 206 Section 4.3.1.			
FMVSS 1 : FMVSS 2 :	206 - Door locks and door retention components NR			
Description of the Safety Risk :	On potentially affected vehicles, the second row seat side do require separate actions to unlock, and to unlatch (via the in handle) the doors and, therefore, this could increase the risk seat occupants.	terior door		

The information contained in this report was submitted pursuant to 49 CFR §573



Number of potentially involved : 40,736 Estimated percentage with defect : 100 %

Population :

25V-106

Part 573 Safety Recall Report

Description of the Cause : NR

Identification of Any Warning NR that can Occur :

Involved Components :

Component Name 1:	Second Row Seat Side Door Locking Modules
Component Description :	Second Row Seat Side Door Locking Modules
Component Part Number :	N/A - Vehicle Assembly Plant Issue

Supplier Identification :

Component Manufacturer

Name : BMW AG Address : NR NR Country : NR

Chronology :

On January 30, 2025, during internal vehicle testing, it was noticed that a second row seat side door could be unlocked and unlatched with a single motion. An engineering review was initiated.

Engineering information and technical drawings were reviewed. Worldwide regulatory requirements, including US-specific requirements, were checked. Vehicle assembly plants were contacted to check vehicle build configuration documentation and module functionality.

Vehicle assembly information was reviewed to determine the number and production dates of potentially affected vehicles.

On February 12, 2025, BMW determined that potentially affected vehicles may not fully conform to FMVSS 206 Section 4.3.1 and decided to conduct a voluntary non-compliance recall.

BMW is not aware of any warranty claims, customer complaints, or field reports related to this issue. BMW has not received any reports, nor is BMW otherwise aware, of any accidents or injuries related to this issue.

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

25V-106

Page 3

Description of Remedy :

door locking modules will be replaced	Description of Remedy Program : The second
y First Class mail and instructed to tak BMW dealer to have the remedy perfor re noticed on a potentially affected vel would be covered by the BMW New V m. Therefore, reimbursement for a pr rt 573.13 and Part 577.11 is not neces	vehicle to free. If th to this re Limited V
0	How Remedy Component Differs Recalled from Recalled Component : N/A (veh
	dentify How/When Recall Condition NR was Corrected in Production :
re noticed on a potentially affected vel would be covered by the BMW New V m. Therefore, reimbursement for a pr rt 573.13 and Part 577.11 is not neces cond Row Seat Side Door Locking Mod	free. If the to this re Limited V notification How Remedy Component Differs from Recalled Component : N/A (veh dentify How/When Recall Condition NR

Recall Schedule :

Description of Recall Schedule :	Dealer notification is planned to begin and end on February 20, 2025. Owner notification is planned to begin and end on April 14, 2025
Planned Dealer Notification Date : Planned Owner Notification Date :	

* NR - Not Reported