

# Part 573 Safety Recall Report

# 25V-205

**Manufacturer Name :** Jayco, Inc.**Submission Date :** APR 02, 2025**NHTSA Recall No. :** 25V-205**Manufacturer Recall No. :** Shyft Group 25V-114**Manufacturer Information :**

Manufacturer Name : Jayco, Inc.

Address : 903 South Main Street

PO Box 460 Middlebury IN 46540

Company phone : 800-283-8267

**Population :**

Number of potentially involved : 34

Estimated percentage with defect : 100 %

**Vehicle Information :**

Vehicle 1 : 2024-2025 Entegra Coach Anthem

Vehicle Type : BUSES, MEDIUM &amp; HEAVY VEHICLES

Body Style : OTHER

Power Train : DIESEL

Descriptive Information : Shyft Group provided a list of affected VIN numbers to Jayco compliance regarding their recall 25V-114. Jayco matched those VIN numbers to our production records.

Production Dates : MAR 12, 2024 - DEC 18, 2024

VIN Range 1 : Begin : 4VZAU1D16RC095370 End : 4VZAT1D18SC095461  Not sequential

Vehicle 2 : 2024-2025 Entegra Coach Aspire

Vehicle Type : BUSES, MEDIUM &amp; HEAVY VEHICLES

Body Style : OTHER

Power Train : DIESEL

Descriptive Information : Shyft Group provided a list of affected VIN numbers to Jayco compliance regarding their recall 25V-114. Jayco matched those VIN numbers to our production records.

Production Dates : MAR 12, 2024 - MAY 28, 2024

VIN Range 1 : Begin : 4VZAU1D19RC095394 End : 4VZAU1D12SC095534  Not sequential

Vehicle 3 : 2025-2025 Entegra Coach Reatta XL

Vehicle Type : BUSES, MEDIUM &amp; HEAVY VEHICLES

Body Style : OTHER

Power Train : DIESEL

Descriptive Information : Shyft Group provided a list of affected VIN numbers to Jayco compliance regarding their recall 25V-114. Jayco matched those VIN numbers to our production records.

Production Dates : MAY 28, 2024 - MAY 28, 2024

VIN Range 1 : Begin : 4VZAR1D11SC095526 End : 4VZAR1D11SC095526  Not sequential

**Description of Defect :**

Description of the Defect : The remote fuel filter hose may separate from the fitting, causing a fuel leak and an engine stall.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : A fuel leak in the presence of an ignition source increases the risk of a fire. An engine stall increases the risk of a crash.

Description of the Cause : The subject hoses may have insufficient crimping of the connector, possibly resulting in insufficient hose retention.

Identification of Any Warning that can Occur : Persons operating in or around the vehicle may see smoke or other visible signs of a fuel leak or may smell diesel fuel.

**Involved Components :**

Component Name 1 : L9 Diesel Engine

Component Description : L9 Diesel Engine

Component Part Number : 0866-AA2-001, 0866-AA2-003, 0866-AA2-004, and 0866-AA2-006

**Supplier Identification :****Component Manufacturer**

Name : Cummins, Inc.

Address : Box 3005 Mail Code COB118  
Columbus Indiana 47202

Country : United States

**Chronology :**

Please refer to Shyft Group's chronology on 25V-114.

On January 21, 2025, Shyft was notified of Cummins recall 25E-004 and supplied a list of affected engine serial numbers. Shyft then began correlating the engine serial numbers to the affected chassis and their respective Vehicle Identification Numbers (VIN's). After confirming the affected VIN's had been identified, on February 14, 2025 Shyft determined a defect related to motor vehicle safety could exist in those chassis.

On March 3, 2025, Jayco's Warranty Incident Review Committee (WIRC) reviewed the incident and elevated it to CPAC. On March 5, 2025 The Corrective Preventive Action Committee (CPAC) decided to elevate the incident

to the Safety Steering Committee (SSC). On March 27, 2025, SSC voted to proceed with a pass through chassis recall. Jayco is not aware of any reports of accident or injury related to this condition.

## Description of Remedy :

**Description of Remedy Program :** Shyft Group will work with the equipment manufacturer, Cummins, to replace the fuel hoses, free of charge. A fuel leak on the affected engines related to the fuel hoses would be remedied through the normal course of warranty. Therefore, Shyft and Jayco Inc. manufacturer's reimbursement plan would not be needed for this matter. Shyft Group will be reporting the quarterly completion rates to NHTSA.

**How Remedy Component Differs from Recalled Component :** The remedied components have an improved crimp and different batch code. The defective hoses have a batch code 518220 printed on the hose data tag.

**Identify How/When Recall Condition was Corrected in Production :** The condition was corrected at Cummins' supplier of the hoses in January 2024 with an update to the specification of the second crimping station. Shyft did not have engines subject to this recall in its inventory. All affected engines have been installed in chassis.

## Recall Schedule :

**Description of Recall Schedule :** Jayco will notify its dealers and affected retail owners.

**Planned Dealer Notification Date :** APR 30, 2025 - APR 30, 2025

**Planned Owner Notification Date :** APR 30, 2025 - APR 30, 2025

\* NR - Not Reported