



U.S. Department  
of Transportation

National Highway  
Traffic Safety  
Administration

## Part 573 Safety Recall Report

## 25V387

**Manufacturer Name:** Rivian Automotive, LLC

**Submission Date:** Jun 11, 2025

**NHTSA Recall No.:** 25V387

**Manufacturer Recall No.:** FSAM-1693

### Manufacturer Information

### Population

**Manufacturer Name:** Rivian Automotive, LLC

**Address:** 13250 North Haggerty Road  
PLYMOUTH MI, 48170

**Total number of potentially involved:** 27,882

**Estimated percentage with defect:** 0.6%

### Vehicle Information

**Vehicle 1:** 2025-2025 RIVIAN R1S

**Product Category:** Light Vehicles

**Product Type:** Multipurpose Passenger Vehicle

**Fuel / Propulsion:** Electric Battery Power

**Production Dates:** Apr 29, 2024 - May 13, 2025

**Number of potentially involved:** 22,807

#### Descriptive Information:

The recall population includes certain Model Year 2025 R1T and R1S vehicles that may have been built with front turn signal lamps that do not meet current production specifications due to incorrectly manufactured parts from the supplier. The suspect period began on April 29, 2024, when Rivian started to build vehicles with front turn signal lamps that were potentially incorrectly manufactured and ended on May 13, 2025, when Rivian stopped building vehicles with the suspect front turn signal lamps. That population was determined using manufacturing records. Similar vehicles not included in this recall have properly manufactured front turn signal lamps.

**Vehicle 2:** 2025-2025 RIVIAN R1T

**Product Category:** Light Vehicles

**Product Type:** Light Truck

**Fuel / Propulsion:** Electric Battery Power

**Production Dates:** Jul 10, 2024 - May 13, 2025

**Number of potentially involved:** 5,075

#### Descriptive Information:

The recall population includes certain Model Year 2025 R1T and R1S vehicles that may have been built with front turn signal lamps that do not meet current production specifications due to incorrectly manufactured parts from the supplier. The suspect period began on April 29, 2024, when Rivian started to build vehicles with front turn signal lamps that were potentially incorrectly manufactured and ended

# Part 573 Safety Recall Report

# 25V387

on May 13, 2025, when Rivian stopped building vehicles with the suspect front turn signal lamps. That population was determined using manufacturing records. Similar vehicles not included in this recall have properly manufactured front turn signal lamps.

## Defect / Noncompliance Description

### Description of the defect or noncompliance:

One or both front turn signal lamps may not illuminate and flash, and, therefore, may not fulfill the requirements of FMVSS 108.

**FMVSS1:** 108 - Lamps, reflective devices, and assoc. Equipment

**FMVSS2:**

### Description of the safety risk, including crash, fire, death, injury:

Diminished front turn signal lamp performance may cause reduced awareness of the vehicle's intent to turn for road users in front of the vehicle. Reduced awareness of intent to turn may increase the risk of a crash. Rivian is not aware of any crashes, injuries, or fatalities related to this condition.

### Description of the cause:

Issues during turn signal lamps manufacturing by the supplier may result in an internal failure of some turn signal lamps during use.

### Identification of any warning that can occur:

If one or more front turn signal lamps fail to illuminate, a message that says "Turn signal lights not working. Service it soon." appears on the driver display. This, along with double speed blinking from the remaining turn signal lamps and double speed turn signal sounds, will alert the driver that one of their turn signals is not illuminated.

## Component Manufacturer

**Tier of Supplier:** Tier 2

**Supplier Type:**

**Name:** Myotek

**Address:** 37000 Grand River Avenue - Suite 220  
Farmington Hills MI, 48335

**Country:** United States

## Involved Components

# Part 573 Safety Recall Report

# 25V387

**Component Name 1:** Lamp, Fascia, Lower, LH

**Component Description:** DIRECTION INDICATOR LAMP LH

**Component Part Number:** PT00882632

**Component Name 2:** Lamp, Fascia, Lower, RH

**Component Description:** DIRECTION INDICATOR LAMP RH

**Component Part Number:** PT00882633

## Chronology

In February 2025, Rivian analyzed turn signal lamps from warranty returned parts and opened an investigation based on analysis that showed some of the failures may have resulted from a supplier manufacturing issue.

From March 2025 through May 2025, Rivian continued investigating the condition to determine the potentially affected population and possible implications for FMVSS 108, Lamps, reflective devices, and assoc. equipment.

On June 4, 2025, Rivian determined that a potential noncompliance to FMVSS 108, Lamps, reflective devices, and assoc. equipment cannot be ruled out.

As of the date of this filing, Rivian is not aware of any accidents or injuries related to this issue in any market.

**Related NHTSA Recall Number:**

## Description of Remedy

**Remedy Type:** Inspect, Replace

**Consumer Advisories:** ☐ Do Not Drive ☐ Park Outside

**Description of remedy program:**

Rivian will inspect and/or replace the front turn signal lamps on the potentially affected vehicles.

**How remedy component differs from recalled component:**

The remedy component will be front turn signal lamps that meet current production specifications.

**Identify how/when recall condition was corrected in production:**

# Part 573 Safety Recall Report

**25V387**

## Reimbursement Plan

Manufacturer used general reimbursement plan on file.

## Recall Schedule

**Description of recall schedule:**

We will mail notifications on or before July 25, 2025.

**Planned Dealer Notification Date:**☒ No Dealers**Planned Interim Owner Notification Date:**☐ No Owners**Planned Remedy Owner Notification Date:** Jul 25, 2025 - Jul 25, 2025☐ Phased Recall**Date when VIN will be searchable:** Jul 25, 2025