



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

25V477

Manufacturer Name: Lamborghini (Automobili Lamborghini)

Submission Date: Jul 22, 2025

NHTSA Recall No.: 25V477

Manufacturer Recall No.: L74X-R.01.25

Manufacturer Information

Population

Manufacturer Name: Lamborghini (Automobili
Lamborghini)

Address: Via Modena 12
Sant'Agata Bolognese (BO)
40019 - Italy Foreign
States, 99999

Total number of potentially involved: 27

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2024-2024 LAMBORGHINI REVUELTO

Product Category: Light Vehicles

Product Type: Passenger Car

Fuel / Propulsion: Plug-In Hybrid

Production Dates: Dec 20, 2023 - Oct 28, 2024

Number of potentially involved: 20

Descriptive Information:

The recall population was determined through production records.

Vehicles outside of the population have been inspected in factory prior to shipment or at destination port.

Vehicle 2: 2025-2025 LAMBORGHINI REVUELTO

Product Category: Light Vehicles

Product Type: Passenger Car

Fuel / Propulsion: Plug-In Hybrid

Production Dates: Nov 10, 2024 - Feb 18, 2025

Number of potentially involved: 7

Descriptive Information:

The recall population was determined through production records.

Part 573 Safety Recall Report

25V477

Vehicles outside of the population have been inspected in factory prior to shipment or at destination port.

Defect / Noncompliance Description

Description of the defect or noncompliance:

Lamborghini has determined that a defect which relates to motor vehicle safety may arise in some MY 2024 and MY 2025 Revuelto vehicles. The spherical pin that supports the door gas springs, allowing the doors to open and remain in the open position, may not have been assembled according to manufacturing specifications and could come loose.

FMVSS1:

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

If the supporting pins detach, the doors may close under their own weight, posing a potential risk of injury to users. This issue could also make it difficult to open the doors, particularly from inside the vehicle, increasing the risk of injury in an emergency.

Description of the cause:

Due to a production deviation during the assembly of the component, the correct assembly sequence may have not been followed.

Identification of any warning that can occur:

The customer will not receive an advance warning due to the nature of the failure mechanism.

Component Manufacturer

Tier of Supplier:

Supplier Type:

Name:

Address:

Country:

Involved Components

Component Name 1: Spherical Pin

Component Description: Spherical Pin for the door gas springs

Part 573 Safety Recall Report

25V477**Component Part Number:** WHT010281

Chronology

On June 26th 2025 Automobili Lamborghini S.p.A. detected, during final static checks, one case of a vehicle on which the spherical pin that supports the door gas springs came loose. An internal investigation was initiated to clarify the failure aspects and to determine if any additional vehicle could be involved. During the investigation Lamborghini received one field claim of a pre-delivered vehicle which presented low tightening of the spherical pin. The investigation pointed in the direction of a possible production deviation during the assembly of the component, the correct assembly sequence may have not been followed. On July 18th 2025 the matter was presented to the Product Safety Committee, and the results from the investigation revealed that for the specific car, there was no confirmation if the torque value of the spherical pins that support the doors gas springs met production specification. The Product Safety Committee determined that a potential safety risk cannot be ruled out and decided to conduct a voluntary safety recall in order to verify the correct tightening of the involved component. Lamborghini is not aware of any crashes, injuries or complaints related to this issue.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type: Inspect, Repair**Consumer Advisories:** ☐ Do Not Drive ☐ Park Outside**Description of remedy program:**

Automobili Lamborghini S.p.A. will notify all owners of affected vehicles and will instruct them to arrange for an appointment with an authorized Lamborghini dealer. Dealers will check the tightening of the spherical pins of the doors gas spring and rework it if necessary, free of charge.

How remedy component differs from recalled component:

Guaranteed tightening of the spherical pins that support the doors gas spring.

Identify how/when recall condition was corrected in production:

Vehicles produced from June 26th 2025 have been inspected for properly tightening of the spherical pin and the assembly process was revised and improved with data registering technology in order to prevent unknown variables.

Reimbursement Plan

Description of reimbursement program:

Part 573 Safety Recall Report

25V477

Automobili Lamborghini does not plan to provide notice about reimbursement to owners since none of the involved vehicles would have been previously subject to the condition described and all remain covered under the new vehicle warranty.

Period of reimbursement:

Costs to be reimbursed:

Address for reimbursement claims:

Recall Schedule

Description of recall schedule:

Customers will be notified by registered mail and customer app while dealers through Lamborghini dealer portal.

Planned Dealer Notification Date: Jul 21, 2025 - Jul 21, 2025

☐ No Dealers

Planned Interim Owner Notification Date:

☐ No Owners

Planned Remedy Owner Notification Date: Sep 06, 2025 - Sep 11, 2025

☐ Phased Recall

Date when VIN will be searchable: