



U.S. Department  
of Transportation

National Highway  
Traffic Safety  
Administration

## Part 573 Safety Recall Report

## 25V492

**Manufacturer Name:** Porsche Cars North America, Inc.

**Submission Date:** Sep 22, 2025

**NHTSA Recall No.:** 25V492

**Manufacturer Recall No.:** ASA7

### Manufacturer Information

### Population

**Manufacturer Name:** Porsche Cars North  
America, Inc.

**Address:** One Porsche Drive  
Atlanta GA, 30354

**Total number of potentially involved:** 3

**Estimated percentage with defect:** 100%

### Vehicle Information

**Vehicle 1:** 2025-2025 PORSCHE MACAN 4 ELECTRIC

**Product Category:** Light Vehicles

**Product Type:**

**Fuel / Propulsion:** Electric Battery Power

**Production Dates:** Apr 15, 2025 - Apr 15, 2025

**Number of potentially involved:** 1

**Descriptive Information:**

The recall population was determined by production records.

**Vehicle 2:** 2024-2024 PORSCHE MACAN 4 ELECTRIC

**Product Category:** Light Vehicles

**Product Type:**

**Fuel / Propulsion:** Electric Battery Power

**Production Dates:** Aug 02, 2024 - Aug 13, 2024

**Number of potentially involved:** 2

**Descriptive Information:**

The recall population was determined by production records.

# Part 573 Safety Recall Report

# 25V492

## Defect / Noncompliance Description

### Description of the defect or noncompliance:

Due to an assembly deviation, the front seat airbags may not be correctly fastened to the backrest frame in certain vehicles.

**FMVSS1:**

**FMVSS2:**

### Description of the safety risk, including crash, fire, death, injury:

In cases where the front seat airbags are not correctly fastened, proper deployment and positioning of the airbag in the event of a crash cannot be ensured. Additionally, there is a potential risk to occupant safety resulting from loose components. Both issues increase the risk of injury to vehicle occupants.

### Description of the cause:

The operator inserted the screw directly into the frame without first guiding it through the designated eyelet on the airbag housing. As a result, the respective airbag is only partially engaged at the top section of the frame.

### Identification of any warning that can occur:

There is no warning.

## Component Manufacturer

**Tier of Supplier:**

**Supplier Type:**

**Name:** Adient Czech Republic s.r.o.

**Address:** Kratochvílova 2657  
Jelcz-Laskowice Foreign States, 413 01

**Country:** Czech Republic

## Involved Components

**Component Name 1:** Front Seat Airbag

**Component Description:** The front seat airbags, integrated into the seat, are designed to protect occupants during side collisions. It is integrated in the seat backrest frame.

**Component Part Number:** 95C880241\*/2\*

# Part 573 Safety Recall Report

# 25V492

**Component Name 2:** Front Seat Airbag

**Component Description:** The front seat airbags, integrated into the seat, are designed to protect occupants during side collisions. It is integrated in the seat backrest frame.

**Component Part Number:** 95C880581\*/2\*

## Chronology

July 11 – The issue was officially reported and registered for further investigation internally.

July 14 – A technical pre-evaluation of the reported issue was conducted to assess its relevance and potential impact.

July 15 – Experimental testing was commenced to validate the suspected deviation.

Subsequently – Initial test results were obtained and presented. These results indicated a negative outcome regarding proper airbag deployment.

Following this – Further analysis of the issue was carried out, including the identification of potentially affected vehicles.

On July 23, 2025 – the case was presented to Porsche’s safety evaluation committee. Some of the Airbag tests conducted have demonstrated that the restraining effect is no longer guaranteed due to the incorrect positioning of the airbag.

A safety defect was determined in the identified vehicles, and a recall decision was made.

There are no injuries, warranty claims, Field/Service Reports or deaths related to this recall.

**Related NHTSA Recall Number:**

## Description of Remedy

**Remedy Type:**

**Consumer Advisories:**  Do Not Drive  Park Outside

**Description of remedy program:**

Screw connection of the airbag bracket to the seat frame must be checked and, if necessary, reworked to ensure proper airbag mounting according to specifications.

The owner’s letter will not include a statement about customer reimbursement for pre-notification remedies as all the affected vehicles are still covered under Porsche New Car Limited Warranty.

**How remedy component differs from recalled component:**

No component will be replaced during the remedial measure, only the screw connection of the airbag bracket is checked and reworked.

# Part 573 Safety Recall Report

**25V492****Identify how/when recall condition was corrected in production:**

Adjusting of the parameter for the fastening screw on June 30th, 2025.

## Reimbursement Plan

**Description of reimbursement program:****Period of reimbursement:****Costs to be reimbursed:****Address for reimbursement claims:**

## Recall Schedule

**Description of recall schedule:**

Owners will be notified within 60 days of the filing of this report.

**Planned Dealer Notification Date:** No Dealers**Planned Interim Owner Notification Date:** No Owners**Planned Remedy Owner Notification Date:** Phased Recall**Date when VIN will be searchable:** Aug 14, 2025