



U.S. Department  
of Transportation

National Highway  
Traffic Safety  
Administration

## Part 573 Safety Recall Report

# 25V494

**Manufacturer Name:** Kia America, Inc.

**Submission Date:** Nov 04, 2025

**NHTSA Recall No.:** 25V494

**Manufacturer Recall No.:** SC347

### Manufacturer Information

### Population

**Manufacturer Name:** Kia America, Inc.

**Address:** 111 Peters Canyon Road  
Irvine CA, 92606

**Total number of potentially involved:** 201,149

**Estimated percentage with defect:** 6%

### Vehicle Information

**Vehicle 1:** 2023-2025 KIA TELLURIDE

**Product Category:** Light Vehicles

**Product Type:** Multipurpose Passenger Vehicle

**Fuel / Propulsion:** Spark Ignition Fuel

**Production Dates:** Oct 03, 2022 - Sep 18, 2024

**Number of potentially involved:** 201,149

**Descriptive Information:**

Certain 2023 through 2025 model year Kia Telluride vehicles manufactured from October 3, 2022 through September 18, 2024.

The recall population was determined by a review of supplier, Kia vehicle production and warranty records. The vehicles subject to this recall were not produced in VIN order. Customers seeking information about their specific vehicle will be referred to Kia's Customer Care Center or their Kia dealer.

### Defect / Noncompliance Description

**Description of the defect or noncompliance:**

Due to a supplier quality issue, the door belt molding face plate may progressively delaminate and become loose from the base of the molding. If the vehicle continues to be driven in this condition, the face plate may eventually fall off.

**FMVSS1:**

**FMVSS2:**

**Description of the safety risk, including crash, fire, death, injury:**

# Part 573 Safety Recall Report

# 25V494

A face plate that detaches from the vehicle while in motion may create a road hazard for other road users, increasing the risk of a crash.

## Description of the cause:

Insufficient application of the adhesive layer between the door belt molding face plate and base of the molding by the supplier.

## Identification of any warning that can occur:

Visually loose, rattle and/or wind noise.

## Component Manufacturer

**Tier of Supplier:** Tier 1

**Supplier Type:** OEM

**Name:** Saedong

**Address:** 8, Jangansandan 8-Ro, Jangan-Eup  
Gijang-Gun Foreign States, 62414

**Country:** Korea, Republic Of

## Involved Components

**Component Name 1:** W/STRIP ASSM-RR DR BELT O/S RH

**Component Description:** Door Belt Weatherstrip - Rear Right

**Component Part Number:** 83220-S9100 (Dark Satin) / 83220-S9510 (Satin)

**Component Name 2:** W/STRIP ASSM-FR DR BELT O/S LH

**Component Description:** Door Belt Weatherstrip - Front Left

**Component Part Number:** 82210-S9100 (Dark Satin) / 82210-S9510 (Satin)

**Component Name 3:** W/STRIP ASSM-FR DR BELT O/S RH

**Component Description:** Door Belt Weatherstrip - Front Right

**Component Part Number:** 82220-S9100 (Dark Satin) / 82220-S9510 (Satin)

**Component Name 4:** W/STRIP ASSM-RR DR BELT O/S LH

**Component Description:** Door Belt Weatherstrip - Rear Left

# Part 573 Safety Recall Report

**25V494****Component Part Number:** 83210-S9100 (Dark Satin) / 83210-S9510 (Satin)

## Chronology

See attached document titled "2023-2025MY Telluride Door Belt Molding Face Plates Chronology"

**Related NHTSA Recall Number:**

## Description of Remedy

**Remedy Type:** Replace**Consumer Advisories:**  Do Not Drive  Park Outside**Description of remedy program:**

All owners of the subject vehicles will be notified by first-class mail with instructions to bring their vehicles to a Kia dealer. Dealers will replace the affected door belt molding assembly(ies) not previously replaced under warranty with an improved one. Kia will reimburse owners for repair expenses already incurred pursuant to Kia's General Reimbursement Plan filed May 1, 2024.

**How remedy component differs from recalled component:**

The remedy door belt molding assembly contains a mechanical retention to the base in addition to the adhesive layer.

**Identify how/when recall condition was corrected in production:**

Model year 2025 Telluride vehicles produced beginning on September 19, 2024 contain door belt molding assemblies with face plates that are mechanically retained.

## Reimbursement Plan

Manufacturer used general reimbursement plan on file.

## Recall Schedule

**Description of recall schedule:**

The planned dealer notification begin and end date is July 29, 2025. The planned owner notification begin and end date is September 26, 2025.

**Part 573 Safety Recall Report****25V494****Planned Dealer Notification Date:** Jul 29, 2025 - Jul 29, 2025 No Dealers**Planned Interim Owner Notification Date:** Sep 26, 2025 - Sep 26, 2025 No Owners**Planned Remedy Owner Notification Date:** Nov 19, 2025 - Dec 31, 2025 Phased Recall**Date when VIN will be searchable:** Aug 11, 2025