



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

25V653

Manufacturer Name: Thor Motor Coach

Submission Date: Oct 17, 2025

NHTSA Recall No.: 25V653

Manufacturer Recall No.: RC000331

Manufacturer Information

Population

Manufacturer Name: Thor Motor Coach

Address: PO Box 1486
701 County Road 15
Elkhart IN, 46515

Total number of potentially involved: 23

Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2024-2025 THOR MOTOR COACH LUMINATE

Product Category: Buses, Medium & Heavy Vehicles

Product Type: Recreational Vehicle

Fuel / Propulsion: Compressed Natural Gas

Production Dates: Jul 20, 2023 - Jun 25, 2024

Number of potentially involved: 15

Descriptive Information:

Welded LP mounting tubes located in front of rear axle

Vehicle 2: 2024-2025 THOR MOTOR COACH INDIGO

Product Category: Buses, Medium & Heavy Vehicles

Product Type: Recreational Vehicle

Fuel / Propulsion: Compressed Natural Gas

Production Dates: Dec 13, 2023 - Jul 24, 2024

Number of potentially involved: 8

Descriptive Information:

Welded LP mounting tubes located in front of rear axle

Defect / Noncompliance Description

Part 573 Safety Recall Report**25V653****Description of the defect or noncompliance:**

The LP tank support tube is too short and has an inferior chassis weld.

FMVSS1:

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

If the LP tank support tube weld separates from the chassis the LP tank can drop leading to an increased risk of a crash, injury or fire.

Description of the cause:

Identification of any warning that can occur:

Component Manufacturer

Tier of Supplier:

Supplier Type:

Name:

Address:

Country:

Involved Components

Component Name 1:

Component Description:

Component Part Number:

Chronology

11/15/2024 - Warranty request submitted for LP tank separation by selling dealer (Canada) while the owner is traveling in the U.S. (Texas). The purpose was to report the incident and note a sublet repair will follow.

3/4/2025 - Selling dealer (Canada) submitted a claim for the proper LP tank repair after the owner returned to Canada.

Part 573 Safety Recall Report

25V653

3/11/2025 - TMC Engineering was made aware of the LP tank bracket separation at a Canadian dealer due to inadequate welds on the support tubing. Repair instructions were generated for servicing dealer to follow. TMC Engineering opened and investigation on LP tank installation.

5/12/2025 - TMC Engineering continued to evaluate the issue. All parties monitoring for additional claims.

9/12/2025 - The original issue was found posted on social media.

9/29/2025 - TMC Safety Committee met and voted to issue a voluntary recall.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type:

Consumer Advisories: Do Not Drive Park Outside

Description of remedy program:

Support brackets will be added to both sides of the LP tank support tubes. This will provide additional support beyond the existing weld. The new support brackets will also be secured to the chassis frame preventing the LP tank from dropping if a weld failure would occur.

How remedy component differs from recalled component:

LP tank support tubes will have additional brackets added to work in conjunction with the current weld.

Identify how/when recall condition was corrected in production:

engineering issued a design change to lengthen the support LP tank tubes to provide adequate surface for welds.

Reimbursement Plan

Manufacturer used general reimbursement plan on file.

Recall Schedule

Description of recall schedule:

Thor Motor Coach has the utmost urgency in notifying owners about a recall that affects their vehicle. Letters will be sent out once all pertinent information has been gathered.

Part 573 Safety Recall Report**25V653**

Planned Dealer Notification Date: Nov 24, 2025 - Nov 24, 2025 No Dealers

Planned Interim Owner Notification Date: Nov 24, 2025 - Nov 24, 2025 No Owners

Planned Remedy Owner Notification Date: Nov 24, 2025 - Nov 24, 2025 Phased Recall

Date when VIN will be searchable: