



U.S. Department  
of Transportation

National Highway  
Traffic Safety  
Administration

## Part 573 Safety Recall Report

# 25V664

**Manufacturer Name:** REV Recreation Group

**Submission Date:** Oct 03, 2025

**NHTSA Recall No.:** 25V664

**Manufacturer Recall No.:** 251003REV

### Manufacturer Information

### Population

**Manufacturer Name:** REV Recreation Group

**Address:** 1031 U.S. 224 E  
P.O. Box 31  
Decatur IN, 46733

**Total number of potentially involved:** 39

**Estimated percentage with defect:** 100%

### Vehicle Information

**Vehicle 1:** 2024-2026 HOLIDAY RAMBLER INVICTA

**Product Category:** Buses, Medium & Heavy Vehicles

**Product Type:** Recreational Vehicle

**Fuel / Propulsion:** Spark Ignition Fuel

**Production Dates:** Jun 20, 2023 - Sep 15, 2025

**Number of potentially involved:** 15

**Descriptive Information:**

On certain Fleetwood Fortis and Holiday Rambler Invicta Y and T models with the theater seat option have fasteners that may have damaged LP (Liquid Propane) hoses.

**Vehicle 2:** 2024-2026 FLEETWOOD FORTIS

**Product Category:** Buses, Medium & Heavy Vehicles

**Product Type:** Recreational Vehicle

**Fuel / Propulsion:** Spark Ignition Fuel

**Production Dates:** Jun 20, 2023 - Sep 15, 2025

**Number of potentially involved:** 24

**Descriptive Information:**

On certain Fleetwood Fortis and Holiday Rambler Invicta Y and T models with the theater seat option have fasteners that may have damaged LP (Liquid Propane) hoses.

# Part 573 Safety Recall Report

**25V664**

## Defect / Noncompliance Description

**Description of the defect or noncompliance:**

On certain Fleetwood Fortis and Holiday Rambler Invicta Y and T models with the theater seat option have fasteners that may have damaged LP (Liquid Propane) hoses.

**FMVSS1:****FMVSS2:****Description of the safety risk, including crash, fire, death, injury:**

Theater seat option mounting screws may penetrate or damage the LP hoses causing risk of fire, injury or death.

**Description of the cause:**

In the process of mounting the theater seat option, a fastener was installed through a bracket which may have damaged the LP hoses causing a risk of fire, injury or death.

**Identification of any warning that can occur:**

May detect an odor of LP in the living area. Unexplained loss of LP identified on the LP monitor.

## Component Manufacturer

**Tier of Supplier:****Supplier Type:****Name:****Address:****Country:**

## Involved Components

**Component Name 1:** LP HOSE**Component Description:** LP HOSE KIT**Component Part Number:** D26-10001

## Chronology

# Part 573 Safety Recall Report

# 25V664

- 9/11 – RRG received a dealer inquiry with complaint of LP leak under the theater seat due to a screw through a bracket under the seat.
  - 9/12 – Follow up with the dealer resulted in recreation of the issue at RRG Decatur.
  - 9/15 – Discussed issue with RRG Engineering. Reviewed prints and a unit in manufacturing without the theater seat (or unit with the standard sofa option). It was determined by the engineering review that the standard sofa option is not in scope as the bracket configuration was different and that the issue was only with the theater seat option. Initiated a stop ship.
  - 9/15 – Warranty claims were reviewed. No previous claims were found.
  - 9/17 - Engineering and Manufacturing conducted a product review with the seat supplier.
  - 9/19 - Engineering determined the bracket was not needed for the theater seat option.
  - 9/23 - RRG safety team reviewed the findings
- 9/24 - Sent data to Corporate Safety committee for review.

**Related NHTSA Recall Number:**

## Description of Remedy

**Remedy Type:** Inspect, Repair

**Consumer Advisories:**  Do Not Drive  Park Outside

**Description of remedy program:**

An authorized REV RV Dealer or Service Center will be provided with technical instructions by REV RV so technicians can perform an inspection and repair of the LP hoses under the theater seating area. Damaged hoses will be replaced

**How remedy component differs from recalled component:**

The extra bracket on support arm is not on the remedy component. This eliminates the risk of damage to the LP hoses.

**Identify how/when recall condition was corrected in production:**

Production corrections were implemented on 9/15/2025 including removal of the errant bracket from the theater seat option from being installed which removes the risk of the LP hose becoming damaged.

## Reimbursement Plan

Manufacturer used general reimbursement plan on file.

# Part 573 Safety Recall Report

# 25V664

## Recall Schedule

**Description of recall schedule:**

Dealer notifications will be conducted via email on or before 11.28.25  
Owner notifications will be conducted via US mail on or before 12.02.25.

**Planned Dealer Notification Date:** Nov 28, 2025 - Nov 28, 2025  No Dealers

**Planned Interim Owner Notification Date:**  No Owners

**Planned Remedy Owner Notification Date:** Dec 02, 2025 - Dec 02, 2025  Phased Recall

**Date when VIN will be searchable:**