



U.S. Department  
of Transportation

National Highway  
Traffic Safety  
Administration

## Part 573 Safety Recall Report

# 25V709

**Manufacturer Name:** Thor Motor Coach

**Submission Date:** Oct 17, 2025

**NHTSA Recall No.:** 25V709

**Manufacturer Recall No.:** RC000335

### Manufacturer Information

### Population

**Manufacturer Name:** Thor Motor Coach

**Address:** PO Box 1486  
701 County Road 15  
Elkhart IN, 46515

**Total number of potentially involved:** 527

**Estimated percentage with defect:** 100%

### Vehicle Information

**Vehicle 1:** 2026-2026 THOR MOTOR COACH GENEVA

**Product Category:** Buses, Medium & Heavy Vehicles

**Product Type:**

**Fuel / Propulsion:**

**Production Dates:** Mar 27, 2025 - Jul 30, 2025

**Number of potentially involved:** 36

**Descriptive Information:**

P-clamps not installed on generator LP fuel hose.

**Vehicle 2:** 2025-2026 THOR MOTOR COACH QUANTUM

**Product Category:** Buses, Medium & Heavy Vehicles

**Product Type:**

**Fuel / Propulsion:**

**Production Dates:** Dec 02, 2024 - Aug 13, 2025

**Number of potentially involved:** 52

**Descriptive Information:**

P-clamps not installed on generator LP fuel hose.

**Vehicle 3:** 2025-2026 THOR MOTOR COACH FOUR WINDS

**Product Category:** Buses, Medium & Heavy Vehicles

**Part 573 Safety Recall Report****25V709****Product Type:****Fuel / Propulsion:****Production Dates:** Sep 04, 2024 - Aug 14, 2025**Number of potentially involved:** 65**Descriptive Information:**

P-clamps not installed on generator LP fuel hose.

**Vehicle 4:** 2025-2026 THOR MOTOR COACH PASADENA**Product Category:** Buses, Medium & Heavy Vehicles**Product Type:****Fuel / Propulsion:****Production Dates:** Jan 07, 2025 - Jul 18, 2025**Number of potentially involved:** 31**Descriptive Information:**

P-clamps not installed on generator LP fuel hose.

**Vehicle 5:** 2025-2026 THOR MOTOR COACH EDDIE BAUER**Product Category:** Buses, Medium & Heavy Vehicles**Product Type:****Fuel / Propulsion:****Production Dates:** Dec 05, 2024 - Aug 08, 2025**Number of potentially involved:** 39**Descriptive Information:**

P-clamps not installed on generator LP fuel hose.

**Vehicle 6:** 2025-2026 THOR MOTOR COACH CHATEAU**Product Category:** Buses, Medium & Heavy Vehicles**Product Type:****Fuel / Propulsion:****Production Dates:** Nov 04, 2024 - Aug 13, 2025**Number of potentially involved:** 131**Descriptive Information:**

**Part 573 Safety Recall Report****25V709**

P-clamps not installed on generator LP fuel hose.

**Vehicle 7:** 2025-2026 THOR MOTOR COACH FREEDOM ELITE

**Product Category:** Trailers

**Product Type:**

**Fuel / Propulsion:**

**Production Dates:** Nov 25, 2024 - Aug 04, 2025

**Number of potentially involved:** 96

**Descriptive Information:**

P-clamps not installed on generator LP fuel hose.

**Vehicle 8:** 2025-2026 THOR MOTOR COACH COLEMAN

**Product Category:** Buses, Medium & Heavy Vehicles

**Product Type:**

**Fuel / Propulsion:**

**Production Dates:** Dec 16, 2024 - Aug 13, 2025

**Number of potentially involved:** 77

**Descriptive Information:**

P-clamps not installed on generator LP fuel hose.

### Defect / Noncompliance Description

**Description of the defect or noncompliance:**

LP fuel hose for the generator was not properly secured with P-clamp allowing the LP hose to rest near the generator exhaust.

**FMVSS1:**

**FMVSS2:**

**Description of the safety risk, including crash, fire, death, injury:**

The LP hose could make contact with generator exhaust increasing the risk of a fire, crash, and injury

**Description of the cause:**

# Part 573 Safety Recall Report

**25V709**

Production did not secure the LP fuel hose with a P-clamp.

**Identification of any warning that can occur:**

Inspection of LP hose and distance from generator exhaust.

## Component Manufacturer

**Tier of Supplier:****Supplier Type:****Name:****Address:****Country:**

## Involved Components

**Component Name 1:****Component Description:****Component Part Number:**

## Chronology

8/14/25 -engineering found the generator exhaust to be close to an LP hose. It was discovered production did not install a P-clamp on the LP hose which allows the LP hose to flex towards the generator exhaust.

8/14/25 -production was made aware of the concern and made immediate corrections.

10/7/25 -engineering provided details to a safety committee member.

10/8/25 -an investigation found no warranty claims or customer complaints have been reported. A scope of potentially impacted units was created.

10/13/25 -safety committee met and voted to issue a voluntary recall.

**Related NHTSA Recall Number:**

## Description of Remedy

**Remedy Type:**

# Part 573 Safety Recall Report

# 25V709

**Consumer Advisories:**  Do Not Drive  Park Outside

**Description of remedy program:**

A heat sleeve and P-clamp will be installed to the LP hose. This will be done at no cost to the owner. Reimbursement will be following the general reimbursement plan that is on file with NHTSA.

**How remedy component differs from recalled component:**

P-clamp installed holding LP fuel line away from generator exhaust.

**Identify how/when recall condition was corrected in production:**

After the engineering inspection production was notified resulting in an immediate change.

## Reimbursement Plan

**Description of reimbursement program:**

A heat sleeve and P-clamp will be installed to the LP hose. This will be done at no cost to the owner. Reimbursement will be following the general reimbursement plan that is on file with NHTSA.

**Period of reimbursement:**

**Costs to be reimbursed:**

**Address for reimbursement claims:**

## Recall Schedule

**Description of recall schedule:**

Thor Motor Coach has the utmost urgency in notifying owners about a recall that affects their vehicle. Letters will be sent out once all pertinent information has been gathered.

**Planned Dealer Notification Date:** Dec 15, 2025 - Dec 15, 2025  No Dealers

**Planned Interim Owner Notification Date:** Dec 15, 2025 - Dec 15, 2025  No Owners

**Planned Remedy Owner Notification Date:** Dec 15, 2025 - Dec 15, 2025  Phased Recall

**Date when VIN will be searchable:**