



U.S. Department  
of Transportation

National Highway  
Traffic Safety  
Administration

# Part 573 Safety Recall Report

## 25V740

**Manufacturer Name:** KTM North America, Inc.

**Submission Date:** Oct 30, 2025

**NHTSA Recall No.:** 25V740

**Manufacturer Recall No.:**

### Manufacturer Information

### Population

**Manufacturer Name:** KTM North America, Inc.

**Address:** 1119 Milan Avenue  
Amherst OH, 44001

**Total number of potentially involved:** 5,488

**Estimated percentage with defect:** 1%

### Vehicle Information

**Vehicle 1:** 2024-2024 KTM 990 DUKE

**Product Category:** Motorcycles

**Product Type:** Motorcycles

**Fuel / Propulsion:**

**Production Dates:** Oct 30, 2023 - Apr 11, 2024

**Number of potentially involved:** 494

**Descriptive Information:**

The original fuel filler cap, part #A60707008066, were only used on the affected models for Model Year 2024. The supplier, MINDA, has identified the production period for the defective seal. The seal on the fuel filler cap shall be replaced with a new seal (part 96307008020). The new part number was not previously available as a separate part. The fuel filler cap is not affected.

**Vehicle 2:** 2024-2024 KTM 390 DUKE

**Product Category:** Motorcycles

**Product Type:** Motorcycles

**Fuel / Propulsion:**

**Production Dates:** Oct 30, 2023 - Apr 11, 2024

**Number of potentially involved:** 2,125

**Descriptive Information:**

The original fuel filler cap, part #A60707008066, were only used on the affected models for Model Year 2024. The supplier, MINDA, has identified the production period for the defective seal. The seal on the fuel filler cap shall be replaced with a new seal (part 96307008020). The new part number was not previously available as a separate part. The fuel filler cap is not affected.

**Part 573 Safety Recall Report****25V740****Vehicle 3:** 2024-2024 Husqvarna Vitpilen 401**Product Category:****Product Type:****Fuel / Propulsion:****Production Dates:** Jan 25, 2024 - Mar 22, 2024**Number of potentially involved:** 550**Descriptive Information:**

The original fuel filler cap, part #A60707008066, were only used on the affected models for Model Year 2024. The supplier, MINDA, has identified the production period for the defective seal. The seal on the fuel filler cap shall be replaced with a new seal (part 96307008020). The new part number was not previously available as a separate part. The fuel filler cap is not affected.

**Vehicle 4:** 2024-2024 Husqvarna Svartpilen 401**Product Category:****Product Type:****Fuel / Propulsion:****Production Dates:** Jan 25, 2024 - Mar 22, 2024**Number of potentially involved:** 1,206**Descriptive Information:**

The original fuel filler cap, part #A60707008066, were only used on the affected models for Model Year 2024. The supplier, MINDA, has identified the production period for the defective seal. The seal on the fuel filler cap shall be replaced with a new seal (part 96307008020). The new part number was not previously available as a separate part. The fuel filler cap is not affected.

**Vehicle 5:** 2024-2024 KTM 250 Duke**Product Category:** Motorcycles**Product Type:** Motorcycles**Fuel / Propulsion:****Production Dates:** Oct 30, 2023 - Apr 11, 2024**Number of potentially involved:** 1,113**Descriptive Information:**

The original fuel filler cap, part #A60707008066, were only used on the affected models for Model Year 2024. The supplier, MINDA, has identified the production period for the defective seal. The seal on the fuel filler cap shall be replaced with a new seal (part 96307008020). The new part number was not previously available as a separate part. The fuel filler cap is not affected.

# Part 573 Safety Recall Report

# 25V740

## Defect / Noncompliance Description

### Description of the defect or noncompliance:

The fuel filler cap seal on all affected vehicles must be replaced with the improved version.

### FMVSS1:

### FMVSS2:

### Description of the safety risk, including crash, fire, death, injury:

On affected models, during use, a fuel leak may lead to fire, injury, or property damage.

### Description of the cause:

Material deviations may cause small cracks to occur on the fuel filler cap seal of the above models. This can lead to the possibility of fuel leaking from the fuel cap.

### Identification of any warning that can occur:

None

## Component Manufacturer

### Tier of Supplier:

### Supplier Type:

**Name:** MINDA CORPORATION LIMITED

**Address:** E - 5 / 2, CHAKAN INDUSTRIAL AREA,  
NANEK  
PUNE Foreign States, 410501

**Country:** India

## Involved Components

**Component Name 1:** Fuel Cap Gasket

**Component Description:** Seal fuel tank cap

**Component Part Number:** A60707008066

## Chronology

# Part 573 Safety Recall Report

# 25V740

**03/19/2023** – The part supplier, MINDA, observed cracked sealing during lab testing. The condition was not observed on a production motorcycle. At that time, the supplier MINDA could not reproduce the issue.

**03/11/2024** - Subsequent test by MINDA showed a cracked sealing. KTM requested quality improvements from the supplier MINDA. No cracked sealing was reported on production vehicles,

**09/04/2024** - A cracked sealing was found on a KTM AG R&D test vehicle.

**09/11/2024** - A second KTM AG R&D vehicle was observed to have a cracked seal. KTM AG requested MINDA to conduct further testing.

**03/18/2025** - KTM determined a defect existed and a recall for the fuel cap seal was required.

No accidents or injuries have been reported.

**Related NHTSA Recall Number:**

## Description of Remedy

**Remedy Type:** Replace

**Consumer Advisories:**  Do Not Drive  Park Outside

**Description of remedy program:**

KTM and Husqvarna Mobility are notifying all registered owners of affected motorcycles by mail to bring their units to an authorized dealer for repair. The dealer technicians will inspect units and replace the fuel cap gasket with a new non-affected replacement part.

**How remedy component differs from recalled component:**

New design and specification of the gasket.

The new fuel cap seal part ( ) has been made with improved production processes.

**Identify how/when recall condition was corrected in production:**

New design and specification of the gasket.

## Reimbursement Plan

**Description of reimbursement program:**

Authorized KTM and Husqvarna dealer technicians will replace the fuel filler cap seal at no cost to customers. Dealer technicians will replace the fuel filler cap on vehicles in their inventory.

**Period of reimbursement:**

**Costs to be reimbursed:**

# Part 573 Safety Recall Report

**25V740**

Customers who previously replaced the fuel filler cap are eligible for reimbursement. Customers should contact KTM or Husqvarna Mobility Customer Relations for more information.

**Address for reimbursement claims:**

1119 Milan Avenue  
Amherst OH, 44001

## Recall Schedule

**Description of recall schedule:**

Dealers will be notified via Dealernet, an online communication portal for dealers. Consumer notification letters will be issued to consumers.

**Planned Dealer Notification Date:** Nov 05, 2025 - Nov 05, 2025  No Dealers

**Planned Interim Owner Notification Date:**  No Owners

**Planned Remedy Owner Notification Date:** Dec 15, 2025 - Dec 15, 2025  Phased Recall

**Date when VIN will be searchable:**