



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

25V740

Manufacturer Name: KTM North America, Inc.

Submission Date: Oct 30, 2025

NHTSA Recall No.: 25V740

Manufacturer Recall No.:

Manufacturer Information

Population

Manufacturer Name: KTM North America, Inc.

Address: 1119 Milan Avenue
Amherst OH, 44001

Total number of potentially involved: 5,488

Estimated percentage with defect: 1%

Vehicle Information

Vehicle 1: 2024-2024 Husqvarna Svartpilen 401

Product Category:

Product Type:

Fuel / Propulsion:

Production Dates: Jan 25, 2024 - Mar 22, 2024

Number of potentially involved:

Descriptive Information:

The original fuel filler cap, part #A60707008066, were only used on the affected models for Model Year 2024. The supplier, MINDA, has identified the production period for the defective seal. The seal on the fuel filler cap shall be replaced with a new seal (part 96307008020). The new part number was not previously available as a separate part. The fuel filler cap is not affected.

Vehicle 2: 2024-2024 Husqvarna Vitpilen 401

Product Category:

Product Type:

Fuel / Propulsion:

Production Dates: Jan 25, 2024 - Mar 22, 2024

Number of potentially involved:

Descriptive Information:

The original fuel filler cap, part #A60707008066, were only used on the affected models for Model Year 2024. The supplier, MINDA, has identified the production period for the defective seal. The seal on the fuel filler cap shall be replaced with a new seal (part 96307008020). The new part number was not previously available as a separate part. The fuel filler cap is not affected.

Part 573 Safety Recall Report

25V740

Defect / Noncompliance Description

Description of the defect or noncompliance:

The fuel filler cap seal on all affected vehicles must be replaced with the improved version.

FMVSS1:**FMVSS2:****Description of the safety risk, including crash, fire, death, injury:**

On affected models, during use, a fuel leak may lead to fire, injury, or property damage damage.

Description of the cause:

Material deviations may cause small cracks to occur on the fuel filler cap seal of the above models. This can lead to the possibility of fuel leaking from the fuel cap.

Identification of any warning that can occur:

None

Component Manufacturer

Tier of Supplier:**Supplier Type:****Name:** MINDA CORPORATION LIMITED**Address:** E - 5 / 2, CHAKAN INDUSTRIAL AREA,
NANEK
PUNE Foreign States, 410501**Country:** India

Involved Components

Component Name 1: Fuel Cap Gasket**Component Description:** Seal fuel tank cap**Component Part Number:** A60707008066

Chronology

Part 573 Safety Recall Report

25V740

03/19/2023 – The part supplier, MINDA, observed cracked sealing during lab testing. The condition was not observed on a production motorcycle. At that time, the supplier MINDA could not reproduce the issue.

03/11/2024 - Subsequent test by MINDA showed a cracked sealing. KTM requested quality improvements from the supplier MINDA. No cracked sealing was reported on production vehicles,

09/04/2024 - A cracked sealing was found on a KTM AG R&D test vehicle.

09/11/2024 - A second KTM AG R&D vehicle was observed to have a cracked seal. KTM AG requested MINDA to conduct further testing.

03/18/2025 - KTM determined a defect existed and a recall for the fuel cap seal was required.

No accidents or injuries have been reported.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type: Replace

Consumer Advisories: ☐ Do Not Drive ☐ Park Outside

Description of remedy program:

KTM and Husqvarna Mobility are notifying all registered owners of affected motorcycles by mail to bring their units to an authorized dealer for repair. The dealer technicians will inspect units and replace the fuel cap gasket with a new non-affected replacement part.

How remedy component differs from recalled component:

New design and specification of the gasket.

The new fuel cap seal part () has been made with improved production processes.

Identify how/when recall condition was corrected in production:

New design and specification of the gasket.

Reimbursement Plan

Description of reimbursement program:

Authorized KTM and Husqvarna dealer technicians will replace the fuel filler cap seal at no cost to customers. Dealer technicians will replace the fuel filler cap on vehicles in their inventory.

Period of reimbursement:

Costs to be reimbursed:

Part 573 Safety Recall Report

25V740

Customers who previously replaced the fuel filler cap are eligible for reimbursement. Customers should contact KTM or Husqvarna Mobility Customer Relations for more information.

Address for reimbursement claims:

1119 Milan Avenue
Amherst OH, 44001

Recall Schedule

Description of recall schedule:

Dealers will be notified via Dealernet, an online communication portal for dealers. Consumer notification letters will be issued to consumers.

Planned Dealer Notification Date: Nov 06, 2025 - Nov 06, 2025

☐ No Dealers

Planned Interim Owner Notification Date:

☐ No Owners

Planned Remedy Owner Notification Date: Dec 15, 2025 - Dec 15, 2025

☐ Phased Recall

Date when VIN will be searchable: