



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

25V757

Manufacturer Name: Volvo Trucks North America

Submission Date: Nov 03, 2025

NHTSA Recall No.: 25V757

Manufacturer Recall No.: RVXX2509

Manufacturer Information

Population

Manufacturer Name: Volvo Trucks North America

Address: 7900 National Service Road
Greensboro NC, 27409

Total number of potentially involved: 3,124

Estimated percentage with defect: 1.6%

Vehicle Information

Vehicle 1: 2025-2026 VOLVO NEW VN

Product Category: Buses, Medium & Heavy Vehicles

Product Type: Tractor

Fuel / Propulsion: Compression Ignition Fuel

Production Dates: Oct 01, 2024 - Jun 30, 2025

Number of potentially involved: 3,124

Descriptive Information:

The vehicle population was identified based on the dates of when incoming supplier shipments arrived at our factories. Trucks with over 10,000 miles were excluded from the population because warranty reports indicate that failures occur shortly before or after vehicles are put in service.

Defect / Noncompliance Description

Description of the defect or noncompliance:

Certain Volvo New VNs may be equipped with roof marker lights with nonconforming sockets. This can result in the center marker lamp connection failing resulting in insufficient luminosity.

FMVSS1: 108 - Lamps, reflective devices, and assoc. Equipment

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

Marker lamps not illuminating may reduce visibility and increase the risk of a crash.

Description of the cause:

Part 573 Safety Recall Report

25V757

During the production of the marker lights the molding of the terminal sockets was compromised.

Identification of any warning that can occur:

Component Manufacturer

Tier of Supplier: Tier 1

Supplier Type: Other

Name: Grote

Address: 2600 Lanier Drive
Madison IN, 47250

Country: United States

Involved Components

Component Name 1: Lamp

Component Description: Marker Center ID Bar Assembly

Component Part Number: 23516797

Chronology

August 12, 2025, Safety Office opens a product safety related issue investigation.

August 25, 2025, Product Safety Evaluation Committee review #1 requests additional information.

October 20, 2025, Product Safety Evaluation Committee review #2 recommends escalation to Product Safety Committee.

October 27, 2025, Product Safety Committee determines that a non-compliance exists and decides to initiate a recall.

There have been 237 claims received in the calendar year 2025 related to this issue received as follows:

January-1, February-1, March-7, April-15, May-49, June-52, July-57, August-27, September-17, October-11

There have been no field reports, accidents or injuries related to this issue.

Related NHTSA Recall Number:

Part 573 Safety Recall Report

25V757

Description of Remedy

Remedy Type: Replace

Consumer Advisories: Do Not Drive Park Outside

Description of remedy program:

Vehicles will be recalled and the center roof marker lamp will be replaced with a marker lamp with corrected terminal sockets.

How remedy component differs from recalled component:

The new components have a corrected terminal socket that allows for proper electrical connectivity.

Identify how/when recall condition was corrected in production:

October 2025 a stop shipment was put in place at the factory and suspect vehicles were inspected prior to releasing.

Reimbursement Plan

Manufacturer used general reimbursement plan on file.

Recall Schedule

Description of recall schedule:

Vehicles will be recalled and the center roof marker lamp will be replaced with a marker lamp equipped with a corrected connector.

Planned Dealer Notification Date: Nov 10, 2025 - Nov 10, 2025 No Dealers

Planned Interim Owner Notification Date: No Owners

Planned Remedy Owner Notification Date: Jan 02, 2026 - Jan 02, 2026 Phased Recall

Date when VIN will be searchable: Nov 10, 2025