



U.S. Department  
of Transportation

National Highway  
Traffic Safety  
Administration

## Part 573 Safety Recall Report

## 25V763

**Manufacturer Name:** International Motors, LLC

**Submission Date:** Nov 10, 2025

**NHTSA Recall No.:** 25V763

**Manufacturer Recall No.:** 25521

### Manufacturer Information

### Population

**Manufacturer Name:** International Motors, LLC

**Address:** 2701 Navistar Drive  
Lisle IL, 60532

**Total number of potentially involved:** 159

**Estimated percentage with defect:** 100%

### Vehicle Information

**Vehicle 1:** 2019-2020 INTERNATIONAL CV

**Product Category:** Buses, Medium & Heavy Vehicles

**Product Type:** Truck

**Fuel / Propulsion:** Compression Ignition Fuel

**Production Dates:** Aug 06, 2018 - Nov 12, 2020

**Number of potentially involved:** 159

#### Descriptive Information:

The suspect population was identified by model year 2019 and 2020 vehicles involved in Safety Recall 23511 (23V282) and 25507 (25V414) that were remedied between 09/22/2025 and 10/14/2025 with a harness without protective material.

The suspect population was identified by model year 2019 and 2020 vehicles involved in Safety Recall 23511 (23V282) and 25507 (25V414) that were remedied between 09/22/2025 and 10/14/2025 with a harness without protective material. All other similar vehicles, which are not subject to this recall, are excluded.

### Defect / Noncompliance Description

#### Description of the defect or noncompliance:

The replacement brake harness for Safety Recalls 23511 (23V282) and 25507 (25V414) used on older vehicle models did not have protective material installed on the wires.

**FMVSS1:**

**FMVSS2:**

**Description of the safety risk, including crash, fire, death, injury:**

**Part 573 Safety Recall Report****25V763**

A lack of protective material can lead to a short circuit in the brake backup motor circuit due to rubbing or chafing of the harness against various components. Under certain conditions, this may lead to reduced braking capacity which may increase the risk of a vehicle crash with potential injury and/or property damage.

**Description of the cause:**

**Identification of any warning that can occur:**

**Component Manufacturer**

**Tier of Supplier:**

**Supplier Type:**

**Name:**

**Address:**

**Country:**

**Involved Components**

**Component Name 1:** Harness, Brake Jumper; Built 11/30/2020 and Prior

**Component Description:** Silicone Block Harness for MY2019-2020 CV

**Component Part Number:** 8900388R91

**Chronology**

09/22/2025 International is notified that a remedy brake harness used in safety recalls 23511 (23V282) and 25507(25V414) for the 2019 and 2020 model year CV vehicles did not have protective material on the wiring.

09/30/2025 International finds that the drawing for the suspect harness did not call for the use of a protective covering.

10/7/2025 International receives a physical part and confirms that all 8900388R91 harnesses in its possession for the final remedy of 23511 (23V282) and 25507(25V414) did not contain a protective covering.

10/13/2025 International releases updated service procedures for 23511 (23V282) and 25507(25V414) requiring dealers to add the protective covering on the harness prior to installation.

**Part 573 Safety Recall Report****25V763**

10/14/2025-10/29/2025 International monitors and reviews incoming safety recall 23511 (23V282) and 25507(25V414) remedy claims that indicate a harness was installed without protective covering to finalize suspect population.

10/29/2025 International concludes that most claims were now processed and finalizes the suspect population.

10/30/2025 International declares a safety recall.

**Related NHTSA Recall Number:**

**Description of Remedy****Remedy Type:**

**Consumer Advisories:**  Do Not Drive  Park Outside

**Description of remedy program:**

The remedy will involve removing the harness, adding protective material as needed and reinstalling the harness.

**How remedy component differs from recalled component:**

The remedied harness will have protective material added to it, where the existing harness does not.

**Identify how/when recall condition was corrected in production:**

See chronology.

**Reimbursement Plan**

Manufacturer used general reimbursement plan on file.

**Recall Schedule****Description of recall schedule:**

When parts are available, remedy instructions and owner notifications will be distributed. Tentative schedule as indicated.

**Planned Dealer Notification Date:** Dec 19, 2025 - Dec 19, 2025  No Dealers

**Planned Interim Owner Notification Date:**  No Owners

# Part 573 Safety Recall Report

**25V763**

**Planned Remedy Owner Notification Date:** Jan 05, 2026 - Jan 05, 2026  Phased Recall

**Date when VIN will be searchable:** Dec 19, 2025