



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

25V892

Manufacturer Name: Honda (American Honda Motor Co.)

Submission Date: Jan 23, 2026

NHTSA Recall No.: 25V892

Manufacturer Recall No.: KT6

Manufacturer Information

Population

Manufacturer Name: Honda (American Honda Motor Co.)

Address: 1919 Torrance Blvd.
Torrance CA, 90501

Total number of potentially involved: 452

Estimated percentage with defect: 1.5%

Vehicle Information

Vehicle 1: 2025-2025 HONDA CB1000SP

Product Category: Motorcycles

Product Type: Motorcycles

Fuel / Propulsion: Compressed Natural Gas

Production Dates: Sep 30, 2024 - Aug 22, 2025

Number of potentially involved: 452

Descriptive Information:

The recall population was determined based on manufacturing records. The production range reflects all possible vehicles that could experience the problem.

Defect / Noncompliance Description

Description of the defect or noncompliance:

Due to improper piston and piston ring specifications, excessive engine oil consumption may occur. As the oil level drops below the minimum required level, oil pressure can decrease, potentially leading to connecting rod bearing seizure.

FMVSS1:

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

If the connecting rod bearing seizes, it may cause rear-wheel lockup, engine components to breach the

Part 573 Safety Recall Report**25V892**

engine case, and/or engine oil to contact the exhaust system or rear tire, increasing the risk of a crash, injury, or fire.

Description of the cause:**Identification of any warning that can occur:**

Low engine oil level and/or increased oil consumption observed during routine recommended inspections.

Component Manufacturer

Tier of Supplier: Tier 1

Supplier Type: OEM

Name: TPR Co., Ltd.

Address: Shin-Marunouchi Center Building 10F
1-6-2 Marunouchi,
Chiyoda-ku, Tokyo Foreign States, 100-0005

Country: Japan

Tier of Supplier: Tier 1

Supplier Type: OEM

Name: Honda Foundry Co., Ltd.

Address: 1620 Matoba
Kawagoe City, Saitama Pref. Foreign States, 350-1101

Country: Japan

Involved Components

Component Name 1: PISTON

Component Description: PISTON

Component Part Number: 13101-MLL-D00

Component Name 2: Ring, Piston Top 76x0.8x2.3

Component Description: Ring, Piston Top 76x0.8x2.3

Component Part Number: 13121-MLL-D01

Part 573 Safety Recall Report

25V892

Chronology

July 1, 2025

Honda received the initial report of high oil consumption in the European market and began to investigate the issue.

October 10, 2025

Honda received a repurchased vehicle experiencing the issue and continued to investigate and analyze the issue.

October 20, 2025

Honda received additional reports of the issue and continued to investigate and analyze the issue.

November 14, 2025 – December 10, 2025

Honda continued to analyze the issue.

December 11, 2025

Honda determined that a defect related to motor vehicle safety existed and decided to conduct a safety recall.

As of December 11, 2025, Honda has had 7 warranty claims and no reports of an injury or death related to this issue from January 25, 2025, through December 11, 2025.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type: Repair

Consumer Advisories: Do Not Drive Park Outside

Description of remedy program:

How remedy component differs from recalled component:

Part 573 Safety Recall Report**25V892**

Identify how/when recall condition was corrected in production:

Reimbursement Plan

Manufacturer used general reimbursement plan on file.

Recall Schedule**Description of recall schedule:**

Dealer notification began and ended on or about 12/12/2025. Interim owner notification is scheduled to begin and end on or about 2/16/2026.

Planned Dealer Notification Date: Dec 12, 2025 - Dec 12, 2025 No Dealers

Planned Interim Owner Notification Date: Feb 16, 2026 - Feb 16, 2026 No Owners

Planned Remedy Owner Notification Date: Phased Recall

Date when VIN will be searchable: