



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

25V904

Manufacturer Name: Terminal Investment Corporation

Submission Date: Dec 22, 2025

NHTSA Recall No.: 25V904

Manufacturer Recall No.:

Manufacturer Information

Population

Manufacturer Name: Terminal Investment Corporation
Address: 66 Cypress Ridge Dr.
Ridgeland SC, 29936

Total number of potentially involved: 110
Estimated percentage with defect: 100%

Vehicle Information

Vehicle 1: 2018-2026 PRO SPOTTER TANDEM

Product Category: Buses, Medium & Heavy Vehicles

Product Type: Tractor

Fuel / Propulsion: Spark Ignition Fuel

Production Dates: Feb 12, 2018 - Sep 24, 2025

Number of potentially involved: 110

Descriptive Information:

A potential defect was identified via FEA completion on all TICO PRO Spotter Tandem Vehicles. The recalled product by design is limited only to the TANDEM vehicle models. The recall includes all TANDEM vehicles produced by TICO

Defect / Noncompliance Description

Description of the defect or noncompliance:

The defect is seen in the forward axle track rod frame side mounting bracket. A fracture can develop at the edge of the bracket near the weld. If the fracture propagates through the part, the track rod can detach from the frame.

FMVSS1:

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

The safety risk to the operator is a crash that can occur if the track rod detaches from the frame. Due to

Part 573 Safety Recall Report**25V904**

the limited speed the vehicle is capable of, It is not likely to cause injury or death.

Description of the cause:

The cause of this fracture is the weld terminating too close to the edge of the bracket, causing a high stress riser.

Identification of any warning that can occur:

When the fracture begins, the operator may notice the frame side mounting of the track rod move vertically. If the bracket fails, the operator will notice the truck not tracking properly and the rear of the vehicle frame begin to shift side to side,

Component Manufacturer**Tier of Supplier:****Supplier Type:****Name:****Address:****Country:****Involved Components****Component Name 1:****Component Description:****Component Part Number:****Chronology**

An FEA was completed and reviewed with the TICO team on 12/17/2025 showing a local high stress riser

Related NHTSA Recall Number:**Description of Remedy****Remedy Type:**

Part 573 Safety Recall Report

25V904

Consumer Advisories: Do Not Drive Park Outside

Description of remedy program:

How remedy component differs from recalled component:

Identify how/when recall condition was corrected in production:

Reimbursement Plan

Description of reimbursement program:

Period of reimbursement:

Costs to be reimbursed:

Address for reimbursement claims:

Recall Schedule

Description of recall schedule:

Planned Dealer Notification Date: No Dealers

Planned Interim Owner Notification Date: No Owners

Planned Remedy Owner Notification Date: Phased Recall

Date when VIN will be searchable: