



U.S. Department
of Transportation

National Highway
Traffic Safety
Administration

Part 573 Safety Recall Report

25V912

Manufacturer Name: Nissan North America, Inc.

Submission Date: Dec 23, 2025

NHTSA Recall No.: 25V912

Manufacturer Recall No.: PD180

Manufacturer Information

Population

Manufacturer Name: Nissan North America, Inc.

Address: P. O. BOX 685001
Franklin TN, 37068-5009

Total number of potentially involved: 4,655

Estimated percentage with defect: 65.3%

Vehicle Information

Vehicle 1: 2026-2026 NISSAN ROGUE

Product Category: Light Vehicles

Product Type: Multipurpose Passenger Vehicle

Fuel / Propulsion: Compression Ignition Fuel

Production Dates: Oct 12, 2025 - Oct 27, 2025

Number of potentially involved: 4,655

Descriptive Information:

Certain Model Year 2026 Nissan Rogue vehicles manufactured from October 12, 2025 through October 27, 2025 at the Smyrna, TN plant. Based on production records, the issue is specific to Nissan Rogue vehicles equipped with an incorrectly sized spare tire assembly and produced during the specified vehicle production period. No other Nissan or INFINITI vehicles are affected.

Defect / Noncompliance Description

Description of the defect or noncompliance:

Due to a production issue that has since been corrected, certain affected Model Year 2026 Nissan Rogue vehicles may have been equipped with a spare tire that does not match the tire size specified on the vehicle's tire placard. As a result, the subject vehicles may fail to comply with the requirements of S4.3 of Federal Motor Vehicle Safety Standard (FMVSS) No. 110, which specifies that the spare tire must conform to the size and inflation pressure information provided on the placard.

FMVSS1: 111 - Rear visibility

FMVSS2:

Description of the safety risk, including crash, fire, death, injury:

Part 573 Safety Recall Report

25V912

If the tire placard specifies an inflation pressure that does not match the specifications of the installed spare tire, the driver may inflate the spare to an incorrect pressure, increasing the risk of a crash.

Description of the cause:

Identification of any warning that can occur:

There is no preceding warning.

Component Manufacturer

Tier of Supplier:

Supplier Type:

Name:

Address:

Country:

Involved Components

Component Name 1: Spare Tire, FWD

Component Description: Spare Tire Assembly – Front Wheel Drive

Component Part Number: 40312 6RR8E

Component Name 2: Spare Tire, AWD

Component Description: Spare Tire Assembly – All Wheel Drive

Component Part Number: 40312 6RR7E

Chronology

On October 27, 2025, a maintenance technician observed a spare tire assembly that was out of sequence in production. Nissan commenced immediate containment measures, initiated a yard audit and launched an internal investigation.

November 2025 through Early December 2025 – Nissan conducted a yard audit of 1,996 Model Year 2026 Rogue vehicles at the Smyrna, Tennessee plant. The audit identified 1,304 vehicles that were manufactured with an incorrect spare tire assembly. Nissan's investigation determined that a spare tire assembly shifted within the overhead conveyor system that caused an out-of-sequence delivery of spare

Part 573 Safety Recall Report

25V912

tires and subsequent incorrect installations on affected vehicles. Nissan implemented a countermeasure to prevent future occurrences.

Nissan evaluated the potential impact of an incorrect spare tire assembly on vehicle performance and compliance. During this time, Nissan confirmed that the tire placard label reflects the correct spare tire size; however, installation of an incorrect spare tire assembly may result in noncompliance with FMVSS No. 110.

December 16, 2025 - Out of an abundance of caution, Nissan decided to conduct a voluntary recall campaign to remedy the potentially affected vehicles in the U.S. market.

Nissan is not aware of any warranty claims, accident or injuries related to the subject condition.

Related NHTSA Recall Number:

Description of Remedy

Remedy Type: Inspect, Repair

Consumer Advisories: Do Not Drive Park Outside

Description of remedy program:

Nissan dealers will be instructed to inspect and if necessary, replace the spare tire assembly with the correct size. All inspections and repairs will be performed free of charge for parts and labor and may take less than one half (0.5) hour to complete.

How remedy component differs from recalled component:

Identify how/when recall condition was corrected in production:

Reimbursement Plan

Description of reimbursement program:

Nissan will not include a statement in the Part 577 owner notification concerning reimbursement for the cost of obtaining a pre-notification remedy as the subject vehicles are still under warranty.

Period of reimbursement:

Costs to be reimbursed:

Part 573 Safety Recall Report**25V912**

Address for reimbursement claims:

Recall Schedule**Description of recall schedule:**

Dealers will be notified on January 6, 2026. Owners of all potentially affected vehicles will be notified beginning February 13, 2026.

Planned Dealer Notification Date: Jan 06, 2026 No Dealers**Planned Interim Owner Notification Date:** No Owners**Planned Remedy Owner Notification Date:** Feb 13, 2026 Phased Recall**Date when VIN will be searchable:** Jan 06, 2026