



Service Engineering Operations  
Customer Service Division

Ford Motor Company  
PO Box 1904  
Dearborn, Michigan 48121

April 4, 2025

**TO:** All U.S. Ford and Lincoln Dealers

**SUBJECT: NEW VEHICLE DEMONSTRATION / DELIVERY HOLD -  
Safety Recall 25S19**

Certain 2025 Model Year Aviator, 2024-2025 Model Year Bronco, 2025 Explorer, and 2024-2025 Model Year F-150, 2025 Model Year Mustang, and 2024 Model Year Ranger Vehicles

Transmission Main Control Valve Body Replacement

**REF: NEW VEHICLE DEMONSTRATION / DELIVERY HOLD -  
Advance Notice - Safety Recall 25S19**

Certain 2024-2025 Model Year Aviator, Bronco, Explorer, F-150, Mustang, and Ranger Vehicles

Transmission Main Control Valve Body Replacement

March 14, 2025

**AFFECTED VEHICLES**

Vehicle	Model Year	Assembly Plant	Build Date Range
Aviator	2025	Chicago	December 4, 2024 through December 20, 2024
Bronco	2024	Michigan	November 27, 2024 through December 21, 2024
Bronco	2025	Michigan	February 4, 2025 through February 4, 2025
Explorer	2025	Chicago	November 25, 2024 through January 30, 2025
F-150	2024	Kansas City	November 22, 2024 through December 8, 2024
F-150	2025	Dearborn	December 2, 2024 through January 31, 2025
F-150	2025	Kansas City	December 11, 2024 through January 31, 2025
Mustang	2025	Flat Rock	December 19, 2024 through February 3, 2025
Ranger	2024	Michigan	November 15, 2024 through December 15, 2024

U.S. population of affected vehicles: 269. Affected vehicles are identified in OASIS and FSA VIN Lists.

**REASON FOR THIS SAFETY RECALL**

On all of the affected vehicles, some inner dimensions of the transmission main valve body do not meet the engineering print specifications, and the driver may experience no reverse motion when the gear selector is placed in reverse. The vehicle may move forward while the gear selector is placed in the reverse or neutral position. The Malfunction Indicator Light (MIL) and Wrench light will illuminate when this malfunction occurs. Unexpected vehicle motion can increase the risk of a crash

## **SERVICE ACTION**

Before demonstrating or delivering any new in-stock vehicles involved in this recall, dealers are to replace the main control valve body in the transmission. This service must be performed on all affected vehicles at no charge to the vehicle owner. For new vehicle storage guidelines, refer to EFC13033, Storage Guidelines for New Vehicles.

- Arrange to pick up the owner's vehicle and drive it to the dealership for repairs (rentals are authorized – see Rental Vehicles)
  - Re-deliver the owner's vehicle after repairs have been completed.
- Pick-Up & Delivery, and mobile service should be made available for all customers. Refer to the Rental and Claiming sections for further details.

## **ESSENTIAL SPECIAL SERVICE TOOLS**

If you do not have the special tools needed, please contact 1-800 ROTUNDA and choose option 3 to place an order to purchase.

## **OWNER NOTIFICATION MAILING SCHEDULE**

Owner letters are expected to be mailed the week of April 14, 2025 or sooner. Dealers should repair any affected vehicles that arrive at their dealerships, whether or not the customer has received a letter.

## **PLEASE NOTE:**

**Federal law requires dealers to complete this recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty of up to \$27,168 per vehicle. Correct all vehicles in your new vehicle inventory before delivery.**

## **ATTACHMENTS**

- Administrative Information
- Labor Allowances and Parts Ordering Information
- Technical Instructions
- Mobile Service Repair Assessment
- Vehicle Pick-Up & Delivery Record
- Owner Notification Letters
- Recall Reimbursement Plan

## **QUESTIONS & ASSISTANCE**

For questions and assistance, contact the Special Service Support Center (SSSC) via the SSSC Web Contact Site. The SSSC Web Contact Site can be accessed through the Professional Technician System (PTS) website using the SSSC link listed at the bottom of the OASIS VIN report screen or listed under the SSSC tab.

Customer Service Division

## Safety Recall 25S19

### **MOBILE SERVICE REPAIR ASSESSMENT LEVEL**

- All repairs in this program have the following assessment level:  
     - Not a Mobile Service Repair

### **OASIS ACTIVATION**

OASIS was activated on March 14, 2025.

### **FSA VIN LISTS ACTIVATION**

FSA VIN Lists were made available through <https://web.fsavinlists.dealerconnection.com> on March 14, 2025. Owner names and addresses will be available by May 2, 2025.

**NOTE:** Your FSA VIN Lists may contain owner names and addresses obtained from motor vehicle registration records. The use of such motor vehicle registration data for any purpose other than in connection with this recall is a violation of law in several states, provinces, and countries. Accordingly, you must limit the use of this listing to the follow-up necessary to complete this recall.

### **SOLD VEHICLES**

- Ford has not issued instructions to stop selling/delivering or driving used vehicles under this safety recall. Owners should contact their dealers for an appointment to have their vehicles remedied as soon as practicable.
- Immediately contact any of your affected customers whose vehicles are not on your VIN list but are identified in OASIS. Give the customer a copy of the Owner Notification Letter (when available) and schedule a service date.
- Correct other affected vehicles identified in OASIS which are brought to your dealership.
- Dealers are to prioritize repairs of customer vehicles over repairs of new and used vehicle inventory.

### **STOCK VEHICLES**

- Correct all affected units in your new vehicle inventory before delivery.
- Use OASIS to identify any affected vehicles in your used vehicle inventory.

### **DEALER-OPERATED RENTAL VEHICLES**

The Fixing America's Surface Transportation (FAST) Act law effective June 2016 prohibits a rental company from selling, renting, or leasing vehicles subject to a safety or compliance recall. Please consult your legal counsel for legal advice.

### **BRANDED / SALVAGED TITLE VEHICLES**

Affected branded / salvaged title vehicles are eligible for this recall.

**Safety Recall 25S19****OWNER REFUNDS**

- **This Safety Recall must still be performed, even if the owner has paid for a previous repair. Claiming a refund will not close the recall on the vehicle.**
- Ford Motor Company is offering a refund for owner-paid repairs covered by this recall if the repair was performed before the date indicated in the reimbursement plan, which is posted with this bulletin. Owners are directed to seek reimbursement through authorized dealers or, at their option, directly through Ford Motor Company at PO Box 6251, Dearborn, MI 48121-6251.
- Dealers are also pre-approved to refund owner-paid emergency repairs that were performed away from an authorized servicing dealer after the end date specified in the reimbursement plan. Non-covered repairs, or those judged by Ford to be excessive, will not be reimbursed.
- Refunds will only be provided for the cost associated with the Transmission Main Control Valve Body Replacement.

**RENTAL VEHICLES**

**F-150 Vehicles ONLY:** Dealers are pre-approved for up to one day for a comparable rental vehicle. Follow Customer Loyalty Program (CLP) guidelines for dollar amounts. Rentals will only be reimbursed for the day(s) the vehicle is at the dealership for part replacement. Prior approval for more than one rental day is required from the Centralized Loaner Support Team. Contact the Centralized Loaner Support Team via the CRC Dealer Portal for consideration and approval if appropriate.

The CRC Dealer Portal Job Aid can be referenced at:

[fmcdealer.dealerconnection.com/content/dam/fmcdealer/documents/parts\\_service/cust\\_sat/GCCT/Pages/FSALoanerProgram.pdf](https://fmcdealer.dealerconnection.com/content/dam/fmcdealer/documents/parts_service/cust_sat/GCCT/Pages/FSALoanerProgram.pdf)

**FORD PICK-UP & DELIVERY**

- Dealers participating in the Remote Experience Program:
  - Refer to EFC16393, Announcing the 2025 Remote Experience Program for additional details.
- Dealers NOT participating in the 2025 Remote Experience Program:
  - Dealers may claim one-half labor hour per repair for vehicle Pick-Up & Delivery services.
  - Dealers must retain a Vehicle Pick-Up & Delivery Record with the repair order documentation.

**LINCOLN PICK-UP & DELIVERY**

- Owners of Lincoln vehicles within a 4 year / 50,000-mile warranty have the option of requesting Pick-Up & Delivery service, from their dealership. For details, reference EFC15921, 2025 Lincoln Pick-Up & Delivery Program Announcement.
- For Lincoln vehicles outside of 4 years / 50,000-mile warranty, refer to refer to EFC16393, Announcing the 2025 Remote Experience Program.
- Dealers NOT participating in the 2025 Remote Experience Program:
  - For Lincoln vehicles outside of 4 years / 50,000-mile warranty, see labor claiming table below.

**Safety Recall 25S19****ADDITIONAL REPAIR (LABOR TIME AND/OR PARTS)**

Additional repairs identified as necessary to complete the FSA should be managed as follows:

- For related damage and access time requirements, refer to the Warranty and Policy Manual / Section 6 – Ford & Lincoln Program Policies / General Information & Special Circumstances for FSAs / Related Damage.
- For vehicles within new vehicle bumper-to-bumper warranty coverage, no SSSC approval is required, although related damage must be on a separate repair line with the “Related Damage” radio button checked.
  - Ford vehicles – 3 years or 36,000 miles
  - Lincoln vehicles – 4 years or 50,000 miles
- For vehicles outside new vehicle bumper-to-bumper warranty coverage, submit an Approval Request to the SSSC Web Contact Site before completing the repair.

**CLAIMS PREPARATION AND SUBMISSION**

- **Technician Competency Requirement:** The STST Competency 10 certification requirement in the U.S. market only will be enforced starting with repair orders opened on or after August 31, 2024. FSA repairs will reject and the claim will not be paid if the repairing technician is not certified in STST Competency 10 FSA. See EFC15936 for more details.
- **Claim Entry:** Enter claims using Dealer Management System (DMS) or One Warranty Solution (OWS) online.
  - When entering claims, select claim type 31: Field Service Action. The FSA number (25S19) is the subcode.
- For additional claims preparation and submission information, refer to the Recall and
- **Related Damage/Additional labor and/or parts:** Must be claimed as Related Damage on a separate repair line from the FSA with the same claim type and subcode as described in Claim Entry above.  
**IMPORTANT:** Click the Related Damage Indicator radio button.
- **Rentals:** For rental vehicle claiming, follow Customer Loyalty Program (CLP) guidelines for dollar amounts. Enter the total amount of the rental expense under the Miscellaneous Expense code RENTAL.
  - Customer Satisfaction Program (CSP) Repairs in the OWS User Guide.

**Safety Recall 25S19**

- **Refunds:** Submit refunds on a separate repair line.
  - Program Code: 25S19
  - Misc. Expense: ADMIN
  - Misc. Expense: REFUND
  - Misc. Expense: 0.2 Hrs.
  - Multiple refunds should be submitted on one repair line and the invoice details for each repair should be detailed in the comments section of the claim.
- **Lincoln Pick-Up & Delivery:** Claims for Lincoln Pick-Up & Delivery should be submitted on a separate line from the FSA. Refer to EFC15921, 2025 Lincoln Pick-Up & Delivery Program Announcement for details.
  - For Lincoln vehicles outside of 4 years / 50,000-mile warranty, refer to refer to EFC16393, Announcing the 2025 Remote Experience Program
  - Dealers NOT participating in the 2025 Remote Experience Program
    - For Lincoln vehicles outside of 4 years / 50,000-mile warranty, see labor claiming table below.
- **Ford Pick-Up & Delivery:**
  - Dealers participating in the Remote Experience Program –
    - Refer to EFC16393, Announcing the 2025 Remote Experience Program for additional details.
  - Dealers NOT participating in the 2025 Remote Experience Program –
    - Dealers may claim one-half labor hour per repair for vehicle Pick-Up & Delivery services.
    - Dealers must retain a Vehicle Pick-Up & Delivery Record with the repair order documentation.

Safety Recall 25S19

**LABOR ALLOWANCES**

Description	Labor Operation	Labor Time
Aviator Replace Main Control Valve Body	MT25S19B	Up to 2.6 Hours
Bronco Replace Main Control Valve Body	MT25S19C	Up to 2.3 Hours
Explorer Replace Main Control Valve Body	Mt25S19D	Up to 2.6 Hours
F-150 Replace Main Control Valve Body	MT25S19E	Up to 4.6 Hours
Mustang Replace Main Control Valve Body	MT25S19F	Up to 3.1 Hours
Ranger Replace Main Control Valve Body	MT25S19G	Up to 2.5 Hours
<b>Lincoln</b> Vehicle Pick-Up & Delivery Allowance: <b>Only</b> vehicles <b>outside</b> of Lincoln Pick-Up & Delivery contract coverage of <b>4 years/50,000 miles for dealers NOT participating in the 2025 Remote Experience Program.</b> <b>NOTE:</b> This allowance is for dealer-performed vehicle Pick-Up & Delivery for dealership repairs only. Can only be claimed once, regardless of outstanding FSAs repaired.	25S19LL	0.5 Hours
<b>Ford</b> Vehicle Pick-Up & Delivery Allowance: <b>This allowance is only for <u>non-eligible</u> 2025 Remote Experience Program Dealers.</b> <b>NOTE:</b> This allowance is for dealer-performed vehicle Pick-Up & Delivery for dealership repairs only. Can only be claimed once, regardless of outstanding FSAs repaired.	25S19PP	0.5 Hours

**PARTS REQUIREMENTS / ORDERING INFORMATION**

Service Part Number	Claim Quantity	Package Order Quantity	Number in Package	Description
<b>All Vehicles</b>				
*7A100*	1	1	1	Main Control Valve Body ( <u>part varies by vehicle – use Ford E-Cat to identify the specific part number by VIN</u> )

Safety Recall 25S19

<b>Aviator</b>				
XT-12-QULV	As Required	1	1	Motorcraft® MERCON® ULV Automatic Transmission Fluid
<b>If Fails Inspection</b>				
HL3Z-7A191-B	1	1	1	Fluid Pan Gasket
MB3Z-7G186-A	1	1	1	Transmission Fluid Filter
7T4Z-7Z302-A	1	1	1	Transmission Fluid Filter Seal
HL3Z-7J227-A	1	1	1	Transmission Fluid Auxiliary Pump Tube O-ring

<b>Bronco</b>				
XT-12-QULV	As Required	1	1	Motorcraft® MERCON® ULV Automatic Transmission Fluid
W520214-S440	2	1	4	Sway Bar Disconnect Nuts
W721449-S439	2	1	4	Sway Bar Disconnect Bolts
W720545-S442	1	1	4	Transmission Fluid Heat Exchanger Tube Bolt (2.7L/3.0L)
<b>If Fails Inspection</b>				
HL3Z-7A191-B	1	1	1	Fluid Pan Gasket
HL3Z-7A098-A	1	1	1	Fluid Filter
7T4Z-7Z302-A	1	1	1	Transmission Fluid Filter Seal
LJ9Z-7J227-A	4	4	1	Transmission Fluid Heat Exchanger O-ring Seals (2.7L/3.0L)
HL3Z-7J227-A	1	1	1	Transmission Fluid Auxiliary Pump Tube O-ring (Auto-Start-Stop Vehicles)

Order your parts through normal order processing channels. To guarantee the shortest delivery time, an emergency order for parts must be placed.

Safety Recall 25S19

**PARTS REQUIREMENTS / ORDERING INFORMATION (continued)**

Service Part Number	Claim Quantity	Package Order Quantity	Number in Package	Description
<b>Explorer 10R60</b>				
XT-12-QULV	As Required	1	1	Motorcraft® MERCON® ULV Automatic Transmission Fluid
<b>If Fails Inspection</b>				
HL3Z-7A191-B	1	1	1	Fluid Pan Gasket
MB3Z-7G186-A	1	1	1	Transmission Fluid Filter
7T4Z-7Z302-A	1	1	1	Transmission Fluid Filter Seal
HL3Z-7J227-A	1	1	1	Transmission Fluid Auxiliary Pump Tube O-ring

<b>Explorer 10R80</b>				
XT-12-QULV	As Required	1	1	Motorcraft® MERCON® ULV Automatic Transmission Fluid
<b>If Fails Inspection</b>				
HL3Z-7A191-B	1	1	1	Fluid Pan Gasket
HL3Z-7A098-A	1	1	1	Transmission Fluid Filter
7T4Z-7Z302-A	1	1	1	Transmission Fluid Filter Seal

<b>Explorer 10R80 MHT</b>				
XT-12-QULV	As Required	1	1	Motorcraft® MERCON® ULV Automatic Transmission Fluid
W720545-S442	1	1	4	Transmission Fluid Cooler Tube Bolt

Order your parts through normal order processing channels. To guarantee the shortest delivery time, an emergency order for parts must be placed.

Safety Recall 25S19

**PARTS REQUIREMENTS / ORDERING INFORMATION (continued)**

Service Part Number	Claim Quantity	Package Order Quantity	Number in Package	Description
<b>Explorer 10R80 MHT Continued</b>				
<b>If Fails Inspection</b>				
L1MZ-7F396-A	1	1	1	Fluid Pan Gasket
L1MZ-7N265-A	2	2	1	Transmission Fluid Pan to Case Seals
BL8Z-7G199-A	2	2	1	Hybrid Drive Unit Feed Tube Seals
L1MZ-7J135-A	1	1	1	Transmission Fluid Auxiliary Pump Seal
L1MZ-7A098-B	1	1	1	Transmission Fluid Filter
7T4Z-7Z302-A	1	1	1	Transmission Fluid Filter Seal
5L7Z-7D285-A	1	1	2	Transmission Fluid Tube Seals
5L7Z-7J324-A	2	1	2	Transmission Fluid Tube Backing Rings

<b>F-150 10R80</b>				
XT-12-QULV	As Required	1	1	Motorcraft® MERCON® ULV Automatic Transmission Fluid
JL1Z-7N134-A	1	1	1	Park Override Lever Bolt
W711140-S901	3	3	1	Transmission Support Insulator Bolts (RWD)
W718353-S900	4	1	4	Transmission Support Insulator Bolts (4WD)
W709771-S440	2	2	1	Transmission Mount Nuts
W520114-S442	1	1	4	Transmission Support Crossmember Nuts
W714418-S439	1	1	4	Transmission Support Crossmember Bolts
<b>If Fails Inspection</b>				
HL3Z-7A191-B	1	1	1	Transmission Fluid Pan Gasket
HL3Z-7A098-A	1	1	1	Transmission Fluid Filter
7T4Z-7Z302-A	1	1	1	Transmission Fluid Filter Seal
HL3Z-7J227-A	1	1	1	Transmission Fluid Auxiliary Pump Tube O-ring (Auto-Start-Stop Vehicles)

Order your parts through normal order processing channels. To guarantee the shortest delivery time, an emergency order for parts must be placed.

Safety Recall 25S19

**PARTS REQUIREMENTS / ORDERING INFORMATION (continued)**

Service Part Number	Claim Quantity	Package Order Quantity	Number in Package	Description
<b>F-150 10R80 MHT</b>				
XT-12-QULV	As Required	1	1	Motorcraft® MERCON® ULV Automatic Transmission Fluid
W705443-S900	4	1	4	LH & RH Catalytic Converter Nuts
RL3Z-6L612-B	1	1	1	LH Exhaust Gasket
PL3Z-5C226-A	1	1	1	RH Exhaust Gasket
W722770-S900	2	1	4	LH Exhaust Studs
W707753-S900	2	1	4	RH Exhaust Studs
W714717-S439	2	1	4	Muffler Inlet Pipe Bolts
JL1Z-7N134-A	1	1	1	Park Override Lever Bolt
ML3Z-6775-K	1	1	1	Self-Adhesive Heat Shield
W520114-S442	4	1	4	Transmission Support Crossmember Nuts
W714418-S439	4	1	4	Transmission Support Crossmember Bolts
W709771-S440	2	2	1	Transmission Mount Nuts
W711140-S901	3	3	1	Transmission Support Insulator Bolts (RWD)
W718353-S900	1	1	4	Transmission Support Insulator Bolts (4WD)
VC-13DL-G	As Required	1	1	Motorcraft® Yellow Prediluted Antifreeze/Coolant
XL-1	As Required	1	1	Motorcraft® Penetrating and Lock Lubricant (5.0L ONLY)
XL2	As Required	1	1	Motorcraft® High-Temperature Nickel Anti-Seize Lubricant (5.0L ONLY)
<b>If Fails Inspection</b>				
L1MZ-7F396-A	1	1	1	Transmission Fluid Pan Gasket
BL8Z-7G199-A	2	2	1	Hybrid Drive Unit Feed Tube Seals
L1MZ-7A098-B	1	1	1	Transmission Fluid Filter
7T4Z-7Z302-A	1	1	1	Transmission Fluid Filter Seal
L1MZ-7J135-A	1	1	1	Transmission Fluid Auxiliary Pump Seal

Order your parts through normal order processing channels. To guarantee the shortest delivery time, an emergency order for parts must be placed.

Safety Recall 25S19

**PARTS REQUIREMENTS / ORDERING INFORMATION (continued)**

Service Part Number	Claim Quantity	Package Order Quantity	Number in Package	Description
<b>Mustang 10R80</b>				
XT-12-QULV	As Required	1	1	Motorcraft® MERCON® ULV Automatic Transmission Fluid
W715131-S437	1	1	4	Transmission Fluid Heat Exchanger Tube Bolt
XL-2	As Required	1	1	Motorcraft® High-Temperature Nickel Anti-Seize Lubricant (5.0L ONLY)
XL-1	As Required	1	1	Motorcraft® Penetrating and Lock Lubricant (5.0L ONLY)
FR3Z-4B496-B	3	3	1	Driveshaft To Pinion Flange Bolts and Retaining Straps (5.0L ONLY)
W500545-S439	3	1	4	Driveshaft To Transmission Flange Bolts (3 Bolt Type 5.0L ONLY)
N800594-S101	4	1	4	Driveshaft To Transmission Flange Bolts (4 Bolt Type 5.0L ONLY)
W717822-S439	2	1	4	Driveshaft Center Bearing Bolts (5.0L ONLY)
TA-25-B	As Required	1	1	Motorcraft® Threadlock and Sealer (5.0L Convertible ONLY)
BR3Z-5A231-B	2	2	1	Exhaust Clamps (5.0L ONLY)
<b>If Fails Inspection</b>				
HL3Z-7A191-B	1	1	1	Fluid Pan Gasket
HL3Z-7A098-A	1	1	1	Fluid Filter
7T4Z-7Z302-A	1	1	1	Transmission Fluid Filter Seal
LJ9Z-7J227-A	4	4	1	Transmission Fluid Heat Exchanger O-ring Seals
HL3Z-7J227-A	4	4	1	Transmission Fluid Auxiliary Pump Tube O-ring (Auto-Start-Stop Vehicles)
W719298-S439	3	1	4	Flex Coupling Bolts (5.0L ONLY)
W520114-S441	3	1	4	Flex Coupling Nuts (5.0L ONLY)

Order your parts through normal order processing channels. To guarantee the shortest delivery time, an emergency order for parts must be placed.

Safety Recall 25S19

**PARTS REQUIREMENTS / ORDERING INFORMATION (continued)**

Service Part Number	Claim Quantity	Package Order Quantity	Number in Package	Description
<b>Ranger 10R60</b>				
XT-12-QULV	As Required	1	1	Motorcraft® MERCON® ULV Automatic Transmission Fluid
W720545-S442	1	1	4	Transmission Fluid Heat Exchanger Tube Bolt
<b>If Fails Inspection</b>				
HL3Z-7A191-B	1	1	1	Fluid Pan Gasket (PBW) Park by Wire
HL3Z-7A098-A	1	1	1	Fluid Filter (PBC) Park by Cable
MB3Z-7G186-A	1	1	1	Fluid Filter (PBW) Park by Wire
7T4Z-7Z302-A	1	1	1	Transmission Fluid Filter Seal
LJ9Z-7J227-A	4	4	1	Transmission Fluid Heat Exchanger O-ring Seals
HL3Z-7J227-A	1	1	1	Transmission Fluid Auxiliary Pump Tube O-ring (Auto-Start-Stop Vehicles)

Order your parts through normal order processing channels. To guarantee the shortest delivery time, an emergency order for parts must be placed.

**DEALER PRICE**

For the latest prices, refer to DOES II.

**PARTS RETENTION, RETURN, & SCRAPPING**

Follow the provisions of the Warranty and Policy Manual, Section 1 - WARRANTY PARTS RETENTION AND RETURN POLICIES. If a replaced part receives a scrap disposition, the part must be scrapped by all applicable local, state, and federal environmental protection and hazardous material regulations. Federal law prohibits selling motor vehicle parts or components that are under safety, compliance, or emissions recall.

**EXCESS STOCK RETURN**

The excess stock returned for credit must have been purchased from Ford Customer Service Division by Policy Procedure Bulletin 4000.

**REPLACED FSA PARTS INSPECTION AND SIGN OFF**

Effective March 1<sup>st</sup>, 2021, all parts replaced as part of an FSA repair with a repair order open date of March 1<sup>st</sup>, 2021, or later must be inspected and signed off on the repair order by a member of your dealer fixed operations management team or an employee of the task has been delegated to. If the task is to be delegated to a non-management employee, the employee needs to be someone other than the technician who completed the repair and needs to understand the importance of completing this task consistently and accurately.

**Safety Recall 25S19**

- All parts replaced as part of an FSA repair should be returned to the parts department following the Warranty Parts Retention and Return Policies.
- Inspect the replaced parts to verify the FSA repair was completed.
- If the FSA repair is found to be complete, the designated employee signs the repair order line or parts return stamp area (electronic or hand signed) for the FSA repair indicating the parts were inspected and validated to have been replaced.
- After the parts have been inspected, they should be handled based on the guidance in the parts status report in the Online Warranty System (Hold, Return, CORE, Scrap, etc.). Please visit FMCDEALER > PARTS & SERVICE > WARRANTY ADMINISTRATION & WARRANTY PARTS RETURN for the latest [Immediate Scrap List](#) information.
- This process is subject to review during warranty audits for FSA repairs with a repair order open date of March 1<sup>st</sup>, 2021, or later. Any eligible FSA claims requiring parts replacement found not to have been inspected and signed off during a warranty audit will be subject to chargeback and consideration for enrollment into the Dealer Incomplete Recall Repair Process.

**Note:** Other approvals (electronic or handwritten) for add-on repair lines, dealer-owned vehicle repairs, and repeat repairs do not qualify as FSA parts inspection approvals. The post-repair FSA parts inspection process (electronic or handwritten) is independent of other warranty approval requirements. The approval by the designated employee implies that the FSA parts were found to be replaced and must be able to be identified on the Repair Order. If multiple FSAs require approval on a single Repair Order, each applicable occurrence will require individual post-repair approval by the designated employee.

## **CERTAIN 2025 MODEL YEAR AVIATOR, 2024-2025 MODEL YEAR BRONCO, 2025 MODEL YEAR EXPLORER, 2024-2025 MODEL YEAR F-150, 2025 MODEL YEAR MUSTANG AND 2024 MODEL YEAR RANGER VEHICLES — MAIN CONTROL VALVE BODY REPLACEMENT**

**IMPORTANT!** The Service Technician Specialty Training (STST) Competency 10 certification requirement in the U.S. market only will be enforced starting with repair orders opened on or after August 31, 2024. Field Service Action (FSA) repairs will reject and the claim will not be paid if the repairing technician is not certified in STST Competency 10 FSA. See Electronic Field Communication (EFC)15936 for more details.

### **SERVICE PROCEDURE**

1. Replace the Main Control Valve Body in the transmission. Follow Workshop Manual (WSM) procedures in Section 307-01.

**IMPORTANT NOTE:** Federal law prohibits selling motor vehicle parts or components that are under safety, compliance, or emissions recall. Unless a part is requested to be returned to Ford, all parts replaced under this FSA must be scrapped in accordance with all applicable local, state and federal environmental protection and hazardous material regulations. Refer to the Parts Retention, Return, & Scrapping section of the FSA dealer bulletin for further information.



**NEW VEHICLE DEMONSTRATION / DELIVERY HOLD -Safety Recall 25S19**

Certain 2025 Model Year Aviator, 2024-2025 Model Year Bronco, 2025 Explorer, and 2024-2025 Model Year F-150, 2025 Model Year Mustang, and 2024 Model Year Ranger Vehicles  
Transmission Main Control Valve Body Replacement

**Mobile Service Repair Assessment**

Assessment levels have been identified to help determine the ease of performing eligible mobile service repairs for a Field Service Action (FSA) outside of the dealership service facility.

**Dealer Bulletin**

Within the Administrative Information Attachment of the dealer bulletin a mobile service repair assessment level(s) will be provided. These assessment levels have been determined using the amount of time, equipment and labor identified to perform the intended service action.

**Assessment Levels**

-  - Mobile Reprogramming (MRA1)
-   - Light Mobile Service (MRA2)
-    - Enhanced Mobile Service (MRA3)
-     - Advanced Mobile Service (MRA4)
-  - Not a Mobile Service Repair (MRA5)
-  - Wheel and Tire Mobile Service (MRA6)
-  - Advanced Driver Assistance System (ADAS) Mobile Repair (MRA7)

**Description of each level that is used to determine the overall assessment.**

-  – Mobile Reprogramming (MRA1)
  - Module Programming or similar type services
  - Minimum tools maybe required other than an **IDS/FDRS** setup
  - FDRS programming that requires internet connection (wi-fi or mobile hotspot)
  - Make sure vehicle has a charge port to ensure battery voltage is maintained during flashing of the module(s)
  - Repairs not greater than 1 hour in length (including time to wait for programming)

*Note: The location will need a charging station or wall box to maintain the 12-volt battery.*
-   – Light Mobile Service (MRA2)
  - Interior repair procedures that do not require seat, dash, or headliner removal
  - Under hood repairs that do not require large component removal
  - Exterior repairs that do not require large component/panel removal
  - Repairs may require standard hand tools (Access to a Technician starter kit or similar)

**NEW VEHICLE DEMONSTRATION / DELIVERY HOLD -Safety Recall 25S19**

Certain 2025 Model Year Aviator, 2024-2025 Model Year Bronco, 2025 Explorer, and 2024-2025 Model Year F-150, 2025 Model Year Mustang, and 2024 Model Year Ranger Vehicles  
Transmission Main Control Valve Body Replacement

   – Enhanced Mobile Service (MRA3)

- **A two-person process is required anytime a procedure requires work under the vehicle**
- Brake Inspection and Brake Repair/Replacement
- Limited Suspension Component replacement (no alignment)
- Under Vehicle access for limited repairs (no large component removal)
- Vehicle Check Up - VCU
- Pre-Delivery Inspection - PDI
- Used Car Inspection/Presale Inspection
- May require floor jack, jack stands, and impact tools

*Note: Wheel lock may be required.*

    – Advanced Mobile Service (MRA4)

- Fluid Exchange/Oil Change
- Light Repairs
- Brake Hydraulic Repairs

 – Not a Mobile Service Repair (MRA5)

1. Large component removal
2. BEV Battery Replacement
3. Requires a vehicle hoist – to complete the repair (more than inspection)
4. Required vehicle alignment
5. Requires significant vehicle disassembly
6. Repairs greater than 2-3 hours
7. Any repairs that require M-Time
8. Includes a service procedure where the vehicle owner may be distressed about the state of their vehicle.

 – Wheel and Tire Mobile Service (MRA6)

- Tire Removal from Wheel
- Tire Balancing
- Tire Repair

*Note: Specialized Mobile Service unit and equipment including Tire balancer and Tire Changer required.*

 – Advanced Driver Assistance System (ADAS) Mobile Repair (MRA7)

- Requires the uses of a ADAS Mobile Service Kit.
- May require a post repair test drive.
  - Parking Lot Maneuvers to capture parking lines for camera alignment.
  - Steady speed cruising (45 MPH).
- **The vehicle service location will have to be validated before scheduling an appointment to determine if a mobile repair is appropriate.**

25S19

## Mobile Repair / Vehicle Pick-Up and Delivery Record

VIN \_\_\_\_\_ received (check one):

- Mobile Repair
- Pick-up and/or delivery service

As outlined below for the 25S19 Field Service Action program.

Mobile Repair – Date: \_\_\_\_\_

OR

Pick-up – Date: \_\_\_\_\_

Delivery – Date: \_\_\_\_\_

\_\_\_\_\_  
Repair Order #

\_\_\_\_\_  
Repair Order Date

\_\_\_\_\_  
Service Manager Signature

\_\_\_\_\_  
Date

**Ford Motor Company**  
**Recall Reimbursement Plan for 25S19**

*Ford and Lincoln dealers are in the best position to quickly and efficiently process reimbursement requests. However, federal legislation requires all motor vehicle manufacturers to establish processes through which customers may seek recall reimbursement directly from the manufacturer or the dealers.*

*Regarding the specific reimbursement plan for Recall # 25S19, owners who have paid for service to remedy the defect or noncompliance must have had that service performed before May 2, 2025. After this date, if repairs related to this recall are performed by a non-Ford repair facility in an emergency, customers must submit any refund requests through their dealership. As required by this federal regulation, Ford Motor Company submitted the details of its latest General Recall Reimbursement Plan in a letter to the National Highway Traffic Safety Administration (NHTSA) in May 2021. The following is the text of that letter and the Plan:*

**General Recall Reimbursement Plan**  
(As submitted to the NHTSA)

Pursuant to the requirements set forth in 49 CFR Part 573 and Part 577 of the Code of Federal Regulations, Ford Motor Company (Ford) is submitting required information pertaining to our general reimbursement plan for the cost of remedies paid for by vehicle owners before they are notified of a related safety recall.

Set forth below is Ford's general plan to reimburse owners and purchasers for costs incurred for remedies in advance of notification of potential safety-related defects or noncompliances pursuant to Part 573.6 (c)(8)(i). This plan has not changed since our May 5, 2021 submission.

Reimbursement Notification

Ford's notice to a vehicle owner in accordance with 49 CFR Part 577 will indicate that Ford is offering a refund if the owner paid to have service to remedy the defect or noncompliance prior to a specified ending date. In accordance with Part 573.13 (c)(2), this ending date will be defined as a minimum of ten calendar days after the date on which Ford mailed the last of its Part 577 notifications to owners and will be indicated in the specific reimbursement plan available to owners for an individual recall. This notice will direct owners to seek eligible reimbursement through authorized dealers or, at their option, directly through Ford at the following address:

Ford Motor Company  
P.O. Box 6251  
Dearborn, MI 48121-6251

Ford notes that this rule allows for the identification of a beginning date for reimbursement eligibility. Under the rule, an owner who paid to remedy the defect or noncompliance prior to the identified beginning date would not be eligible for reimbursement. Ford generally has not established such a beginning date for reimbursement eligibility and does not presently anticipate changing this general policy. However, in any case where Ford determines a beginning date is appropriate, Ford will indicate that date in the owner notice. As permitted by 577.11(e), Ford may not include a reimbursement notification when all vehicles are well within the warranty period, subject to approval by the Agency.

## Costs to be Reimbursed

For vehicles, reimbursement will not be less than the lesser of:

- The amount paid by the owner for the remedy that specifically addressed and was reasonably necessary to correct the defect or noncompliance that is the subject of the recall, or
- The cost of parts for the remedy (to be no more than the manufacturer's list retail price for authorized part(s), plus associated labor at local labor rates, miscellaneous fees (such as disposal of waste) and taxes.

For replacement equipment, reimbursement will be the amount paid by the owner for the replacement item (limited by the amount of the retail list price of the defective or noncompliant item that was replaced, plus taxes, where the brand or model purchased by the owner was different than the brand or model that was the subject of the recall). If the item of motor vehicle equipment was repaired, the reimbursement provisions identified above for vehicles will apply.

Ford notes that costs incurred by the owner within the period during which Ford's original or extended warranty would have provided for a free repair of the problem will not be eligible for reimbursement, as provided by Part 573.13 (d)(1).

## Entities Authorized to Provide Reimbursement

Ford will continue to use authorized dealers to reimburse owners under the specific reimbursement plans for a particular recall and will encourage owners to pursue requests for reimbursement directly through dealers to expedite reimbursement. Ford will also provide a mailing address to which customers can, at their option, send requests for reimbursement directly to Ford, as previously noted. Requests for reimbursement sent directly to Ford may take up to 60 days to process. Whether the owner chooses to pursue reimbursement requests through a dealer or directly through Ford, the owner will be directed to submit the required documentation, upon which reimbursement eligibility will be determined.

## Required Documentation

The reimbursement determination will depend upon the information provided by the customer. Consistent with Part 573.13 (d)(4) the following information must be submitted:

- Claimant name and address
- Vehicle make, model and model year
- Vehicle identification number (VIN) and, for replacement equipment, a description of such equipment or, for tires, the model, size and TIN (DOT code)
- Identification of the recall number (either the Ford recall number or the NHTSA recall number)
- Identification of the owner of the recalled vehicle at the time that the pre-notification remedy was obtained
- An original receipt for the pre-notification remedy that includes a breakdown of the amount for parts, labor, other costs and taxes, including costs for the replacement item. Where the receipt covers work other than to address the recall or noncompliance, Ford may require the claimant to separately identify costs that are eligible for reimbursement.
- If the remedy was obtained during the warranty repair did not correct the problem related to the recall

Failure to submit all the above information may result in denial of the reimbursement request.

Additional Information

The Part 577 required owner notice will provide a toll-free telephone number through which specific information about the reimbursement plan can be requested from Ford. This general reimbursement plan will be incorporated into notifications pursuant to Part 573.6 by reference. Information specific to an individual recall also may be incorporated into the Part 573.6 notification.