

STEVE DEGRAZIO – HEAD OF QUALITY

July 7th, 2025
Subject: Recall RP1063
TO: All U.S Sales and Service Points

NEW VEHICLES IN RETAILER INVENTORY

It is against Polestar policy for a retailer to deliver any new Polestar that is eligible for a recall. Service Points are advised to check all vehicles in inventory for recall eligibility and repair immediately. All vehicles in your new vehicle inventory must be corrected/updated before delivery.

What does this mean for customers?

Customers will not be able to take delivery of affected vehicles until the recall has been completed.

When will this be resolved?

Polestar Automotive USA, on behalf of Polestar Performance AB, have decided to launch Recall RP1063 on certain model year 2025 Polestar 3 vehicles.

Polestar has identified that the inline connector located between the engine bay cable harness the front bumper cable harness may experience water ingress into the connector housing, which has led to corrosion on the connector pins.

As a result, water entering the connector housing may affect the vehicles' electrical systems, increasing the risk of a crash or injury.

To remedy the affected vehicles, Polestar will replace the entire front bumper cable harness

AND

- Replace the two inline front bumper/engine bay connectors (left and right) on the engine bay harness.

**VIN start: YSREA3YBXXXXXXXXX VIN end: YSREE3YBXXXXXXXXXX
Chassis start: xxxxxxxx Chassis end: xxxxxxxx**

OR

- Replace the male side of the inline front bumper/engine bay connector on the engine bay cable harness.

**VIN start: YSREA3YBXXXXXXXXX VIN end: YSREE3YBXXXXXXXXXX
Chassis start: xxxxxxxx Chassis end: xxxxxxxx**

A total of 969 U.S. Vehicles is affected by this recall.

Important Note:

- When performing wire splicing, ensure that the wire is free from corrosion. If any oxidation or contamination is present, clean the wire thoroughly before proceeding.
- If oxidation or discoloration is found on the wire, it is not necessary to replace the entire wire. Clean only the section of the wire where the splice will be made.

Vehicle eligibility must be confirmed:

- Vehicle Inquiry – Warranty Vehicle Inquiry where the message "Recall RP1063 PS3 Cable Harness" will appear for eligible vehicles, F4=History from the main Inquiry menu must be selected to confirm Recall RP1063 has not been completed. Eligibility can also be confirmed in VIDA.
- Recall RP1063 eligible vehicles not yet delivered to end customers must be corrected prior to delivery.

All vehicles must be checked for any incomplete Recalls, Service Campaigns or Service Actions. All open Recall, Service Campaigns or Service Action repairs must be completed.

OWNER NOTIFICATION

An owner's notification letter will be sent out mid-August that will notify the owner of this recall instructing them to contact their Service Point and request an appointment to have this repair completed free of charge.

PORT VEHICLES

NOT all eligible vehicles arriving from the ports will have this recall completed. Vehicle eligibility must be confirmed.

PARTS / PARTS RETURN

Please refer to Parts Bulletin RP1063 which will be released shortly.
No parts are required to be returned for this recall.

CLAIM SUBMISSION

A Quality Bulletin will be released shortly. Please refer to the claim submission information in the Quality Bulletin.

SERVICE POINT RESPONSIBILITIES

Service Point must perform this recall campaign on eligible vehicles regardless of miles/kilometers or vehicle age. All work performed under this recall is free of charge to the owner. As the safety of our customers is our utmost priority, we are taking full responsibility to ensure the highest quality and safety standards for our cars.

If you have questions about this recall or any other field service action, please contact me or any member of Customer Support.

Your cooperation in completing this important recall is greatly appreciated.

Best regards,



Steve DeGrazio
Head of Quality
201-981-7066
Steve.degrazio@polestar.com