



RECALL

MY24 Brake Line Inspection

Zero Motorcycles has decided that a defect, which relates to motor vehicle safety, exists in certain model year 2024 Zero DS, Zero DSR, Zero DSRP, and Zero DSR/X motorcycles produced with the front brake line from the Hydraulic Control Unit (HCU) to front left caliper twisted 180°, which restricts the designed flexibility through the “p-clamps” causing it to rub and damage the outer layers of the brake line potentially leading to brake fluid leakage and possible loss of brake pressure. A loss of brake pressure will reduce braking ability increasing the risk of a crash.

In response, we have launched a Recall (Campaign 25V-459). All affected vehicles in your inventory should be immediately inspected. Support cases for all affected models have already been created and are available to view in the Dealer Portal. Consumers that own affected vehicles will be notified directly and directed to their closest dealer for inspection and repair as needed. For full details on and next steps please see the bulletin SV-RCL-025-017 which is available in the 2025 Dealer Binder in the Customer Service Tools folder and via the button below:

[RECALL BULLETIN SV-RCL-025-017](#)